

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
1	FD	1FL-FD1	60x15	Air Balance	Unknown	Pass	N/A	Added More Access
2	SD	1FL-SD1	60x15	Air Balance	Unknown	Pass	N/A	Zone SR
3	FD	1FL-FD2	13" R	Air Balance	Unknown	Pass	N/A	None
4	SD	1FL-SD2	13" R	Air Balance	Unknown	Pass	N/A	Zone 1
5	FD	1FL-FD3	9" R	Air Balance	Unknown	Pass	N/A	None
6	SD	1FL-SD3	9" R	Air Balance	Unknown	N/A	N/A	Abandoned per JCI
7	FD	1FL-FD4	22x12	Air Balance	Unknown	Pass	N/A	Repaired
8	FD	1FL-FD5	12x6	Air Balance	Unknown	Pass	N/A	None
9	FD	1FL-FD6	13" R	Air Balance	Unknown	Pass	N/A	Changed Fusible Link
10	SD	1FL-SD6	13" R	Air Balance	Unknown	Pass	N/A	Zone 8
11	FD	1FL-FD7	60x15	Air Balance	Unknown	N/A	N/A	Fragile water lines blocking access
12	SD	1FL-SD7	60x15	Air Balance	Unknown	Pass	N/A	Zone NR
13	FD	1FL-FD8	11" R	Air Balance	Unknown	Pass	N/A	Changed Fusible Link
14	SD	1FL-SD8	11" R	Air Balance	Unknown	Pass	N/A	Zone 2
15	FD	1FL-FD9	10" R	Air Balance	Unknown	Pass	N/A	None
16	SD	1FL-SD10	7" R	Air Balance	Unknown	Pass	N/A	Zone 4
17	SD	1FL-SD11	8" R	Air Balance	Unknown	Pass	N/A	Zone 5
18	FD	1FL-FD12	13" R	Air Balance	Unknown	Pass	N/A	Changed Fusible Link
19	SD	1FL-SD12	13" R	Air Balance	Unknown	Pass	N/A	Zone 6
20	FD	1FL-FD13	14X7	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz/ Larry Coreno  
Inspection Dates: 4/5/23, 4/18/23  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
24	FD	2FL-FD1	60x15	Air Balance	Unknown	Pass	N/A	None
25	SD	2FL-SD1	60x15	Air Balance	Unknown	Pass	N/A	None
26	FD	2FL-FD2	10x12	Air Balance	Unknown	Pass	N/A	None
27	FD	2FL-FD3	10" R	Air Balance	Unknown	Pass	N/A	None
28	SD	2FL-SD3	10" R	Air Balance	Unknown	Pass	N/A	None
29	FD	2FL-FD4	12" R	Air Balance	Unknown	Pass	N/A	None
30	SD	2FL-SD4	12" R	Air Balance	Unknown	Pass	N/A	None
31	FD	2FL-FD5	12" R	Air Balance	Unknown	Pass	N/A	None
32	SD	2FL-SD5	12" R	Air Balance	Unknown	Pass	N/A	None
33	FD	2FL-FD6	28x6	Air Balance	Unknown	Pass	N/A	None
34	FD	2FL-FD7	8x6	Air Balance	Unknown	Pass	N/A	None
35	FD	2FL-FD8	13" R	Air Balance	Unknown	Pass	N/A	None
36	SD	2FL-SD8	13" R	Air Balance	Unknown	Pass	N/A	None
37	FD	2FL-FD9	15" R	Air Balance	Unknown	Pass	N/A	None
38	SD	2FL-SD9	15" R	Air Balance	Unknown	Pass	N/A	None
39	FD	2FL-FD10	10x6	Air Balance	Unknown	Pass	N/A	None
40	FD	2FL-FD11	14" R	Air Balance	Unknown	Pass	N/A	None
41	SD	2FL-SD11	14" R	Air Balance	Unknown	Pass	N/A	None
42	FD	2FL-FD12	10" R	Air Balance	Unknown	Pass	N/A	None
43	SD	2FL-SD12	10" R	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz/ Larry Coreno  
Inspection Dates: 4/4/23, 4/5/23  
Facility: Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
50	FD	3FL-FD1 North	14" Round	Air Balance	Unknown	Pass	N/A	None
51	FD	3FL-FD2 North	11x7	Air Balance	Unknown	Pass	N/A	None
52	FD	3FL-FD3 North	10x4	Air Balance	Unknown	Pass	N/A	None
53	FD	3FL-FD4 North	48x15	Air Balance	Unknown	Pass	N/A	None
54	SD	3FL-SD4 North	48x15	Air Balance	Unknown	Pass	N/A	None
55	FD	3FL-FD5 North	16x8	Air Balance	Unknown	Pass	N/A	None
56	SD	3FL-SD6 North	9" Round	Air Balance	Unknown	Pass	N/A	None
57	FD	3FL-FD6 North	9" Round	Air Balance	Unknown	Pass	N/A	None
58	FD	3FL-FD8 North	36x15	Air Balance	Unknown	Pass	N/A	None
59	SD	3FL-SD8 North	36x15	Air Balance	Unknown	Pass	N/A	None
60	FD	3FL-FD9 North	14" Round	Air Balance	Unknown	Pass	N/A	None
61	SD	3FL-SD9 North	14" Round	Air Balance	Unknown	Pass	N/A	None
62	FD	3FL-FD10 North	26x10	Air Balance	Unknown	Pass	N/A	None
63	FD	3FL-FD11 North	14" Round	Air Balance	Unknown	Pass	N/A	None
64	FD	3FL-SD13 North	48x12	Air Balance	Unknown	Pass	N/A	None
65	FSD	3FL-FSD1 North	16x12	Ruskin	FSD36	Pass	N/A	Has Test Switch
66	FSD	3FL-FSD2 North	16" Round	Ruskin	FSDR26	Pass	N/A	Has Test Switch

Inspector: Julie Gue/ Dan Tulcewicz/ Larry Coreno  
Inspection Dates: 4/3/2023

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
67	FD	3FL-FD1 South	10" Round	Air Balance	Unknown	Pass	Pass	None
68	SD	3FL-SD1 South	10" Round	Air Balance	Unknown	Pass	Pass	Zone 11
69	FD	3FL-FD2 South	16x8	Air Balance	Unknown	Pass	Pass	None
70	SD	3FL-SD2 South	16x8	Air Balance	Unknown	Pass	Pass	Zone SWR
71	SD	3FL-SD3 South	12" Round	Air Balance	Unknown	Pass	Pass	Zone 10
72	SD	3FL-SD4 South	10" Round	Air Balance	Unknown	Pass	Pass	Zone 14
73	FD	3FL-FD5 South	48x15	Air Balance	Unknown	Pass	Pass	None
74	SD	3FL-SD5 South	48x15	Air Balance	Unknown	Pass	Pass	Zone SWR
75	FD	3FL-FD6 South	13" Round	Air Balance	Unknown	Pass	Pass	None
76	SD	3FL-SD6 South	13" Round	Air Balance	Unknown	Pass	Pass	Zone 8
77	FD	3FL-FD7 South	14" Round	Air Balance	Unknown	Pass	Pass	None
78	SD	3FL-SD7 South	14" Round	Air Balance	Unknown	Pass	Pass	Zone 9
79	FD	3FL-FD8 South	46x12	Air Balance	Unknown	Pass	Pass	None
80	SD	3FL-SD8 South	46X12	Air Balance	Unknown	Pass	Pass	Zone SER
81	FD	3FL-FD9 South	38x10	Air Balance	Unknown	Pass	Pass	None
82	SD	3FL-SD9 South	38x10	Air Balance	Unknown	Pass	Pass	Zone SER

Inspector: Julie Gue/ Dan Tulcewicz  
Inspection Dates: 4/3/2023  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
83	SD	4FL-SD1 North	42x12	Air Balance	Uknkown	Pass	Pass	Zone NWR
84	FD	4FL-FD2 North	9" R	Air Balance	Uknkown	Pass	Pass	None
85	SD	4FL-SD2 North	9" R	Air Balance	Uknkown	Pass	Pass	Zone 2
86	FD	4FL-FD3 North	14x6	Air Balance	Uknkown	Pass	Pass	None
87	SD	4FL-SD3 North	14x8	Air Balance	Uknkown	N/A	N/A	Abandoned per JCI
88	FD	4FL-FD4 North	14x6	Air Balance	Uknkown	Pass	Pass	None
89	SD	4FL-SD4 North	14x6	Air Balance	Uknkown	N/A	N/A	Abandoned per JCI
90	FD	4FL-FD5 North	22" R	Air Balance	Uknkown	Pass	Pass	None
91	SD	4FL-SD5 North	22" R	Air Balance	Uknkown	Pass	Pass	Zone 1
92	FD	4FL-FD6 North	42x12	Air Balance	Uknkown	Pass	Pass	None
93	SD	4FL-SD6 North	42x12	Air Balance	Uknkown	Pass	Pass	Zone NER
94	SD	4FL-SD7 North	10x6	Air Balance	Uknkown	Pass	Pass	Zone NER
95	FD	4FL-FD8 North	16"	Air Balance	Uknkown	Pass	Pass	None
96	SD	4FL-SD8 North	16"	Air Balance	Uknkown	Pass	Pass	Zone 3
20								

Inspector: Julie Gue/ Dan Tulcewicz/ Larry Coreno  
Inspection Dates: 3/31/23,4/18/23  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
97	FD	4FL-FD1 South	12" Round	Air Balance	Unknown	Pass	N/A	None
98	FD	4FL-FD2 South	20x10	Air Balance	Unknown	Pass	N/A	None
99	FD	4FL-FD3 South	15x10	Air Balance	Unknown	Pass	N/A	None
100	SD	4FL-SD3 South	15x10	Air Balance	Unknown	Pass	N/A	Zone 9
101	SD	4FL-SD4 South	60x12	Air Balance	Unknown	Pass	N/A	Zone SWR
102	SD	4FL-SD6 South	48x12	Air Balance	Unknown	N/A	N/A	Abandoned per JCI
103	FD	4FL-FD7 South	38x10	Air Balance	Unknown	Pass	N/A	None
104	FD	4FL-FD8 South	12" Round	Air Balance	Unknown	Pass	N/A	None
105	FD	4FL-FD9 South	34x12	Air Balance	Unknown	Pass	N/A	None
106	SD	4FL-SD9 South	34x12	Air Balance	Unknown	Pass	N/A	Zone SER
107	SD	4FL-SD10 South	32x10	Air Balance	Unknown	N/A	N/A	Abandoned per JCI
108	FD	4FL-FD11 South	14" Round	Air Balance	Unknown	Pass	N/A	None
109	SD	4FL-SD12 South	14x6	Air Balance	Unknown	N/A	N/A	Abandoned per JCI
110	SD	4FL-SD13 South	20x6	Air Balance	Unknown	N/A	N/A	Abandoned per JCI
111	FD	4FL-FD14 South	48x24	Air Balance	Unknown	Pass	N/A	None
112	SD	4FL-SD14 South	48x24	Air Balance	Unknown	N/A	N/A	Abandoned per JCI
113	SD	4FL-SD15 South	12" R	Air Balance	Unknown	Pass	N/A	None
114	SD	4FL-SD16 South	44x12	Air Balance	Unknown	N/A	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz/ Larry Coreno  
Inspection Dates: 3/31/23,4/18/23  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
115	FD	6FL FD1 North	6" R	Air Balance	Unknown	Pass	N/A	None
116	FD	6FL FD2 North	20x16	Ruskin	Unknown	Pass	N/A	None
117	FD	6FL FD3 North	60x12	Air Balance	Unknown	Pass	N/A	larger access
118	SD	6FL SD3 North	60x12	Air Balance	Unknown	Pass	N/A	None
119	SD	6FL SD4 North	9" R	Air Balance	Unknown	Pass	N/A	Zone 13
120	FD	6FL FD5 North	16" R	Air Balance	Unknown	Pass	N/A	None
121	SD	6FL SD5 North	16" R	Air Balance	Unknown	Pass	N/A	None
122	FD	6FL FD6 North	32x10	Air Balance	Unknown	Pass	N/A	None
123	FD	6FL FD7 North	10x6	Air Balance	Unknown	Pass	N/A	None
124	SD	6FL SD8 North	6" R	Prefco Products	Unknown	Pass	N/A	Zone 1
125	SD	6FL SD9 North	14" R	Prefco Products	Unknown	Pass	N/A	Zone 1
126	SD	6FL SD10 North	18x8	Air Balance	Unknown	Pass	N/A	Zone 14R
127	SD	6FL SD11 North	30x10	Air Balance	Unknown	Pass	N/A	Zone NWR
128	SD	6FL SD12 North	16" Round	Air Balance	Unknown	Pass	N/A	None
129	SD	6FL SD13 North	24x12	Air Balance	Unknown	Fail	N/A	Pneumatic lines between damper and sleeve
130	SD	6FL-SD14 North	24x12	Air Balance	Unknown	Fail	N/A	Pneumatic lines between damper and sleeve
131	SD	6FL-SD15 North	24x10	Prefco Products	Unknown	Pass	N/A	Zone 2
132	SD	6FL-SD16 North	8x8	Prefco Products	Unknown	Pass	N/A	Zone 2
133	SD	6FL-SD17 North	12x12	Prefco Products	Unknown	Pass	N/A	Zone 1
134	SD	6FL-SD18 North	22x8	Air Balance	Unknown	Pass	N/A	Zone 1

Inspector: Julie Gue/ Dan Tulcewicz/ Larry Coreno  
Inspection Dates: 28-Mar-23  
Facility: Justice Center Jail 1

SA = Supply Air  
 RA = Return Air  
 EA = Exhaust Air  
 FD = Fire Damper  
 SD = Smoke Damper  
 FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
138	SD	6FL SD1 South	16" R	Air Balance	Unknown	Pass	N/A	Zone 5
139	SD	6FL SD2 South	14x8	Unknown	Unknown	Pass	N/A	Zone 5
140	SD	6FL SD3 South	24x8	Air Balance	Unknown	Pass	N/A	Zone 5
141	FD	6FL FD4 South	16" R	Air Balance	Unknown	Pass	N/A	None
142	FD	6FL FD5 South	60x12	Air Balance	Unknown	Pass	N/A	None
143	SD	6FL SD5 South	60x12	Air Balance	Unknown	Pass	N/A	Zone SER
144	FD	6FL FD6 South	16x6	Air Balance	Unknown	Pass	N/A	None
145	FD	6FL FD7 South	26x12	Air Balance	Unknown	Pass	N/A	None
146	SD	6FL SD8 South	8" R	Unknown	Unknown	Pass	N/A	Zone R6
147	SD	6FL SD9 South	18x8	Prefco Products	Unknown	Pass	N/A	Zone R6
148	SD	6FL SD10 South	18x8	Air Balance	Unknown	Pass	N/A	Zone R6
149	FD	6FL FD11 South	8" R	Air Balance	Unknown	Pass	N/A	None
150	SD	6FL SD11 South	8" R	Air Balance	Unknown	Pass	N/A	Zone 13
151	FD	6FL FD12 South	14" Round	Air Balance	Unknown	Pass	N/A	None
152	SD	6FL SD12 South	14" Round	Air Balance	Unknown	Pass	N/A	Zone 12
153	SD	6FL SD13 South	28x10	Air Balance	Unknown	Pass	N/A	Zone 12
154	SD	6FL SD14 South	18" R	Prefco Products	Unknown	Pass	N/A	Zone 11
155	SD	6FL SD15 South	28x8	Air Balance	Unknown	Pass	N/A	Zone SWR
156	SD	6FL SD16 South	20x10	Air Balance	Unknown	Pass	N/A	None
157	SD	6FL FD17 South	54X12	Air Balance	Unknown	N/A	N/A	No access to damper/No options

Inspector: Julie Gue/ Dan Tulcewicz/ Larry Careno  
Inspection Dates: 27-Mar-23  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
168	FD	7FL-FD1 North	6" R	Air Balance	Unknown	Pass	N/A	None
169	SD	7FL-SD2 North	12x8	Air Balance	Unknown	Pass	N/A	Zone 13R
170	SD	7FL-SD3 North	13" Round	Air Balance	Unknown	Pass	N/A	None
171	SD	7FL-SD4 North	54x12	Air Balance	Unknown	Pass	N/A	Zone NWR
172	FD	7FL-FD5 North	17" R	Air Balance	Unknown	Pass	N/A	None
173	SD	7FL-SD5 North	16" R	Air Balance	Unknown	Pass	N/A	Zone 3R
174	SD	7FL-SD6 North	8" Round	Air Balance	Unknown	Pass	N/A	Zone 12
175	FD	7FL-FD7 North	22x8	Air Balance	Unknown	Pass	N/A	Added access
176	FD	7FL-FD8 North	12x6	Air Balance	Unknown	Pass	N/A	None
177	SD	7FL-SD9 North	22x8	Air Balance	Unknown	Pass	N/A	Repaired W/JCI
178	SD	7FL-SD10 North	28x12	Air Balance	Unknown	Pass	N/A	Zone 2R
179	SD	7FL-SD11 North	16" R	Air Balance	Unknown	Pass	N/A	Repaired W/JCI
180	SD	7FL-SD12 North	6" R	Air Balance	Unknown	Pass	N/A	Zone 3R
181	SD	7FL-SD13 North	24x10	Air Balance	Unknown	Pass	N/A	Zone 3R
182	FD	7FL-FD14 North	6x4	Air Balance	Unknown	Pass	N/A	Zone 3R
183	SD	7FL-SD15 North	22x12	Air Balance	Unknown	Pass	N/A	Zone 5
184	SD	7FL-SD16 North	22x8	Air Balance	Unknown	Pass	N/A	Zone 2
185	SD	7FL-SD17 North	26x12	Air Balance	Unknown	Pass	N/A	Zone 5
186	SD	7FL-SD18 North	12x10	Air Balance	Unknown	Pass	N/A	None
187	SD	7FL-SD19 North	6" R	Air Balance	Unknown	Pass	N/A	None
188	FD	7FL-FD20 North	14" R	Air Balance	Unknown	Pass	N/A	None
189	SD	7FL-SD20 North	14" R	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: March 23, 2023 and April 11, 2023  
Facility: Justice Center Jail 1

SA = Supply Air  
 RA = Return Air  
 EA = Exhaust Air  
 FD = Fire Damper  
 SD = Smoke Damper  
 FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
220	FD	7FL-FD14 South	28x8	Air Balance	Unknown	Pass	N/A	None
221	SD	7FL-FD14 South	28x8	Air Balance	Unknown	Pass	N/A	Zone 3R
222	FD	7FL-FD15 South	14" R	Air Balance	Unknown	Pass	N/A	None
223	SD	7FL-SD15 South	14" R	Air Balance	Unknown	Pass	N/A	Zone 6
224	FD	7FL-FD16 South	10" R	Air Balance	Unknown	Pass	N/A	None
225	SD	7FL-SD16 South	10" R	Air Balance	Unknown	Pass	N/A	None
226	SD	7FL-SD17 South	28x8	Air Balance	Unknown	Pass	N/A	Zone 7
227	SD	7FL-SD18 South	48x8	Air Balance	Unknown	Pass	N/A	Zone 9R
228	SD	7FL-SD19 South	22x8	Air Balance	Unknown	Pass	N/A	Zone 9R
229	SD	7FL-SD20 South	43x8	Air Balance	Unknown	Pass	N/A	Zone 8
230	SD	7FL-SD21 South	8" R	Air Balance	Unknown	Pass	N/A	Zone 7 (holes in firewall)
231	SD	7FL-SD22 South	22x8	Air Balance	Unknown	Pass	N/A	Zone 8

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: 3/23/2023, 4/12/2023 and 4/13/2023  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
232	FD	8FL-FD1 North	5" Round	Air Balance	Unknown	Pass	N/A	None
233	SD	8FL-SD2 North	54x12	Air Balance	Unknown	Pass	N/A	Zone NWR
234	SD	8FL-SD3 North	9" Round	Air Balance	Unknown	Pass	N/A	Zone 9
235	FD	8FL-FD4 North	26x11	Air Balance	Unknown	Pass	N/A	None
236	SD	8FL-SD4 North	26x11	Air Balance	Unknown	Pass	N/A	None
237	FD	8FL-FD5 North	10" Round	Air Balance	Unknown	Pass	N/A	None
238	SD	8FL-SD6 North	14x14	Air Balance	Unknown	Pass	N/A	None
239	FD	8FL-FD7 North	18x12	Ruskin	IBD20	Pass	N/A	None
240	SD	8FL-SD8 North	22x8	Air Balance	Unknown	Pass	N/A	Zone 1
241	SD	8FL-SD9 North	24x6	Air Balance	Unknown	Pass	N/A	Zone 1
242	SD	8FL-SD10 North	54x12	Air Balance	Unknown	Pass	N/A	Zone NWR
243	SD	8FL-SD11 North	24x12	Air Balance	Unknown	Pass	N/A	Zone 2R
244	SD	8FL-SD12 North	22x8	Air Balance	Unknown	Pass	N/A	Zone 2R
245	SD	8FL-SD13 North	10" Round	Air Balance	Unknown	Pass	N/A	Zone 1
246	SD	8FL-SD14 North	30x11	Air Balance	Unknown	Pass	N/A	Zone 3
247	SD	8FL-SD15 North	22x8	Air Balance	Unknown	Pass	N/A	Zone 3

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: 3/22/2023, 4/11/2023  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
248	FD	8FL-FD1 South	16" R	Air Balance	Unknown	Pass	Pass	Changed Link
249	SD	8FL-SD1 South	16" R	Air Balance	Unknown	Pass	Pass	Zone 8
250	FD	8FL-FD2 South	26x12	Air Balance	Unknown	Pass	Pass	None
251	FD	8FL-FD3 South	16x6	Air Balance	Unknown	Pass	Pass	None
252	FD	8FL-FD4 South	60x12	Air Balance	Unknown	Pass	Pass	None
253	SD	8FL-SD4 South	60x12	Air Balance	Unknown	Pass	Pass	Zone SW Main
254	FD	8FL-FD5 South	17" R	Air Balance	Unknown	Pass	Pass	None
255	SD	8FL-SD5 South	17" R	Air Balance	Unknown	Pass	Pass	Zone 7
256	SD	8FL-SD6 South	18x18	Prefco Products	Unknown	Pass	Pass	Zone 7
257	FD	8FL-FD7 South	18x12	Prefco Products	Unknown	Pass	Pass	None
258	SD	8FL-SD8 South	8" R	Unknown	Unknown	Pass	Pass	Zone SWR
259	SD	8FL-SD9 South	48x12	Air Balance	Unknown	Pass	Pass	Zone 6
260	SD	8FL-SD10 South	22x8	Air Balance	Unknown	Pass	Pass	Zone 6
								No Dampers 11-13
261	SD	8FL-SD14 South	22x8	Air Balance	Unknown	Pass	Pass	Zone 8R
262	SD	8FL-SD15 South	26x12	Air Balance	Unknown	Pass	Pass	Zone 8R
263	SD	8FL-SD16 South	48x12	Air Balance	Unknown	Pass	Pass	Zone SWM
264	SD	8FL-SD17 South	26x12	Air Balance	Unknown	Pass	Pass	Zone 7
265	SD	8FL-SD18 South	22x8	Air Balance	Unknown	Pass	Pass	Zone 7
266	SD	8FL-SD19 South	22x8	Air Balance	Unknown	Pass	Pass	Zone 7

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: 3/22/2023, 4/11/2023  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
351	FD	AC 7A-S1	16" R	Air Balance	Unknown	Pass	N/A	None
352	FD	AC 7A-S2	18" R	Air Balance	Unknown	Pass	N/A	None
353	FD	AC 7A-S3	16" R	Air Balance	Unknown	Pass	N/A	None
354	FD	AC 7A- Return	38x36	Air Balance	Unknown	Pass	N/A	None
355	FD	AC7-S1	24" R	Air Balance	Unknown	Pass	N/A	None
356	FD	AC7-S2	30" R	Ruskin	IBD200W	Pass	N/A	None
357	FD	AC7-S3	30" R	Air Balance	Unknown	Pass	N/A	None
358	FD	AC7-S4	20" R	Air Balance	Unknown	Pass	N/A	None
359	FD	AC7-Return	60x60	Air Balance	Unknown	Pass	N/A	None
360	FD	AC8-S1	22" R	Air Balance	Unknown	Pass	N/A	None
361	FD	AC9-S1	24" R	Air Balance	Unknown	No	No	Access Door Blocked. Pipes
362	FD	AC10-S1	18"R	Air Balance	Unknown	Pass	N/A	None
363	FD	AC10-S2	26" R	Air Balance	Unknown	Pass	N/A	None
364	FD	AC10-S3	28" R	Air Balance	Unknown	Pass	N/A	None
365	FD	AC10-S4	30" R	Air Balance	Unknown	Pass	N/A	None
366	FD	AC10-Return	60x54	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/Larry Coreno  
Inspection Dates: 3/28/2023, 3/30/2023  
Facility: Justice Center Jail 1

SA = Supply Air  
 RA = Return Air  
 EA = Exhaust Air  
 FD = Fire Damper  
 SD = Smoke Damper  
 FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
367	FD	AC10-Return 1	44x24	Ruskin	IBD2	Pass	N/A	None
368	FD	AC11-S1	28" R	Air Balance	Unknown	Pass	N/A	None
369	FD	AC11-S2	26" R	Air Balance	Unknown	Pass	N/A	None
370	FD	AC11-S3	24" R	Air Balance	Unknown	Pass	N/A	None
371	FD	AC11-S4	24" R	Air Balance	Unknown	Pass	N/A	None
372	FD	AC11-Return	60x60	Air Balance	Unknown	Pass	N/A	None
373	FD	AC12-S1	28" R	Air Balance	Unknown	Pass	N/A	None
374	FD	AC12-S2	22" R	Air Balance	Unknown	Pass	N/A	None
375	FD	AC12-S3	28 R	Air Balance	Unknown	Pass	N/A	None
376	FD	AC12-S4	32 R	Air Balance	Unknown	Pass	N/A	None
377	FD	AC12-Return	60x54	Air Balance	Unknown	Pass	N/A	None
378	FD	AC29-Supply	32x14	Prefco Products	Unknown	Pass	N/A	None
379	FD	AC29-Return	32x14	Prefco Products	Unknown	Pass	N/A	None

Inspector: Julie Gue  
Inspection Dates: 2/28/2023, 3/30/2023  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
267	FD	9FL-FD1 North	6" Round	Air Balance	Unknown	Pass	N/A	None
268	SD	9FL-SD1 North	10x8	Nailer	Unknown	Pass	N/A	Zone 1
269	FD	9FL-FD2 North	12" Round	Air Balance	Unknown	Pass	N/A	None
270	SD	9FL-SD2 North	12" Round	Unknown	Unknown	Pass	N/A	Zone 12
271	FD	9FL-FD3 North	48x14	Unknown	Unknown	Pass	N/A	None
272	SD	9FL-SD3 North	48x14	Unknown	Unknown	Pass	N/A	Zone NWR
273	SD	9FL-SD4 North	14x10	Air Balance	Unknown	Pass	N/A	Zone 1
274	SD	9FL-SD5 North	8" Round	Air Balance	Unknown	Pass	N/A	None
275	FD	9FL-FD6 North	17" Round	Air Balance	Unknown	Pass	N/A	None
276	SD	9FL-SD6 North	17" Round	Air Balance	Unknown	Pass	N/A	Zone 2
277	FD	9FL-FD7 North	22x8	Air Balance	Unknown	Pass	N/A	None
278	SD	9FL-FSD1 North	12x8	Prefco	Unknown	Pass	N/A	None
279	FD	9FL-FD9 North	12x8	Air Balance	Unknown	Pass	N/A	None
280	SD	9FL-SD9 North	8" Round	Air Balance	Unknown	Pass	N/A	Zone
281	FD	9FL-FD10 North	30x8	Air Balance	Unknown	Pass	N/A	None
282	SD	9FL-SD10 North	28X11	Unknown	Unknown	Pass	N/A	Zone 5
283	FD	9FL-FD11 North	48x12	Air Balance	Unknown	Pass	N/A	None
284	SD	9FL-SD11 North	48x12	Air Balance	Unknown	Pass	N/A	None
285	FD	9FL-FD14 North	8x6	Air Balance	Unknown	Pass	N/A	None
286	SD	9FL-SD15 North	22x8	Air Balance	Unknown	Pass	N/A	Zone 2R

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: 3/21/2023, 4/10/2023  
Facility: Justice Center Jail 1

SA = Supply Air  
 RA = Return Air  
 EA = Exhaust Air  
 FD = Fire Damper  
 SD = Smoke Damper  
 FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
296	FD	9FL-FD1 South	14" R	Air Balance	Unknown	Pass	N/A	None
297	SD	9FL-SD1 South	14" R	Air Balance	Unknown	Pass	N/A	Zone
298	FD	9FL-FD2 South	22x8	Air Balance	Unknown	Pass	N/A	None
299	SD	9FL-SD3 South	28x12	Air Balance	Unknown	Pass	N/A	Zone SWM
300	FD	9FL-FD4 South	15" Round	Air Balance	Unknown	Pass	N/A	None
301	SD	9FL-SD4 South	15" Round	Air Balance	Unknown	Pass	N/A	None
302	FD	9FL-FD5 South	6" Round	Air Balance	Unknown	Pass	N/A	None
303	SD	9FL-SD5 South	6" Round	Air Balance	Unknown	Pass	N/A	None
304	FD	9FL-FD6 South	12" Round	Air Balance	Unknown	Pass	N/A	None
305	SD	9FL-SD6 South	12" Round	Air Balance	Unknown	Pass	N/A	None
306	FD	9FL-FD7 South	48x2	Air Balance	Unknown	Pass	N/A	None
307	SD	9FL-SD7 South	48x2	Air Balance	Unknown	Pass	N/A	None
308	SD	9FL-SD8 South	12x8	Prefco Products	Uknown	Pass	N/A	Zone Uknown
309	SD	9FL-SD9 South	12X8	Air Balance	Uknown	Pass	N/A	None
310	FD	9FL-FD10 South	22x8	Air Balance	Uknown	Pass	N/A	None
311	SD	9FL-SD11 South	8" Round	Air Balance	Uknown	Pass	N/A	None
312	SD	9FL-SD12 South	12X8	Air Balance	Uknown	Pass	N/A	None
313	FD	9FL-FD13 South	26X12	Air Balance	Uknown	Pass	N/A	Zone 9
314	SD	9FL-SD14 South	22x8	Air Balance	Unknown	Pass	N/A	Zone 9
315	SD	9FL-SD15 South	26x12	Air Balance	Unknown	Pass	N/A	Zone 9

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: 3/21/2023, 4/10/2023  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
318	SD	10FL-SD1 North	13" R	Air Balance	Unknown	Pass	N/A	Zone 1
319	FD	10FL-FD2 North	5" R	Air Balance	Unknown	Pass	N/A	None
320	SD	10FL-SD3 North	54x12	Air Balance	Unknown	Pass	N/A	Zone NWR
The #4 was not utilized. No damper #4								
321	FD	10FL-FD5 North	13" Round	Air Balance	Unknown	Pass	N/A	None
322	FD	10FL-FD6 North	54x12	Air Balance	Unknown	Pass	N/A	None
323	FD	10FL-FD7 North	26x11	Air Balance	Unknown	Pass	N/A	None
324	SD	10FL-SD8 North	10x8	Air Balance	Unknown	Pass	N/A	None
325	SD	10FL-SD9 North	22x8	Air Balance	Unknown	Pass	N/A	Zone 8R
326	SD	10FL-SD10 North	22x8	Air Balance	Unknown	Pass	N/A	Zone 2
327	SD	10FL-SD11 North	24x12	Air Balance	Unknown	Pass	N/A	Zone 2
328	SD	10FL-SD12 North	24x12	Air Balance	Unknown	Pass	N/A	Zone 1R
329	SD	10FL-SD13 North	54x12	Air Balance	Unknown	Pass	N/A	Zone NWR
330	SD	10FL-SD14 North	8x8	Prefco Products	Unknown	Pass	N/A	Zone 1R
331	SD	10FL-SD15 North	30x10	Air Balance	Unknown	Pass	N/A	Zone 3R
332	SD	10FL-SD16 North	22x8	Air Balance	Unknown	Pass	N/A	Zone 3R

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: 3/20/2023, 4/10/2023  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
333	FD	10FL-FD1 South	15" Round	Air Balance	Unknown	Pass	N/A	None
334	SD	10FL-SD1 South	15" Round	Air Balance	Unknown	Pass	N/A	Zone 8
335	FD	10FL-FD2 South	26x12	Air Balance	Unknown	Pass	N/A	None
336	FD	10FL-FD3 South	60x12	Air Balance	Unknown	Pass	N/A	None
337	SD	10FL-SD3 South	60x12	Air Balance	Unknown	Pass	N/A	Zone-SWR
338	FD	10FL-FD4 South	17" Round	Air Balance	Unknown	Pass	N/A	None
339	SD	10FL-SD5 South	24x12	Air Balance	Unknown	Pass	FAIL	Can Not Access Actuator To Fix It
340	FD	10FL-FD7 South	18x12	Air Balance	Unknown	Pass	N/A	None
341	SD	10FL-SD8 South	10x8	Prefco Products	Unknown	Pass	N/A	None
342	FSD	10FL-FSD1 South	10x8	Prefco Products	Unknown	Pass	N/A	None
343	SD	10FL-SD9 South	22x8	Air Balance	Unknown	Pass	N/A	Zone 8
344	SD	10FL-SD10 South	26x12	Air Balance	Unknown	Pass	N/A	Zone 8
345	SD	10FL-SD11 South	48x12	Air Balance	Unknown	Pass	N/A	Zone SWR
346	SD	10FL-SD12 South	26x12	Air Balance	Unknown	FAIL	N/A	Not enough air in Pnuematic line to keep these dampers open Zone 7R
347	SD	10FL-SD13 South	8" Round	Prefco Products	Unknown	FAIL	N/A	
348	SD	10FL-SD14 South	22x8	Air Balance	Unknown	FAIL	N/A	
349	SD	10FL-SD15 South	22x8	Air Balance	Unknown	Pass	N/A	Zone 6R
350	SD	10FL-SD16 South	48x12	Air Balance	Unknown	Pass	N/A	Zone 6R

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: 3/20/2023, 4/10/2023  
Facility: Justice Center Jail 1

SA = Supply Air  
 RA = Return Air  
 EA = Exhaust Air  
 FD = Fire Damper  
 SD = Smoke Damper  
 FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
408	FD	NS 5FL FD1	24x24	Air Balance	Unknown	Pass	N/A	None
409	FD	NS 6FL FD2	26x8	Air Balance	Unknown	Pass	N/A	None
410	FD	NS 6FL FD3	60x14	Air Balance	Unknown	Fail	N/A	Access from pod for inspection
411	SD	NS 6FL SD3	60x14	Air Balance	Unknown	Pass	N/A	Zone NER
412	FD	NS 6FL FD4	15" R	Air Balance	Unknown	Pass	N/A	None
413	SD	NS 6FL SD4	15" R	Air Balance	Unknown	Pass	N/A	Zone 3 Repaired
414	FSD	NS 6FL FSD1	18" R	Prefco Products	Unknown	Fail	N/A	Zone 4 Will need to be repaired from Pod
415	FSD	NS 6FL FSD2	36x10	Prefco Products	Unknown	Pass	N/A	Zone NER
416	FSD	NS 6FL FSD3	6x12	Prefco Products	Unknown	Pass	N/A	Zone NER Enlarged access
							N/A	
417	FD	NS 8FL FD1	15" R	Air Balance	Unknown	Pass	N/A	Changed Fusible Link
418	SD	NS 8FL SD1	15" R	Air Balance	Unknown	Fail	N/A	Z-4 Not Enough Air To Keep New Actuator Open
419	FD	NS 8FL FD2	30x10	Air Balance	Unknown	Pass	N/A	None
420	FD	NS 8FL FD3	48x12	Air Balance	Unknown	Pass	N/A	None
421	SD	NS 8FL SD3	48x12	Air Balance	Unknown	Pass	N/A	None
422	FD	NS 8FL FD4	9" R	Air Balance	Unknown	Pass	N/A	None
423	SD	NS 8FL SD4	9" R	Air Balance	Unknown	Pass	N/A	Zone 9
424	FD	NS 8FL SD5	15" R	Air Balance	Unknown	Pass	N/A	None
425	SD	NS 8FL SD5	15" R	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: 3/24/2023  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
433	FD	SS 8FL-FD1	14" Round	Air Balance	Unknown	Pass	N/A	None
434	SD	SS 8FL-SD1	14" Round	Air Balance	Unknown	Fail	N/A	Zone 5 Lack of air to actuator
435	FD	SS 8FL-FD2	30x10	Air Balance	Unknown	Pass	N/A	None
436	FD	SS 8FL-FD3	8" Round	Air Balance	Unknown	Pass	N/A	None
437	SD	SS 8FL-SD3	8" Round	Air Balance	Unknown	Pass	N/A	Zone 6
438	FD	SS 8FL-FD4	48X12	Air Balance	Unknown	Pass	N/A	None
439	SD	SS 8FL-SD4	48X12	Air Balance	Unknown	Pass	N/A	Zone SWR
440	FD	SS 8FL-FD5	15" Round	Air Balance	Unknown	Pass	N/A	None
441	SD	SS 8FL-SD5	15" Round	Air Balance	Unknown	Pass	N/A	Zone 5
442	FD	SS 10FL-FD1	14" Round	Air Balance	Unknown	Pass	N/A	None
443	SD	SS 10FL-SD1	14" Round	Air Balance	Unknown	Pass	N/A	Zone 8
444	FD	SS 10FL-FD2	30x10	Air Balance	Unknown	Pass	N/A	None
445	FD	SS 10FL-FD3	48x12	Air Balance	Unknown	Pass	N/A	None
446	SD	SS 10FL-SD3	48x12	Air Balance	Unknown	Pass	N/A	Zone SWR
447	FD	SS 10FL-FD4	15" Round	Air Balance	Unknown	Pass	N/A	None
448	SD	SS 10FL-SD4	15" Round	Air Balance	Unknown	Pass	N/A	Zone 6

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: 3/24/2023  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
380	FD	G-ELV-RM-S	30x16	Ruskin	IBD40	Pass	N/A	5th Floor Mechanical Rm
381	FD	G-ELV-RM-R	30x16	Ruskin	IBD40	Pass	N/A	5th Floor Mechanical Rm
382	FD	INM-ELV-RM-S	20x18	Ruskin	IBD40	Pass	N/A	5th Floor Mechanical Rm
383	FD	INM-ELV-RM-R	16x18	Ruskin	IBD40	Pass	N/A	5th Floor Mechanical Rm
384	FD	3EF1	42x60	Air Balance	Unknown	Pass	N/A	5th Floor Mechanical Rm
385	FD	3EF2	23x34	Air Balance	Unknown	Pass	N/A	5th Floor Mechanical Rm
386	FD	3EF3	20x24	Air Balance	Unknown	Pass	N/A	5th Floor Mechanical Rm
387	FD	3EF4	58x40	Air Balance	Unknown	Pass	N/A	5th Floor Mechanical Rm
388	FD	3EF5	18x18	Air Balance	Unknown	Pass	N/A	5th Floor Mechanical Rm
389	FD	Stairwell 5 Relief	24X24	Air Balance	Unknown	Pass	N/A	5th Floor Mechanical Rm

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: 3/28/2023  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
390	FD	PH-FD1	12x12	Ruskin	IBD2	Pass	N/A	None
391	FD	PH-FD2	12x12	Ruskin	IBD2	Pass	N/A	None
392	FD	PH-FD3	15x12	Ruskin	IBD2	Pass	N/A	None
393	FD	PH-FD4	12x12	Prefco Products	Unknown	Pass	N/A	None
394	FD	PH-FD5	12x12	Prefco Products	Unknown	Pass	N/A	None
395	FD	P1-FD1	12" Round	Air Balance	Unknown	Pass	N/A	None
396	SD	P1-SD1	12" Round	Air Balance	Unknown	Pass	N/A	None
397	FD	P1-FD2	10" Round	Air Balance	Unknown	Pass	N/A	None
398	SD	P1-SD2	10" Round	Air Balance	Unknown	Pass	N/A	None
399	FD	P1-FD3	30x12	Air Balance	Unknown	Pass	N/A	None
400	SD	P1-SD3	14x10	Air Balance	Unknown	Pass	N/A	None
401	FD	P1-FD4	10" Round	Air Balance	Unknown	Pass	N/A	None
402	SD	P1-SD4	26x12	Air Balance	Unknown	Pass	N/A	None
403	FD	P1-FD5	24x10	Air Balance	Unknown	Pass	N/A	None
404	SD	P1-SD5	10" Round	Air Balance	Unknown	Pass	N/A	None
405	FD	P1-FD6	8x6	Air Balance	Unknown	Pass	N/A	None
406	FSD	P1-FSD1	12" Round	Ruskin	FSD60	Pass	N/A	None
407	FSD	P1-FSD2	9" Round	Ruskin	FSD60	Pass	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz/Larry Coreno  
Inspection Dates: 4/14/2023  
Facility: Justice Center Jail 1

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Sheriff office

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-FD1

**Damper Type**

Vertical Fire Damper

**Damper Size**

60"x15"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

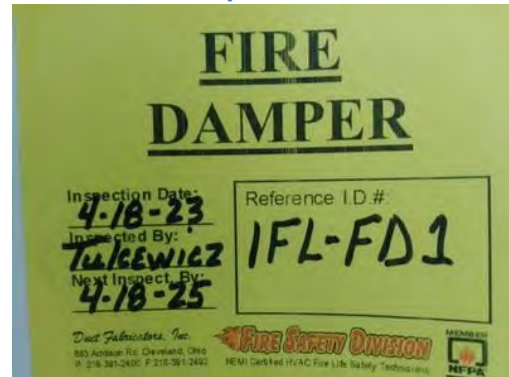

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Video visitation

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-FD2

**Damper Type**

Vertical Fire Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Video Visitation

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-FD3

**Damper Type**

Vertical Fire Damper

**Damper Size**

9" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8 x 8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

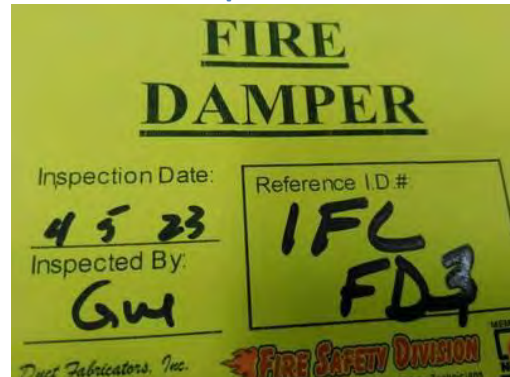

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Video visitation

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-FD4

**Damper Type**

Vertical Fire Damper

**Damper Size**

22 x 12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

14 x 14

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

Fire wall needs repair

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Main Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-FD5

**Damper Type**

Vertical Fire Damper

**Damper Size**

12 x 6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

7 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Main Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-FD6

**Damper Type**

Vertical Fire Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Main Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-FD8

**Damper Type**

Vertical Fire Damper

**Damper Size**

11" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Main corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-FD9

**Damper Type**

Vertical Fire Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

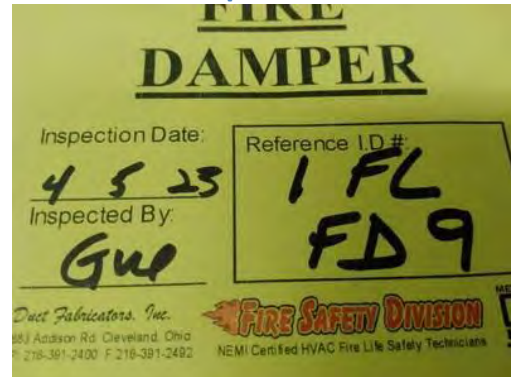

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Sheriffs office

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-FD12

**Damper Type**

Vertical Fire Damper

**Damper Size**

13"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Sheriff's office

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-FD13

**Damper Type**

Vertical Fire Damper

**Damper Size**

14"x7"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

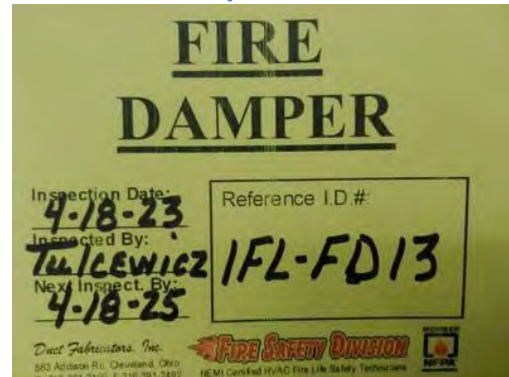



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Sheriff office

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-FD14

**Damper Type**

Vertical Fire Damper

**Damper Size**

11"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

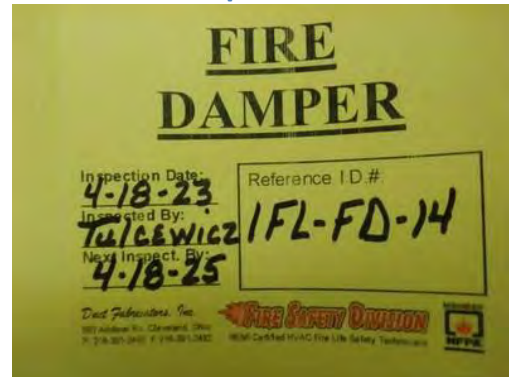

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Sheriff office

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-FD15

**Damper Type**

Vertical Fire Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Sheriff's office

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-SD1

**Damper Type**

Vertical Smoke Damper

**Damper Size**

60"x15"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

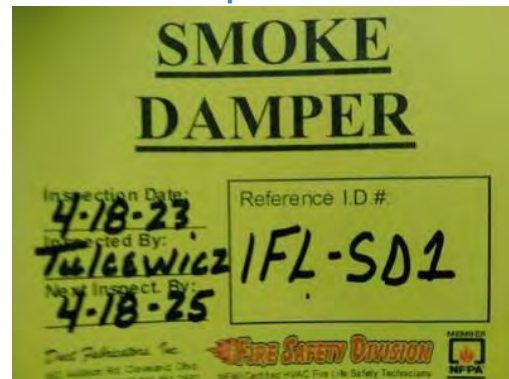

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Video Visitation

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-SD2

**Damper Type**

Vertical Smoke Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Video visitation

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-SD3

**Damper Type**

Vertical Smoke Damper

**Damper Size**

9" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8 x 8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Main corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-SD6

**Damper Type**

Vertical Smoke Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

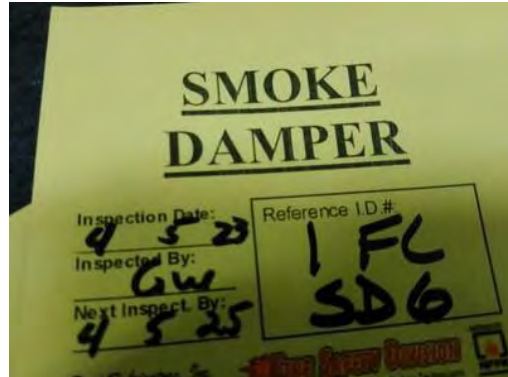

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Main Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-SD7

**Damper Type**

Vertical Smoke Damper

**Damper Size**

60 x 15

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Main corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-SD8

**Damper Type**

Vertical Smoke Damper

**Damper Size**

11" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Main corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-SD10

**Damper Type**

Vertical Smoke Damper

**Damper Size**

7" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

5 x 3

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None



Interior Picture of Damper



Picture of Damper I.D. Label



**Exterior Picture of Damper**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Main corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

1FL-SD11

**Damper Type**

Vertical Smoke Damper

**Damper Size**

8" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

4 x 4

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None



Interior Picture of Damper



Picture of Damper I.D. Label



**Exterior Picture of Damper**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Sheriff's office

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-SD12

**Damper Type**

Vertical Smoke Damper

**Damper Size**

13"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

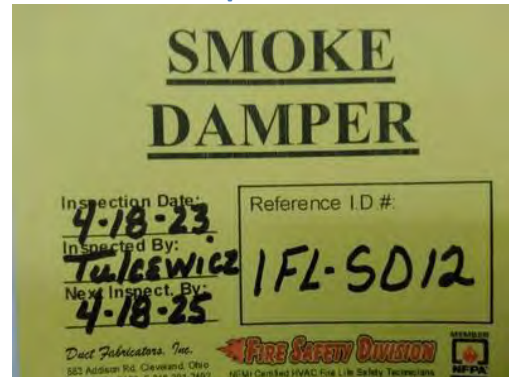

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Sheriff's office

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-SD14

**Damper Type**

Vertical Smoke Damper

**Damper Size**

11"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

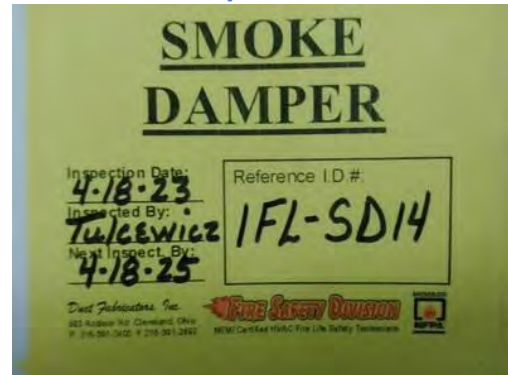

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Cashier Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FD1

**Damper Type**

Vertical Fire Damper

**Damper Size**

60 x 15

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Restroom corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FD2

**Damper Type**

Vertical Fire Damper

**Damper Size**

10 x 12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

7 x 7

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Cashier Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FD3

**Damper Type**

Vertical Fire Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

5 x 5

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Restroom Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FD4

**Damper Type**

Vertical Fire Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Fiscal offices

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FD5

**Damper Type**

Vertical Fire Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Fiscal offices

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FD6

**Damper Type**

Vertical Fire Damper

**Damper Size**

26 x 8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

11 x 10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

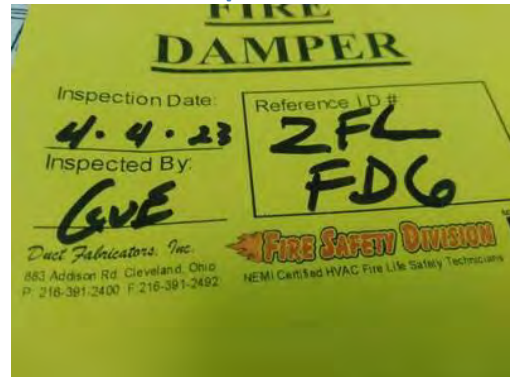

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Fiscal offices

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FD7

**Damper Type**

Vertical Fire Damper

**Damper Size**

8 x 6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Red Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FD9

**Damper Type**

Vertical Fire Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Red corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FD10

**Damper Type**

Vertical Fire Damper

**Damper Size**

10 x 6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8 x 8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Red Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FD11

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

5 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-04

**Facility Location**  
Jail 1

**Damper Location**  
Red Corridor

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
2FL-FD12

**Damper Type**  
Vertical Fire Damper

**Damper Size**  
10" Round

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
10 x 9

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-04

**Facility Location**  
Jail 1

**Damper Location**  
Break room

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
2FL-FD13

**Damper Type**  
Vertical Fire Damper

**Damper Size**  
48 x 15

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
Open

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-04

**Facility Location**  
Jail 1

**Damper Location**  
Break room

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
2FL-FD14

**Damper Type**  
Vertical Fire Damper

**Damper Size**  
12" Round

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
10" Round

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Cashier Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FSD1

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Greenheck

**Damper Model #**

FSDR11

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9 x 6 Oval

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Restroom Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-FSD2

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Greenheck

**Damper Model #**

FSDR511

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x4 Oval

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Cashier Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-SD1

**Damper Type**

Vertical Fire Damper

**Damper Size**

60x15

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-05

**Facility Location**

Jail 1

**Damper Location**

Cashier Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-SD3

**Damper Type**

Vertical Smoke Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

5 x 5

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Restroom corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-SD4

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

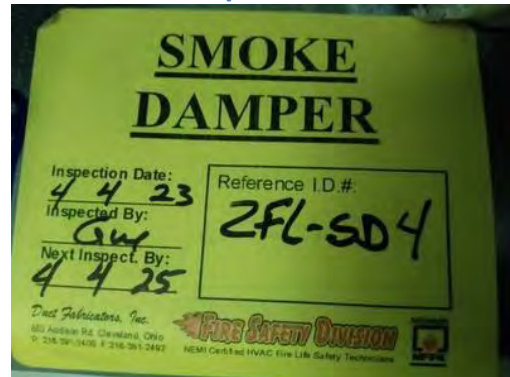



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Fiscal offices

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-SD5

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Red corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-SD9

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10 x 9

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Red corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-SD11

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

5 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Red corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-SD12

**Damper Type**

Vertical Smoke Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10 x 9

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

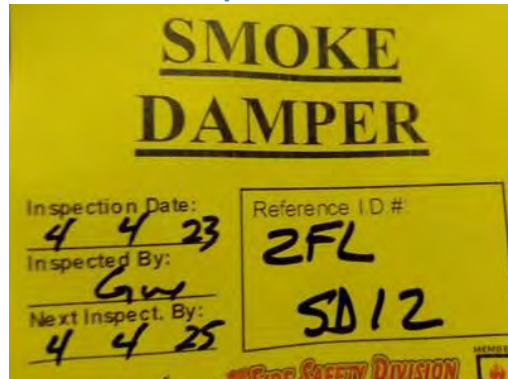

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Break room

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-SD13

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48 x 15

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-04

**Facility Location**  
Jail 1

**Damper Location**  
Break room

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
2FL-SD14

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
12" Round

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
10" Round

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

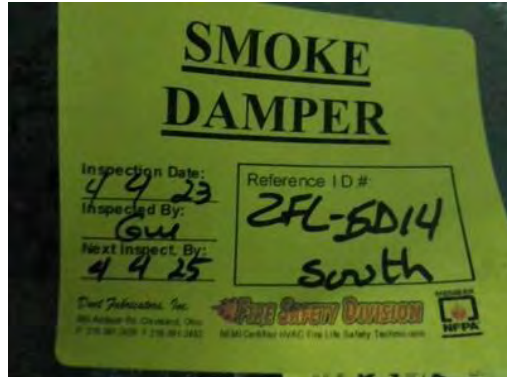

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3 EF 5

**Damper Type**

Vertical Fire Damper

**Damper Size**

18"×18"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3EF1

**Damper Type**

Vertical Fire Damper

**Damper Size**

60 x 43

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

20 x 20

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3EF2

**Damper Type**

Vertical Fire Damper

**Damper Size**

22 x 34

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

20 x 20

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3EF3

**Damper Type**

Vertical Fire Damper

**Damper Size**

16 x 18

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18 x 18

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

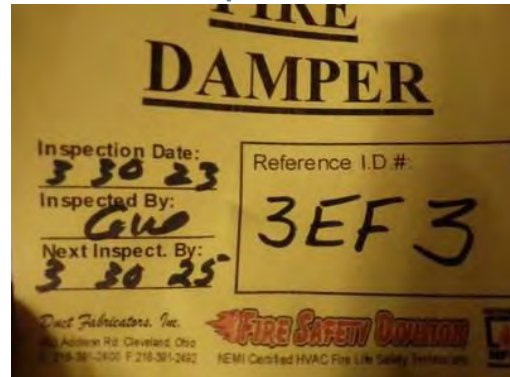

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-04

**Facility Location**

Jail 1

**Damper Location**

Men's Restroom.

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

3EF4

**Damper Type**

Vertical Fire Damper

**Damper Size**

58"x40"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

20"x20"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3EF5

**Damper Type**

Vertical Fire Damper

**Damper Size**

18"×18"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Vestibule F/G

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD1 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

11 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

ID unit

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD1 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

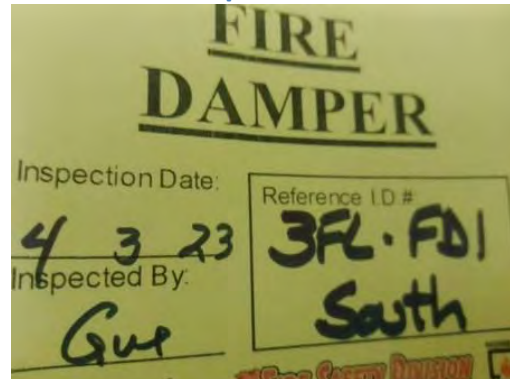

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Storage RM

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD2 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

11 x 7

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open


**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**

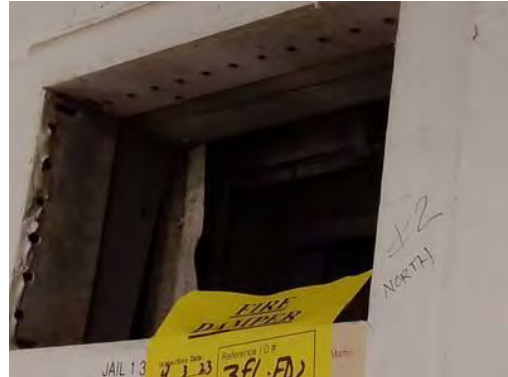

**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

ID unit

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD2 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

16 x 8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Storage RM

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD3 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

10 x 4

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

11 x 8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

Found closed/ reopened


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

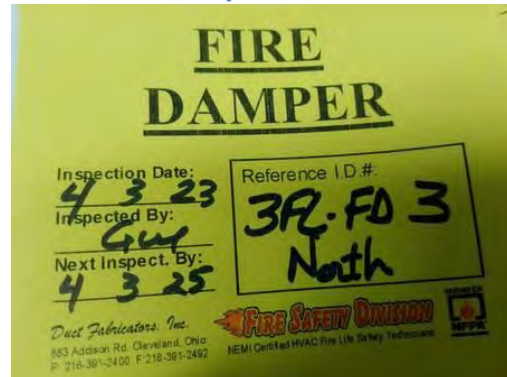

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Storage RM

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD4 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

48 x 15

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Storage RM

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD5 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

16 x 8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

7 x 7

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

ID unit corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD5 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x15

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod F

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

3FL-FD6 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

9" Round.

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8" x 6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

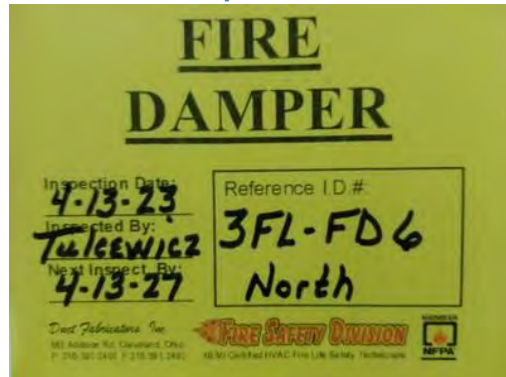

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Sheriff's office

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD6 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Sheriff's office

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD7 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

NE corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD8 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

36 x 15

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

3FL-FD8 South

**Inspector Name**

Julie Gue

**Damper I.D. #**

Sheriff's office

**Damper Type**

Vertical Fire Damper

**Damper Size**

46 x 12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10 x 10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

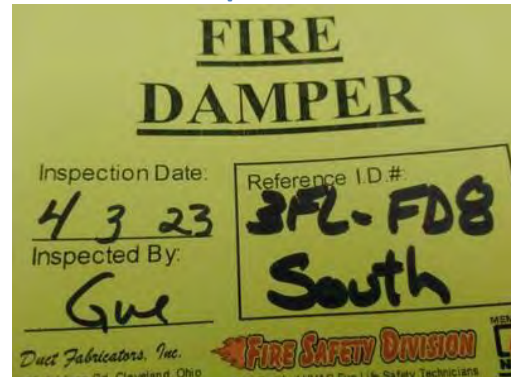

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod F

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

3FL-FD9 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10" x 10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Sheriff's office

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD9 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

38 x 10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10 x 10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

NE Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD10 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

26 x 10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

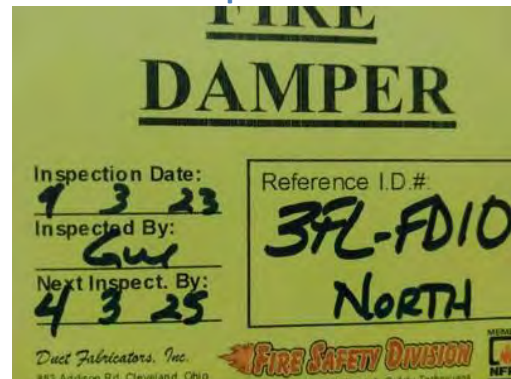

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

NE Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FD11 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

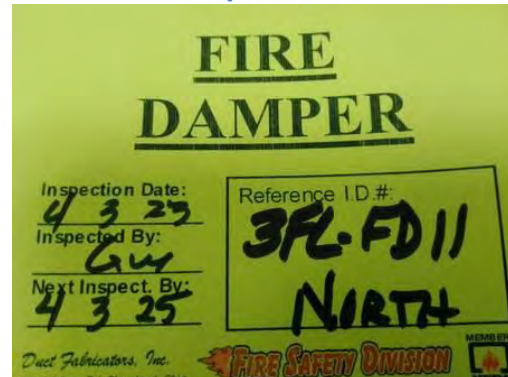

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Vestibule F/G

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FSD1 North

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

16 x 12

**Damper Manufacturer**

Ruskin

**Damper Model #**

FSD36

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

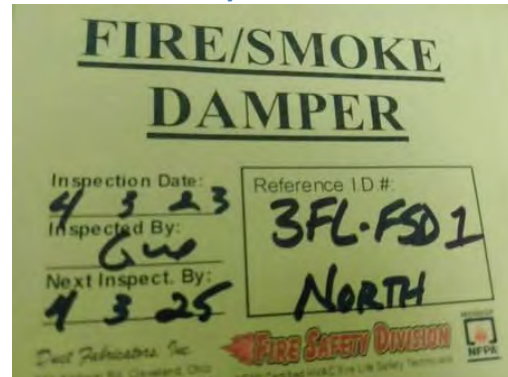

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Vestibule F/G

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-FSD2 North

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Ruskin

**Damper Model #**

FSDR25

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

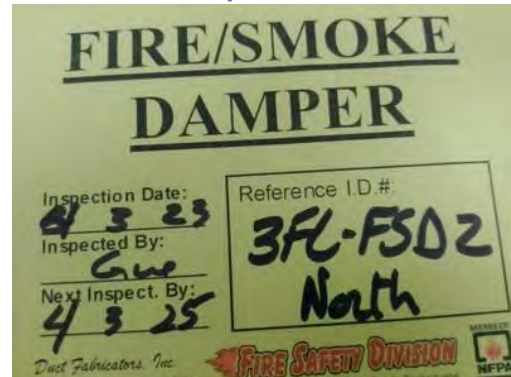

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

NE corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD 13 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48 x 12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-03

**Facility Location**  
Jail 1

**Damper Location**  
ID unit

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
3FL-SD1 South

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
10" Round

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
9" Round

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

ID unit

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD2 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16 x 8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

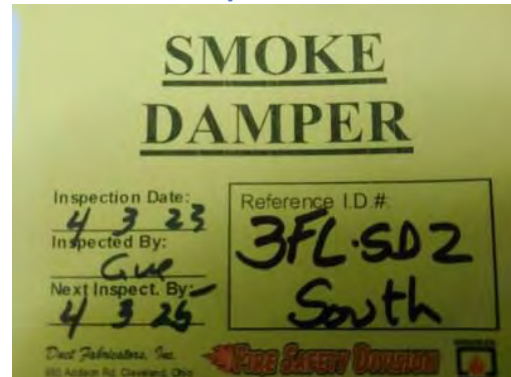

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

ID Unit

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD3 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

7 x 5

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

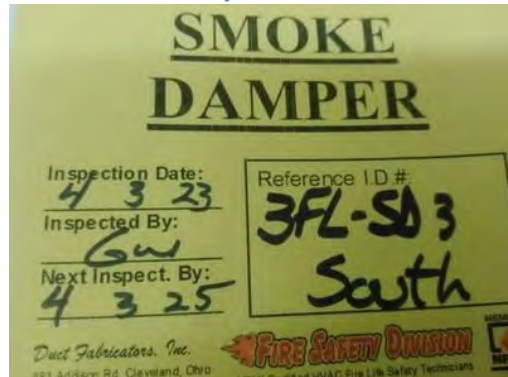

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Storage RM

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD4 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48 x 15

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

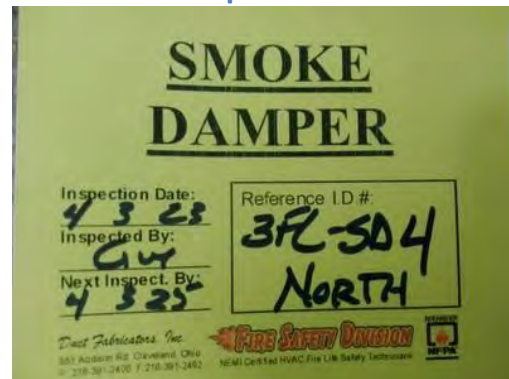

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

ID Unit

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD4 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

7 x 5

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

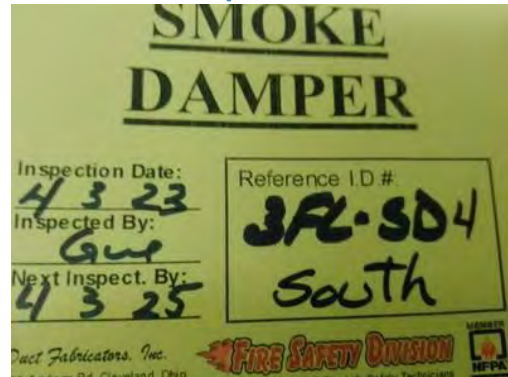

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

ID unit

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD5 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48 x 15

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Vestibule F/G

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD6 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

9" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

5 x 3

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

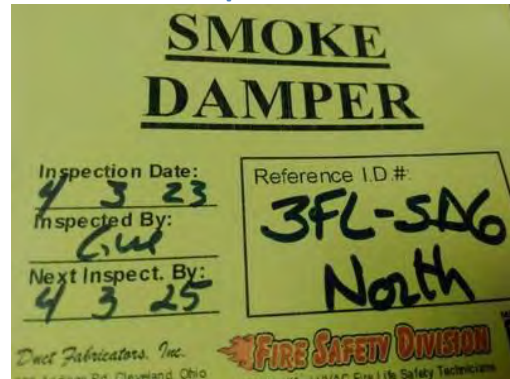

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Sheriff's office

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD6 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

Damper is 3FL-SD6  
Label is mismarked


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

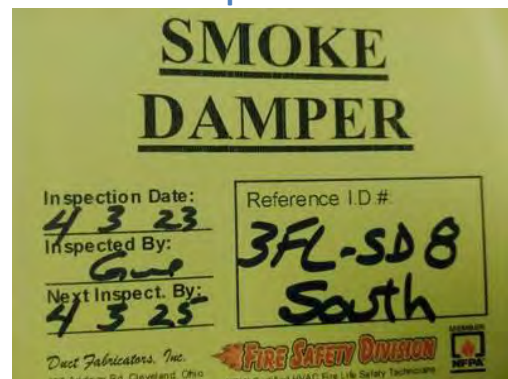



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Sheriff's office

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD7 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

NE corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD8 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

36x15

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

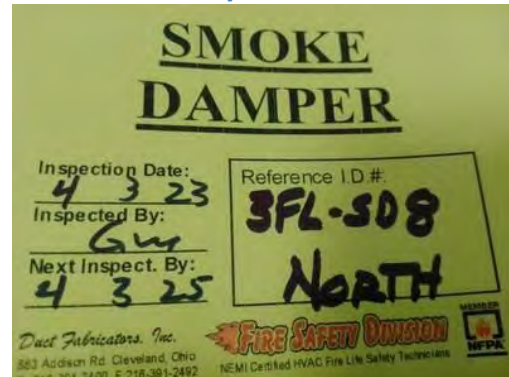

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-04

**Facility Location**

Jail 1

**Damper Location**

Main Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD8 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48 x 15

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10 x 10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-03

**Facility Location**  
Jail 1

**Damper Location**  
NE corridor

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
3FL-SD9 North

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
14" Round

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
12 x 12

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

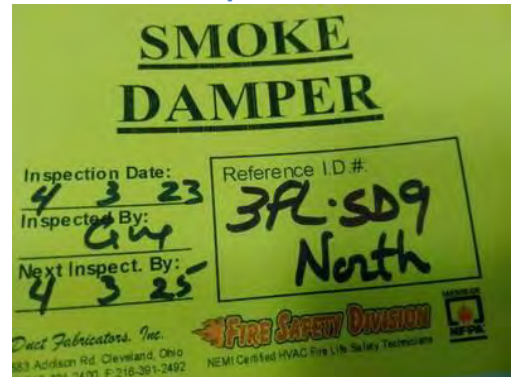

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-03

**Facility Location**

Jail 1

**Damper Location**

Sheriff's office

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-SD9 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

38 x 10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-03

**Facility Location**  
Jail 1

**Damper Location**  
NE Corridor

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
3FL-SD11 North

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
14" Round

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
12" Round

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

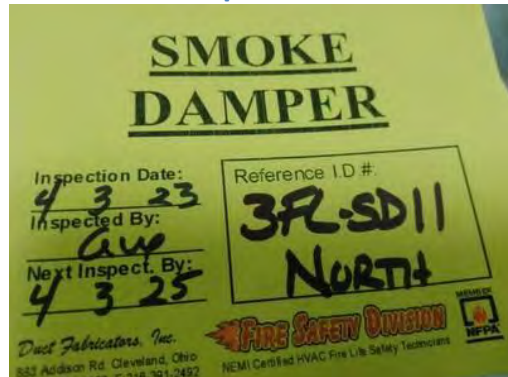

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-04-18

### Facility Location

Jail 1

### Damper Location

Southeast vending machine

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

4FL SD16 South

### Damper Type

Vertical Smoke Damper

### Damper Size

48"x12"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

Open

### Pass / Fail / Abandoned

Abandoned

### Comments / Corrections

Abandoned per JCI


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

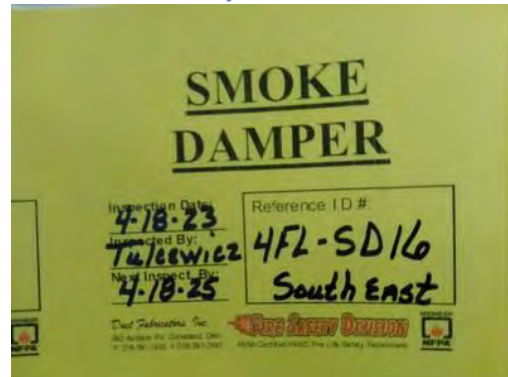

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

Bridge to Jail 2

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD1 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6 x 5

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

NW Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD2 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

9" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

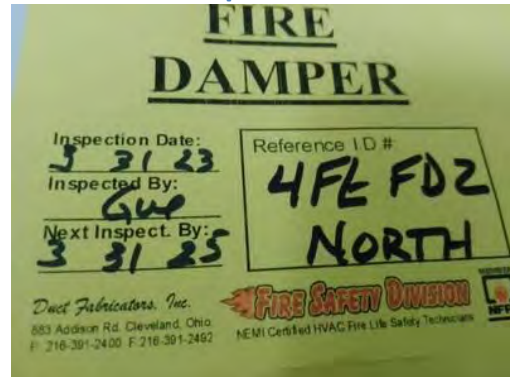

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

Bridge to Jail 2

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD2 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

20 x 20

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12 x 12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

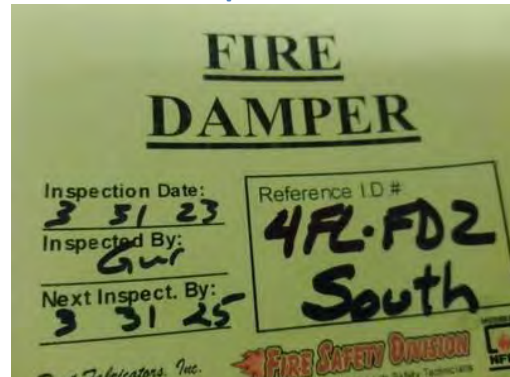

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD3 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

14 x 6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8 x 8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

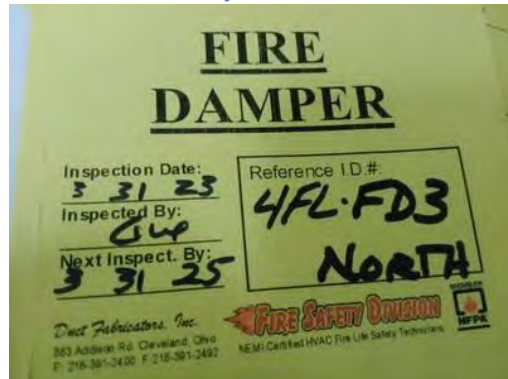

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

Bridge to Jail 2

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD3 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

15 x 10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F:216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD4 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

14 x 6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8 x 8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

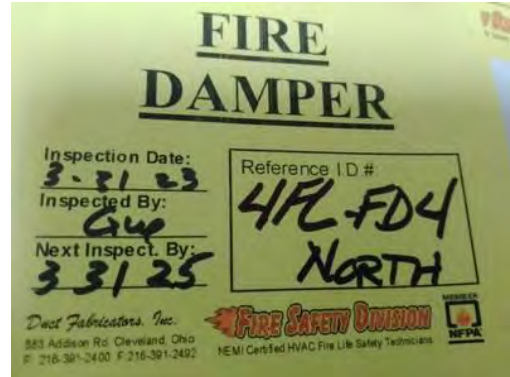

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

Bridge to Jail 2

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD4 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

60 x 12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass


**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**

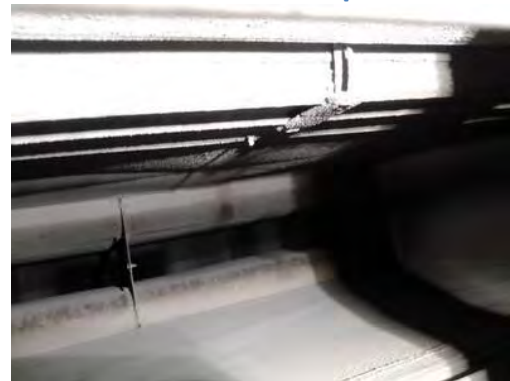

**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-25

**Facility Location**

Jail 1

**Damper Location**

Kitchen toilet

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD5 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

22" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

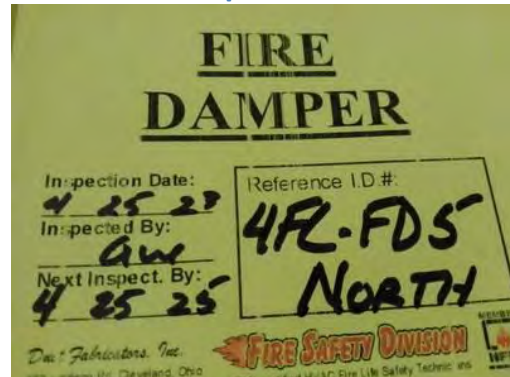

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

SW Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD5 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

17" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

Storage RM

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD6 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

42 x 12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

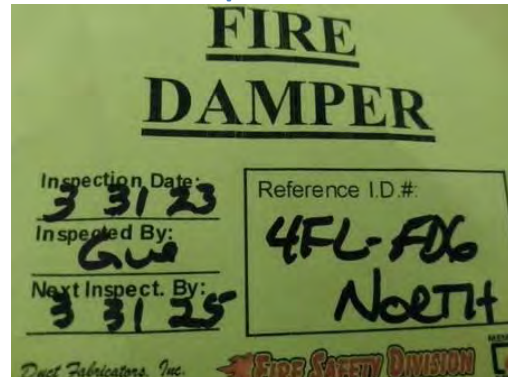

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

Storage RM

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD7 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

10 x 6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

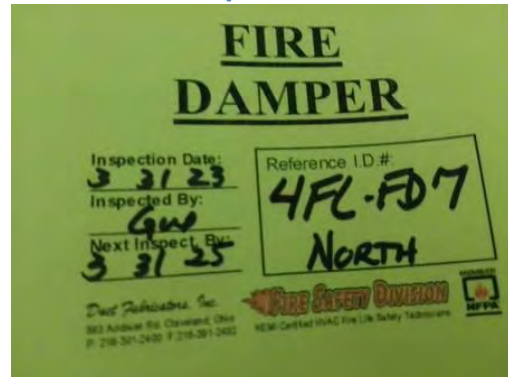

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

F Pod Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD7 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

38 x 10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

13 x 9

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

Storage RM

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD8 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

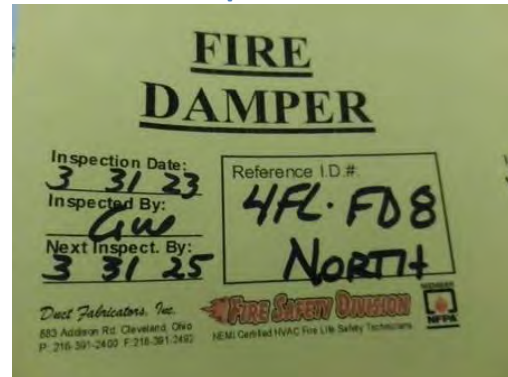

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

F Pod Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD8 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10 Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

F Pod

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD9 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

34 x 12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-04-18

### Facility Location

Jail 1

### Damper Location

Outside pod 4F

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

4FL-FD11 South

### Damper Type

Vertical Fire Damper

### Damper Size

13" Round

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

12" Round

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

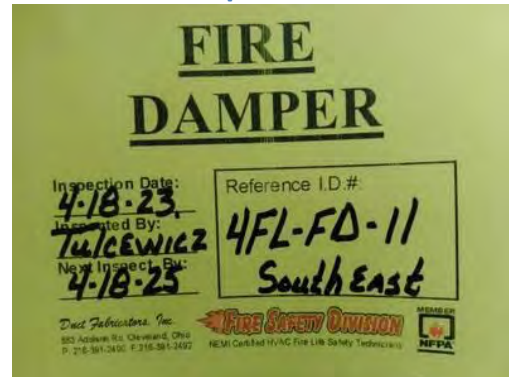

## CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-02-09

**Facility Location**

Old Police Dept Building

**Damper Location**

South corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-FD14 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Grille access

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Picture of Damper in Open Position**



**Picture of Damper in Closed Position**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-SD1 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

42 x 12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

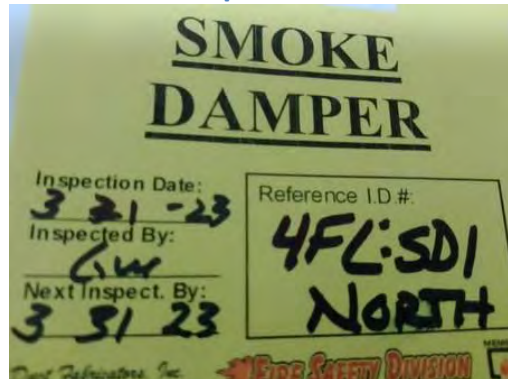

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

SW Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-SD1 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6 x 5

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

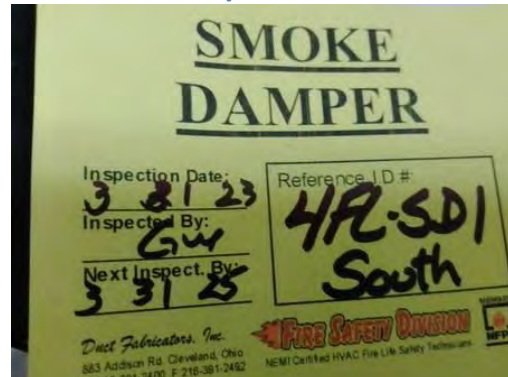

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-SD2 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

9" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

Bridge to Jail 2

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-SD3 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15 x 10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12 x 12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

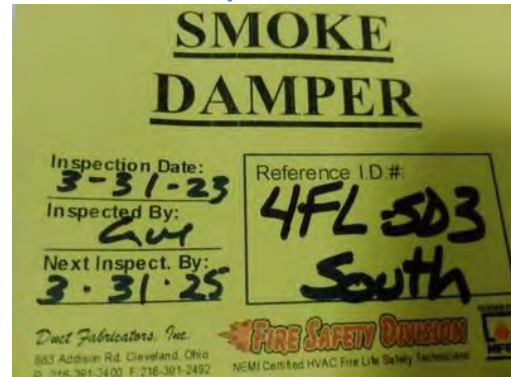

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-03-31

**Facility Location**  
Jail 1

**Damper Location**  
SW Corridor

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
4FL-SD4 South

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
60 x 12

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
Open

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

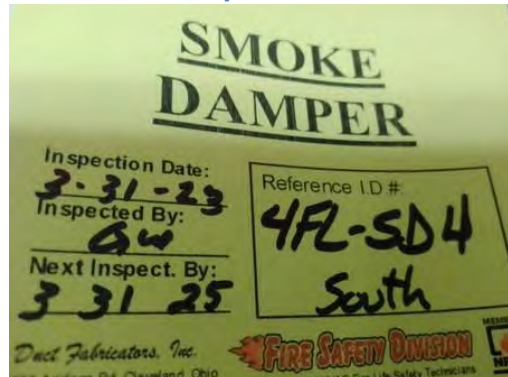

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-25

**Facility Location**

Jail 1

**Damper Location**

Kitchen toilet

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-SD5 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

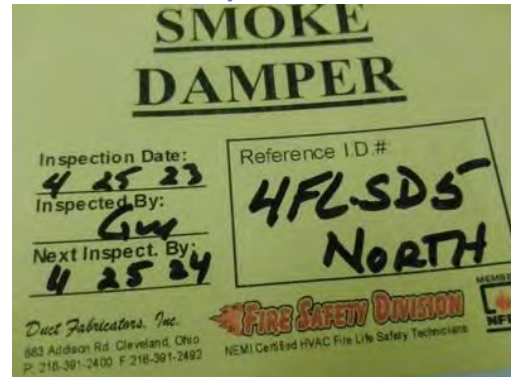

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

Storage RM

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-SD6 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

42 x 12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-03-31

**Facility Location**  
Jail 1

**Damper Location**  
Storage RM

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
4FL-SD7 North

**Damper Type**  
Vertical Fire Damper

**Damper Size**  
10x6

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
8x6

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

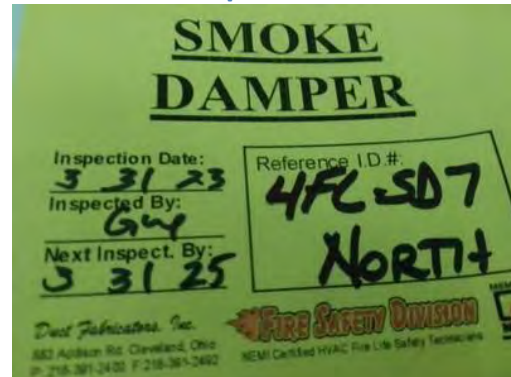



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

Storage RM

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-SD8 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

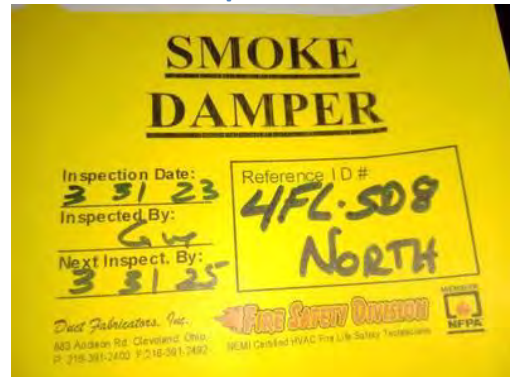

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-31

**Facility Location**

Jail 1

**Damper Location**

F Pod Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-SD9 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

34 x 12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

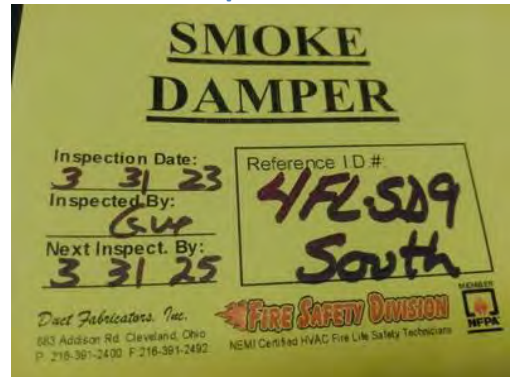

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Outside pod 4F

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

4FL-SD10 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

32"x10"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10"x10"

**Pass / Fail / Abandoned**

Abandoned

**Comments / Corrections**

Abandoned per JCI


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

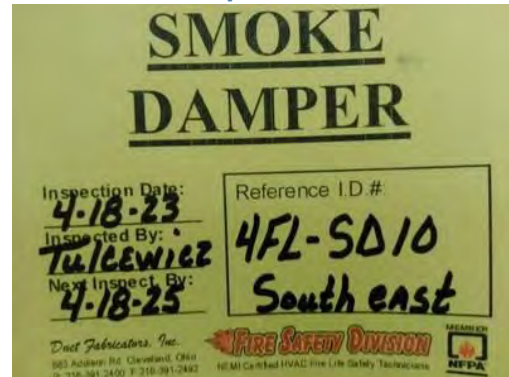

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Outside of pod 4F

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

4FL-SD12 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14"x6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10"x10"

**Pass / Fail / Abandoned**

Abandoned

**Comments / Corrections**

Abandoned per JCI


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

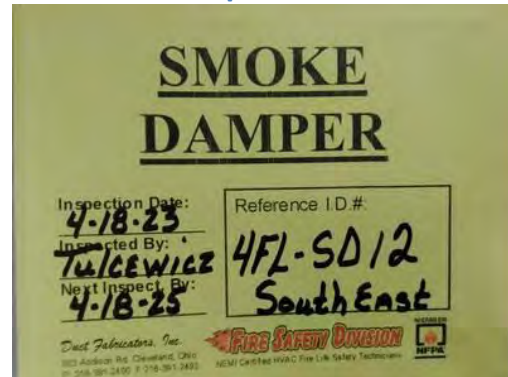

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-04-18

### Facility Location

Jail 1

### Damper Location

Outside of pod 4F

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

4FL-SD13 South

### Damper Type

Vertical Smoke Damper

### Damper Size

20"x6"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

N/A

### Access Door Size

16"x5"

### Pass / Fail / Abandoned

Abandoned

### Comments / Corrections

Abandoned per JCI


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

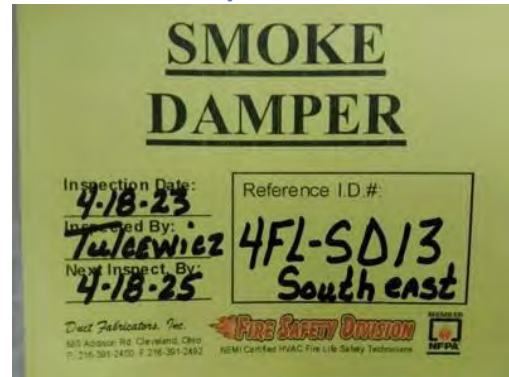

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Release Desk.

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

4FL-SD14 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

44"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Abandoned

**Comments / Corrections**

Abandoned per JCI


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

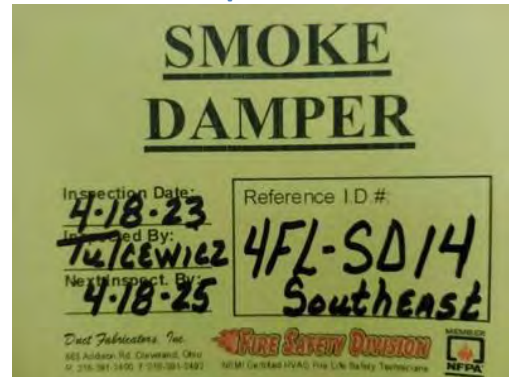

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-18

**Facility Location**

Jail 1

**Damper Location**

Release Desk

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

4FL-SD15 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

4"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-FD1 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

6" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Flex

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-FD2 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

20x16

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

17x6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-FD3 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

60x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18x18

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

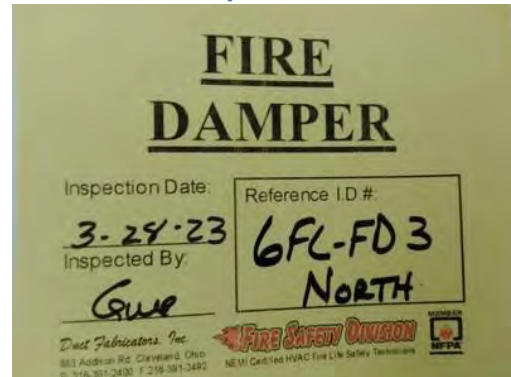

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southeast Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-FD4 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-FD5 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southeast Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-FD5 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

60"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

11"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-FD6 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

32x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southeast Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-FD6 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

16"x6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-FD7 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

10x6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southeast Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-FD7 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

26"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

14"x7"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southeast Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-FD11 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

8" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

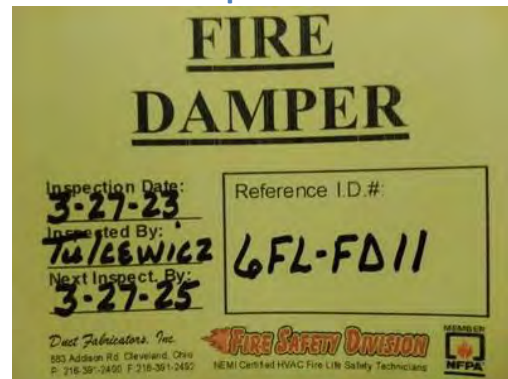

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southeast Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-FD12 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

**Damper I.D. #**

6FL-FD17 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

54"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-FD21 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

12"Round

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-03

**Facility Location**

Jail 1

**Damper Location**

Room# 616

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-FSD1 North

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

20"x16"

**Damper Manufacturer**

Ruskin

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Outside Pod C

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-FSD1 South

**Damper Type**

Vertical Fire/ Smoke Damper

**Damper Size**

8" x 8"

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Remove duct

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

Air disconnected.  
Damper labeled wrong  
Damper is 6FL-FSD1 South

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-28

**Facility Location**

Jail 1

**Damper Location**

Room# 6A1

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-FSD2 South

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

14 "x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-29

**Facility Location**

Jail 1

**Damper Location**

South Corridor.

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD1 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

3" x 3"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

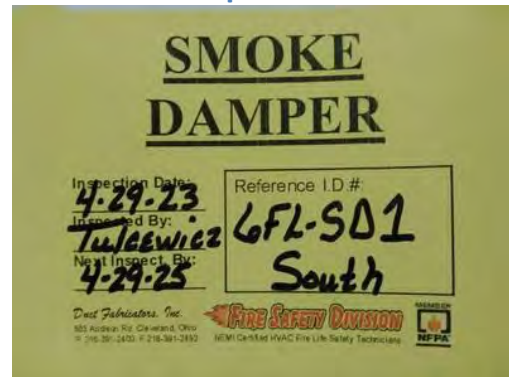

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-03-28

**Facility Location**  
Jail 1

**Damper Location**  
RM 616

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
6FL-SD2 North

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
20x16

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
12x5

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

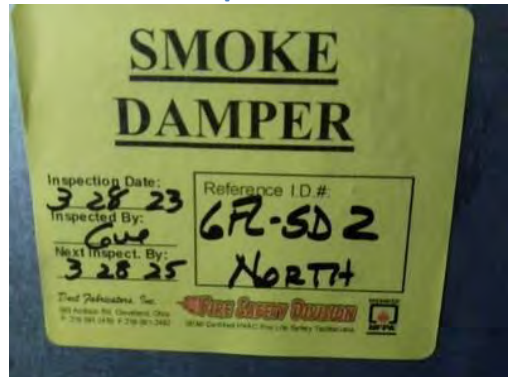

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

NW Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD3 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

60x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

18x18

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

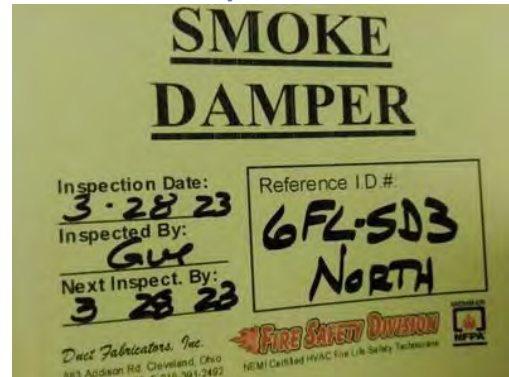

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-03-27

**Facility Location**  
Jail 1

**Damper Location**  
Rm 6A1

**Inspector Name**  
Dan Tulcewicz

**Damper I.D. #**  
6FL-SD3 South

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
18" x 8"

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
Open

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

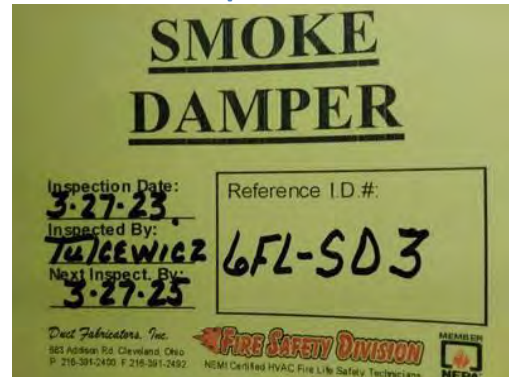

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-28

**Facility Location**

Jail 1

**Damper Location**

North Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD4 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

9" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

5"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

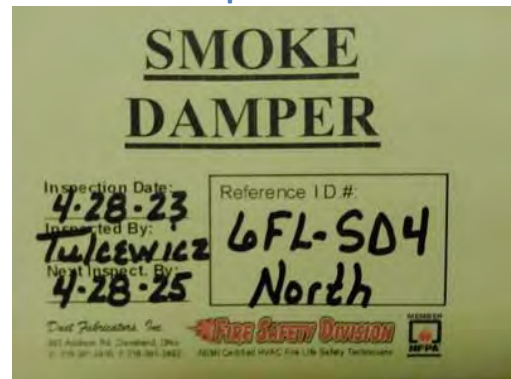

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD5 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

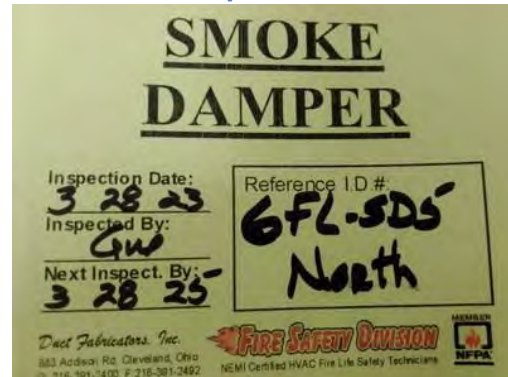

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southeast Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD5 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

60"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

11"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

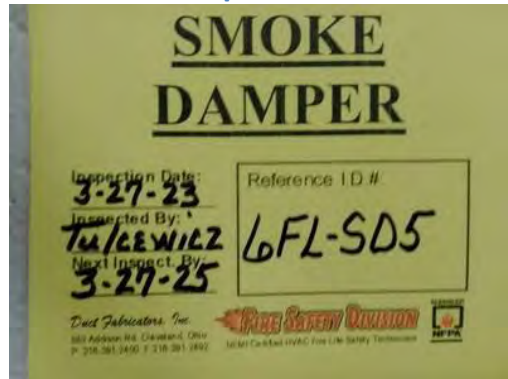

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD8 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

6 Round

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

3x3

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

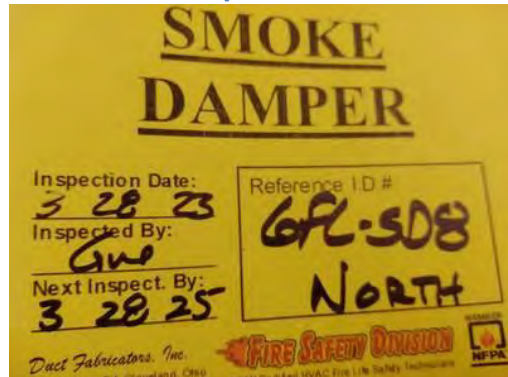



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

RM 6A1

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD8 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

8"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

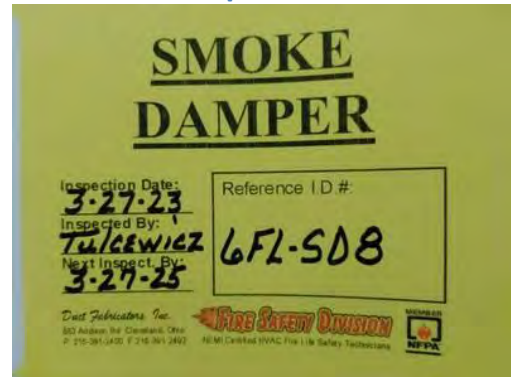

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

NW Corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD9 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

3x2

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

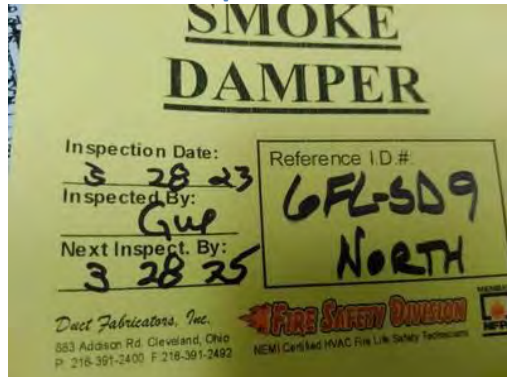

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

RM 6A1

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD9 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

18"x8"

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

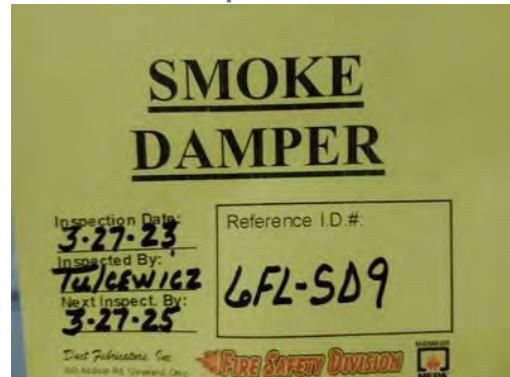

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-04-28

### Facility Location

Jail 1

### Damper Location

North Corridor

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

6FL-SD10 North

### Damper Type

Vertical Smoke Damper

### Damper Size

18" x 8"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

N/A

### Access Door Size

18" x 12"

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

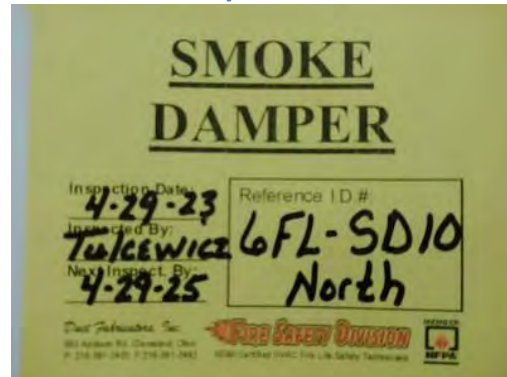

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD11 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

30x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10x17

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

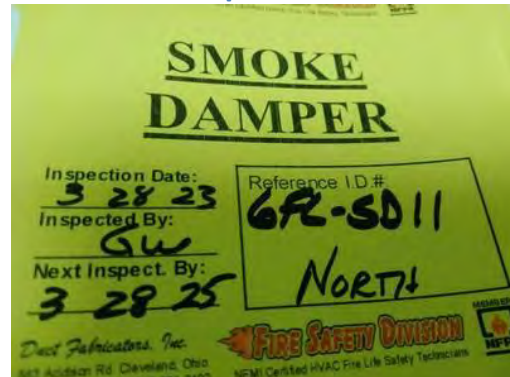

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southeast Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD11 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

8" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

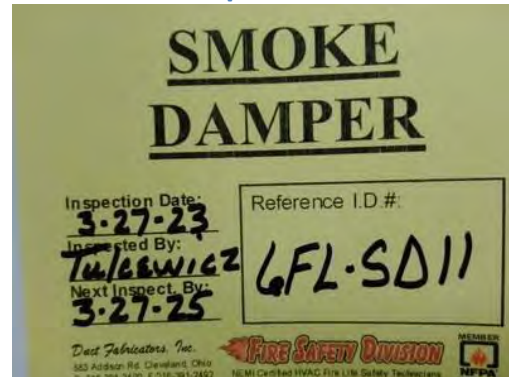

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD12 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

3x3

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

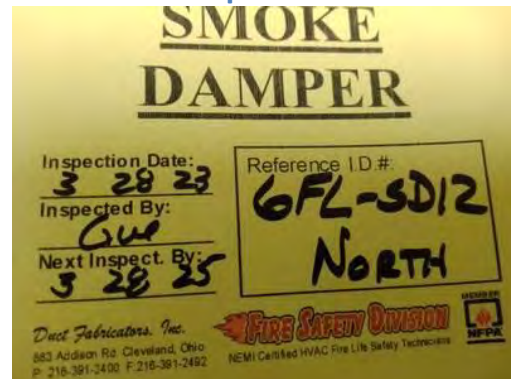

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southeast Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD12 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

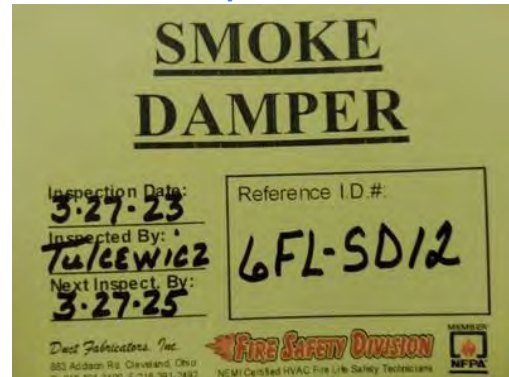



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD13 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

24x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

Pneumatic tubing is in the annular space


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

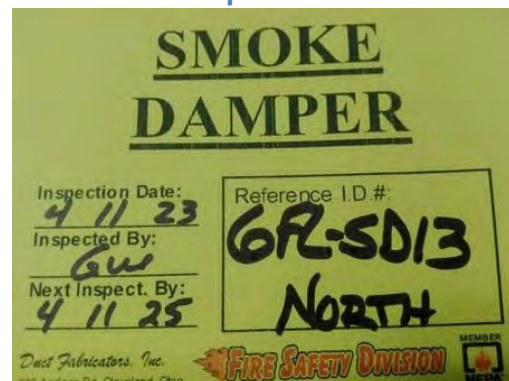

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD13 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

28"x10"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

17"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

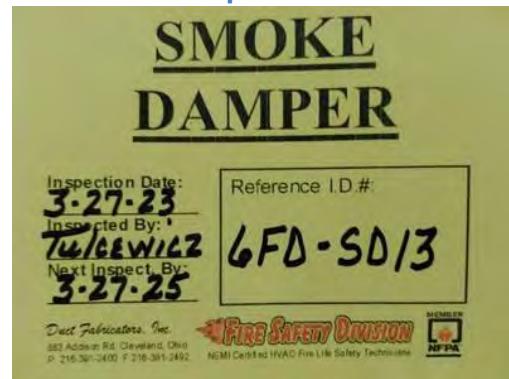

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD14 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

24x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

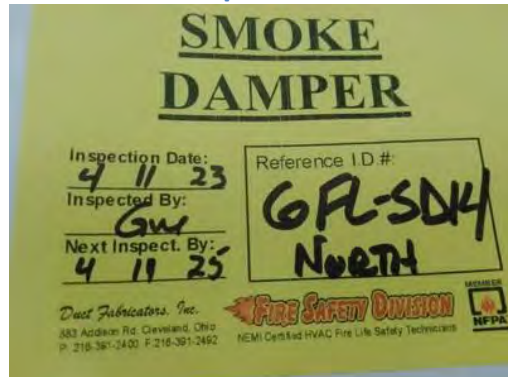

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD14 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

18" Round

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

3"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

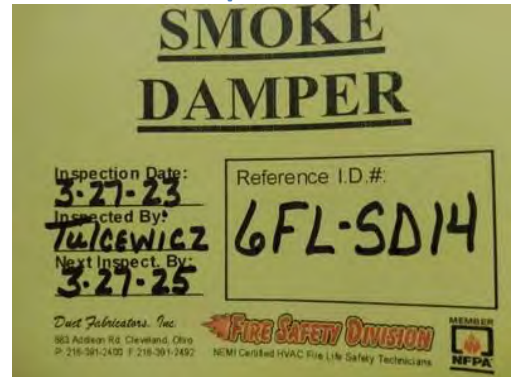

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

North corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD15 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

24x10

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

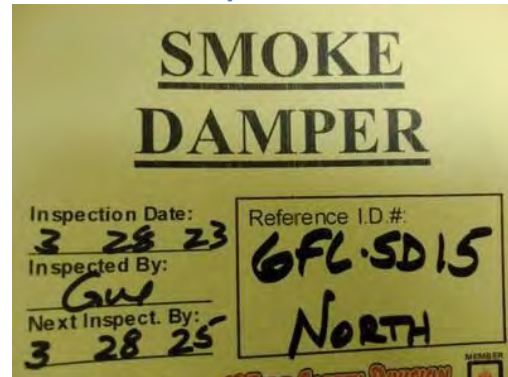

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD15 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

28" x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

3" x 4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

North corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD16 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

8" Round

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

7 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

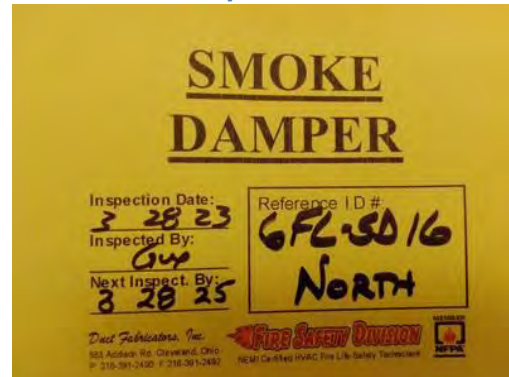

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD16 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

20"x10"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

5"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

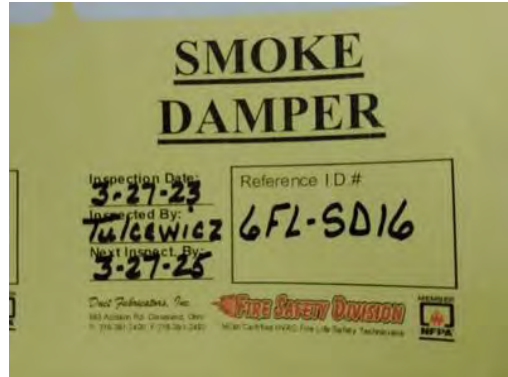



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

North corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD17 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

7x5

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

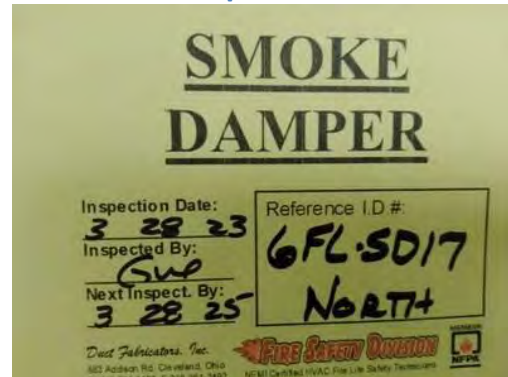

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD17 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

54"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12"X10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

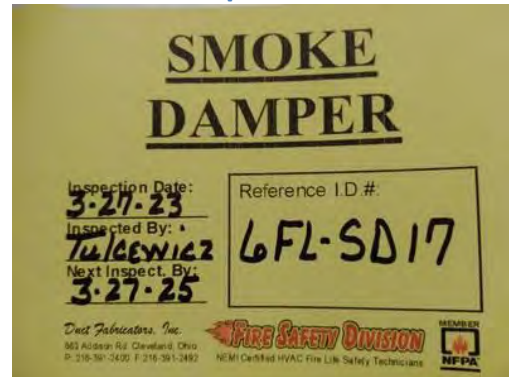

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD18 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

38"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

7"x7"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD19 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

4x4

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

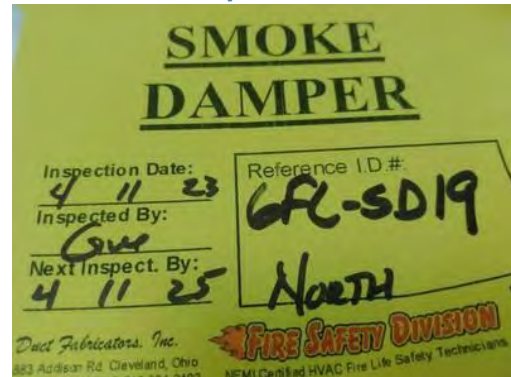

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD19 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14" x 6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

3" X 3"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

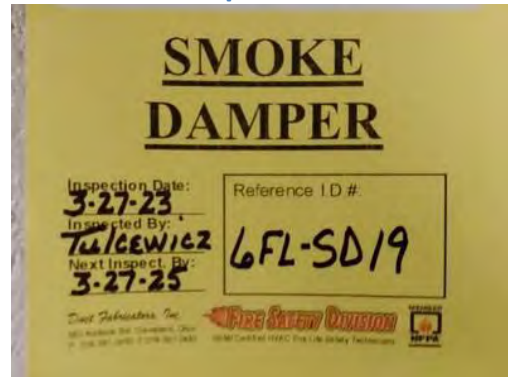

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-SD20 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48" x 12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

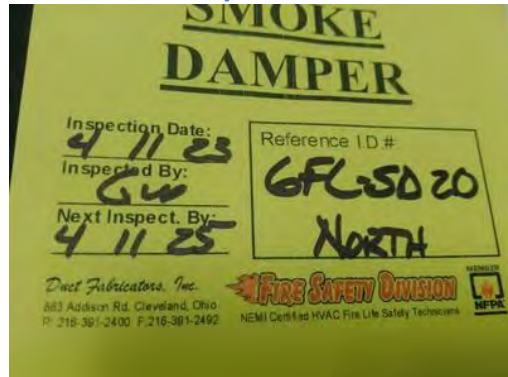

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-27

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD20 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14"x6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

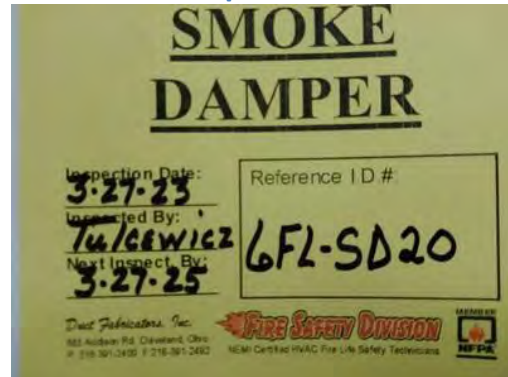

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod C

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD22 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16" x 16"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

4" x 8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod C

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD23 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

34" x 10"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

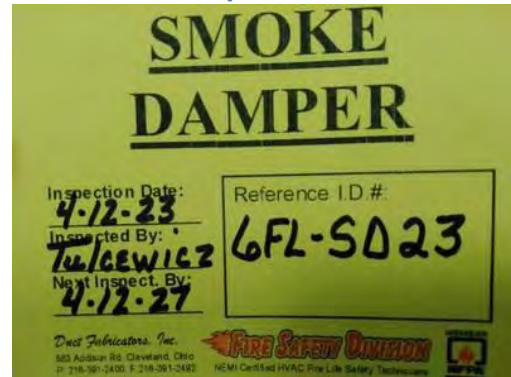

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod C

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD24 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

20" x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

4" x 4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-03

**Facility Location**

Jail 1

**Damper Location**

Outside pod 6C1

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

6FL-SD25 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

8"x8"

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the pipe.

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

Replaced the air line.


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

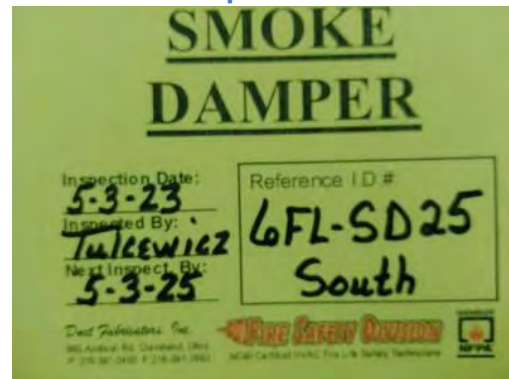

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-04-13

### Facility Location

Jail 1

### Damper Location

Pod H

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

7FL- SD19 North

### Damper Type

Vertical Smoke Damper

### Damper Size

6" round

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

3 x 5

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

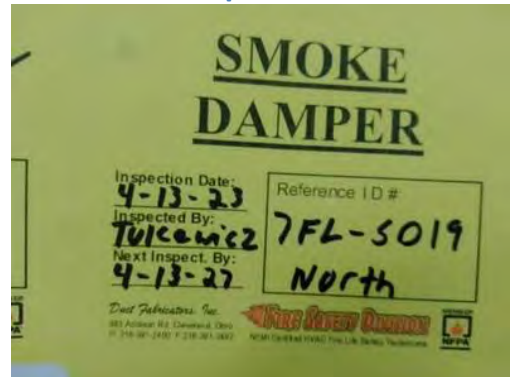

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-01

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD1 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

6" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove flex

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

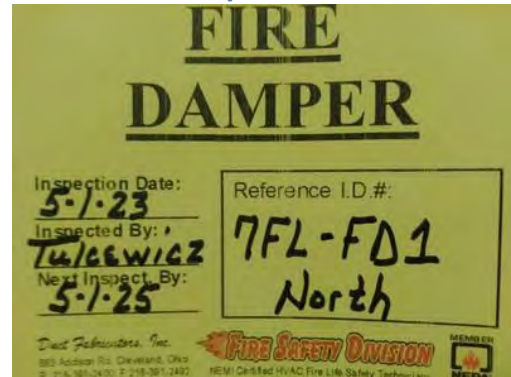

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD1 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

7"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

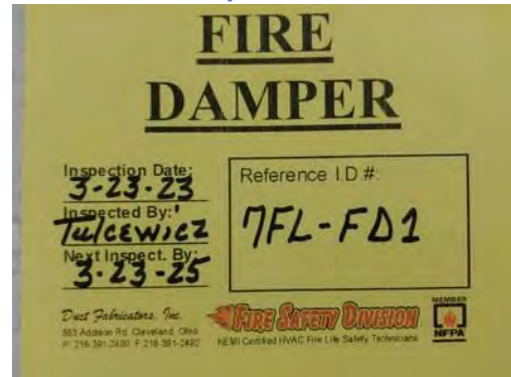

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD2 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

28"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F:216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD3 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

55"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD4 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

12"x6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-23

### Facility Location

Jail 1

### Damper Location

Northwest Corridor

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

7FL-FD5 North

### Damper Type

Vertical Fire Damper

### Damper Size

16" Round

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

12" Round

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None

### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD5 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

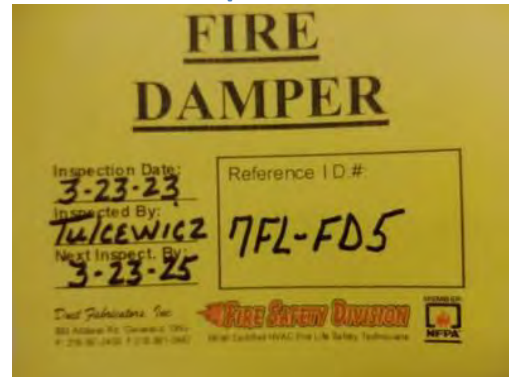

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD6 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

8" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Northwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD7 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

22"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-23

### Facility Location

Jail 1

### Damper Location

Northwest Corridor

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

7FL-FD8 North

### Damper Type

Vertical Fire Damper

### Damper Size

12"x6"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

10"x8"

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

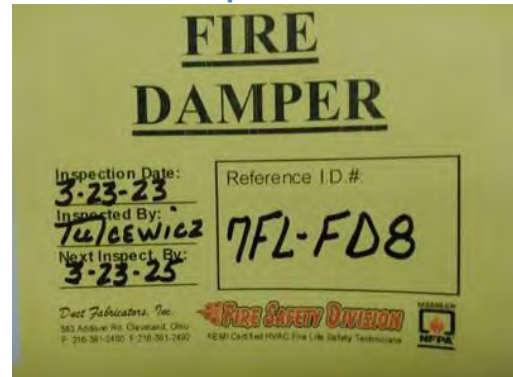

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-01

**Facility Location**

Jail 1

**Damper Location**

7J1 Door

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD8 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9"x9"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

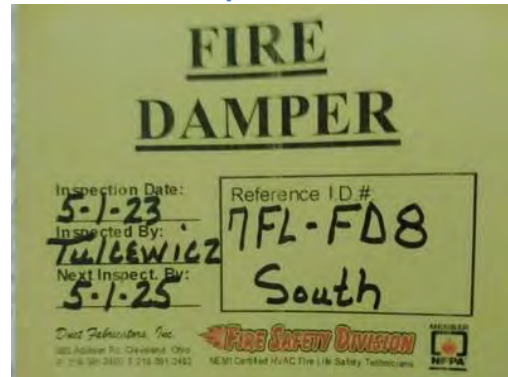

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD11 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

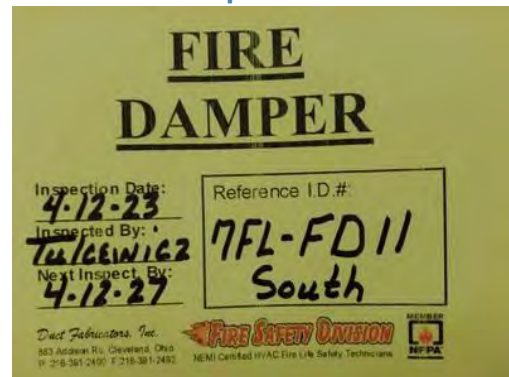



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD12 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

6" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

4" x 4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

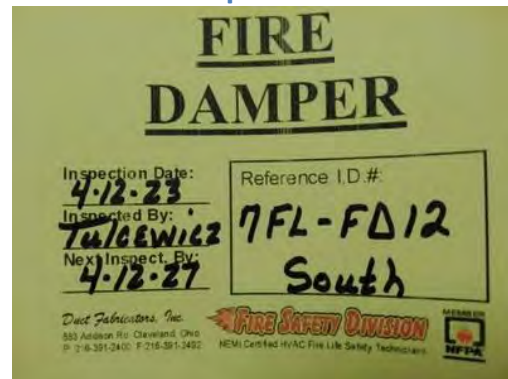

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD13 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

48" x 11"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" x 12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

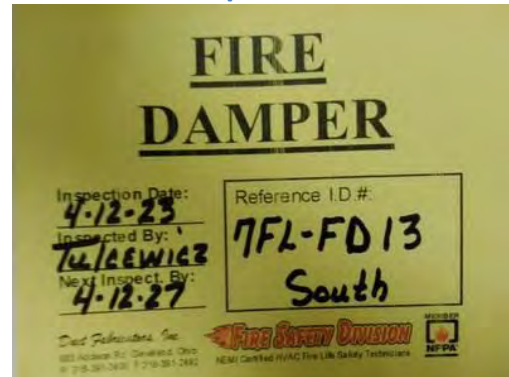

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD14 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

28" x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" x 12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

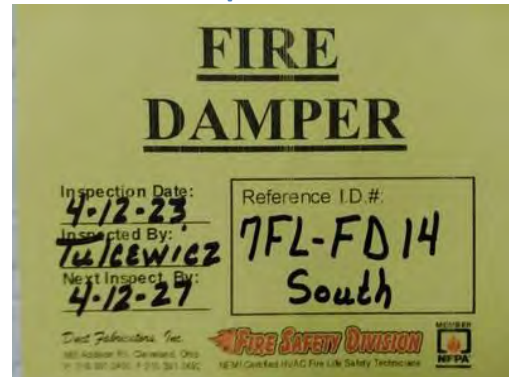

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD15 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Advanced Air

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

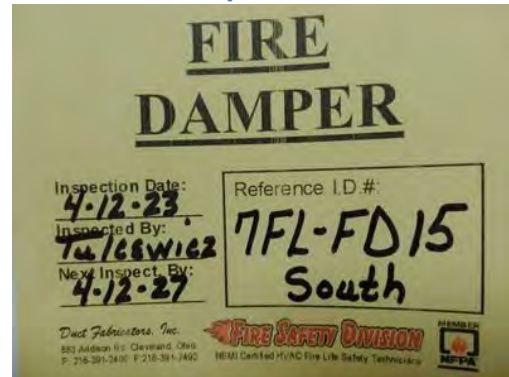

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD19 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

6" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

3" x 5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

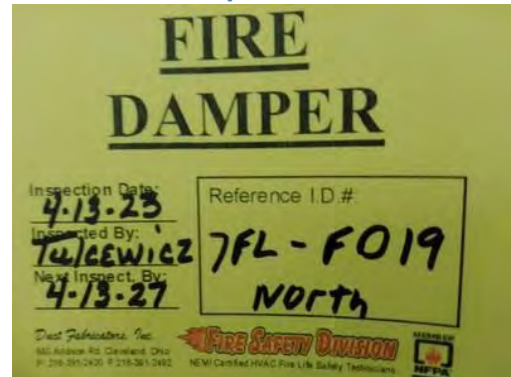

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD20 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10" x 5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

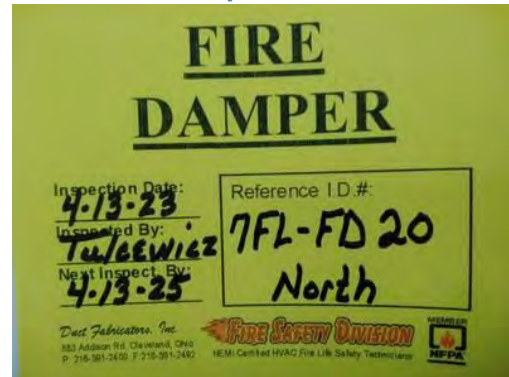

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD21 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

48" x 12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" x 12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD23 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

30" x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" x 8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

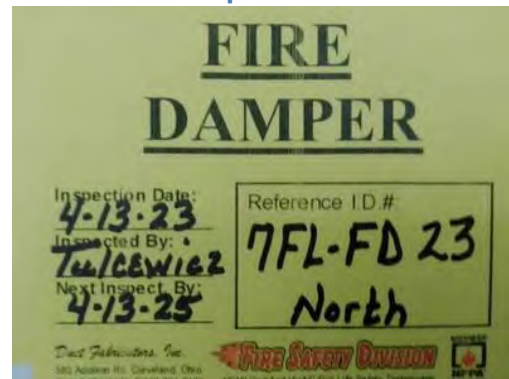



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD24 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

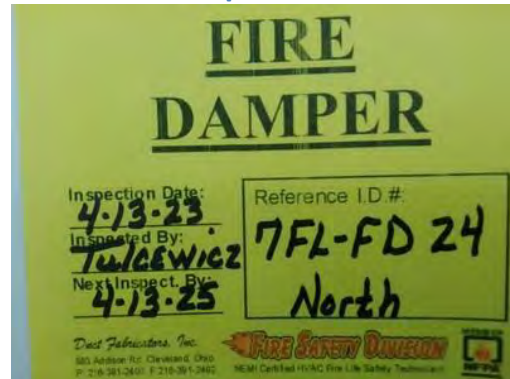

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Rm 712

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD27 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Rm 712

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-FD28 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

48" x 15"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" x 12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

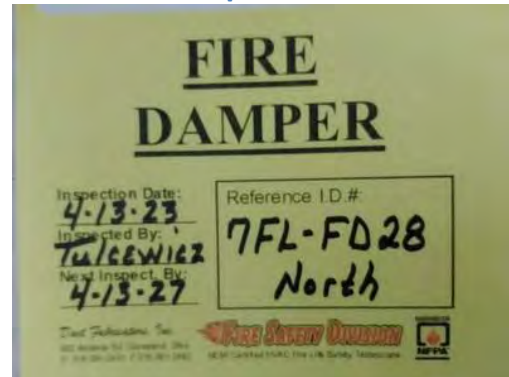

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD1 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

7"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

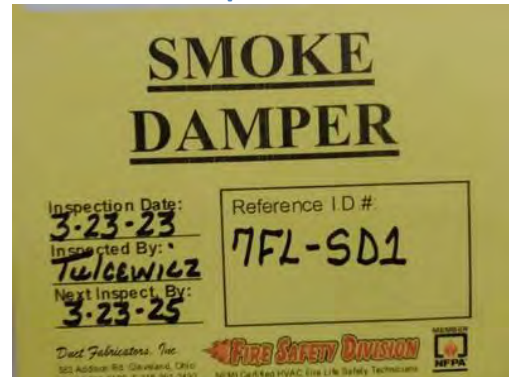

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-28

**Facility Location**

Jail 1

**Damper Location**

North Corridor.

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD2 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

7FL Northwest Hallway

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD3 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8"x8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

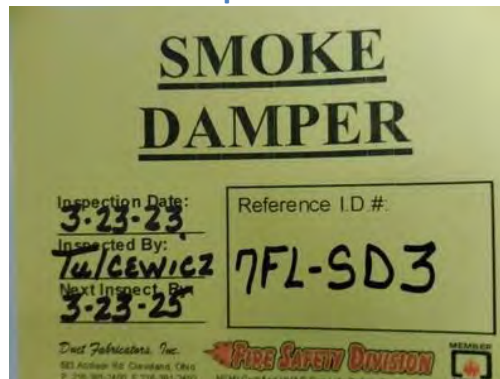

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD3 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

55"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Northwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD4 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

54"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

7"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

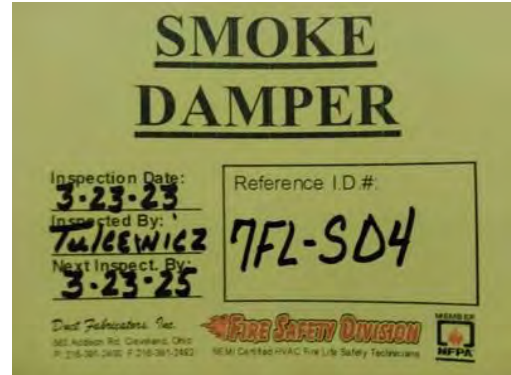



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Northwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD5 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

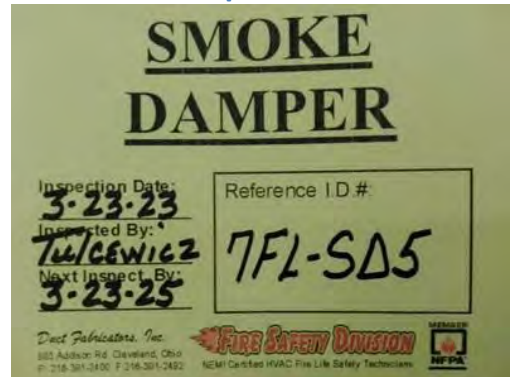

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD5 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

3"X3"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Northwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD6 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

8" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

5"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD6 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

8"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

3"x3"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Northwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD7 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

3"X3"

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

Need to check accuator

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD7 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16"x6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-25

**Facility Location**

Jail 1

**Damper Location**

NW corridor

**Inspector Name**

Julie Gue

**Damper I.D. #**

7FL-SD9 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22" x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6" x 6"

**Pass / Fail / Abandoned**

Pass


**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**

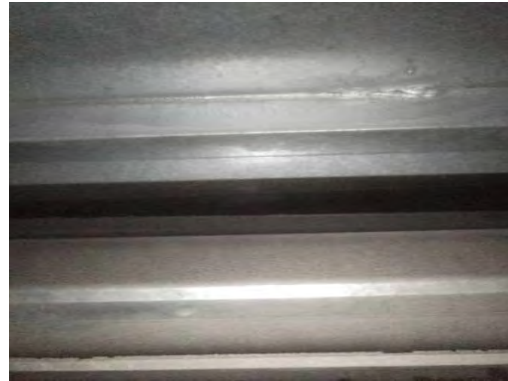

**Picture of Damper I.D. Label**

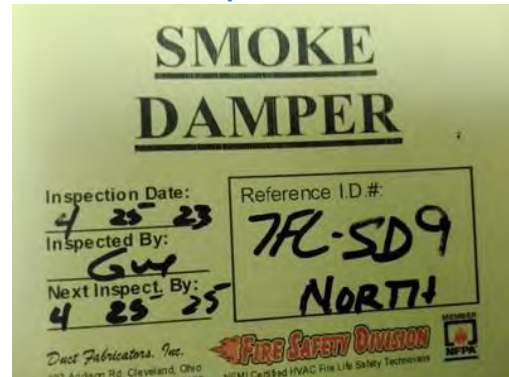

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD9 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

6" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Remove the Elbow

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Northwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD10 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

28"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

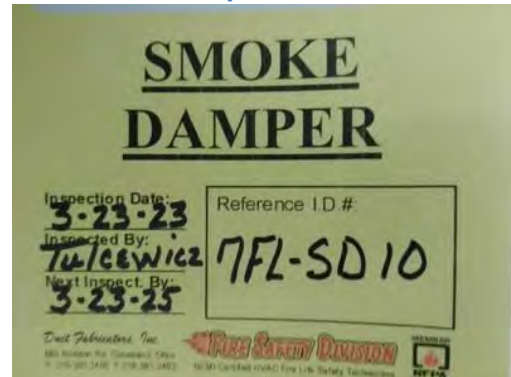

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

Northwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD11 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

4"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD11 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

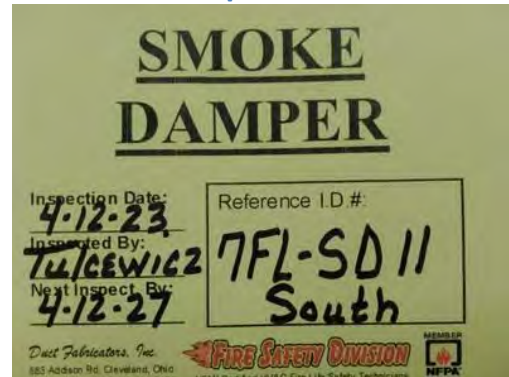

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

Northwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD12 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

6" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

4"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

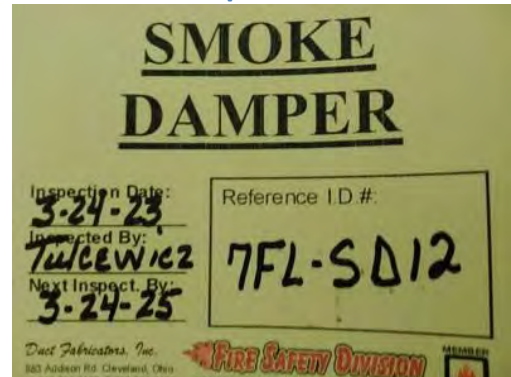

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD12 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

6" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

4" x 4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

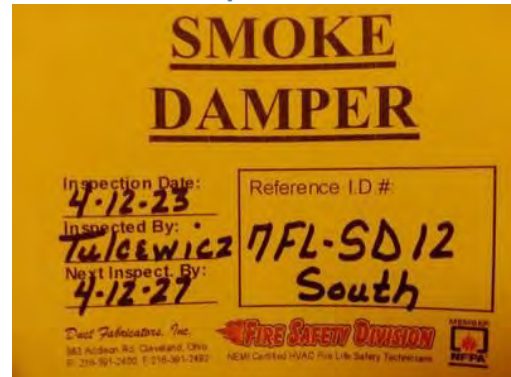

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

Northwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD13 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

24"x10"

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

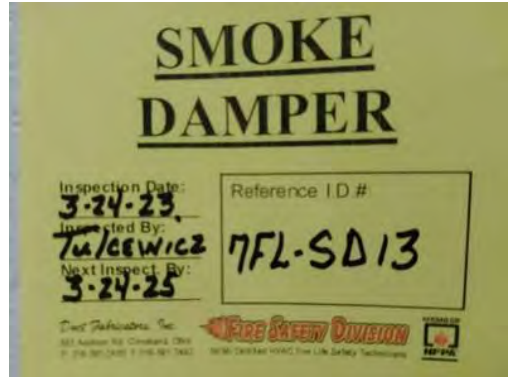

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD13 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48" x 11"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" x 12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

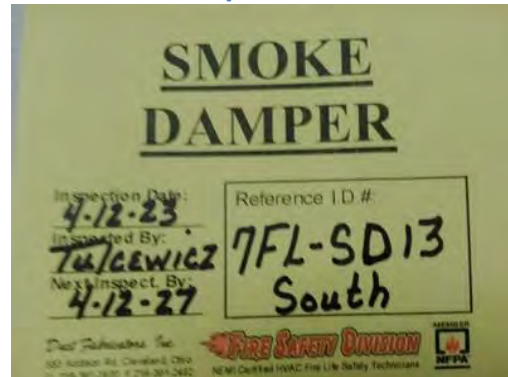

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

North Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD14 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

4"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

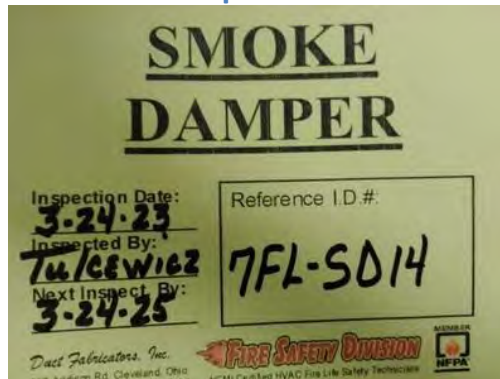



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-23

### Facility Location

Jail 1

### Damper Location

Northwest Corridor

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

7FL-SD15 North

### Damper Type

Horizontal Smoke Damper

### Damper Size

12"x10"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

N/A

### Access Door Size

Open

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

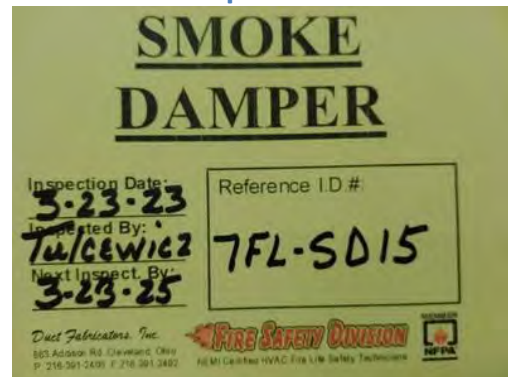

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD15 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

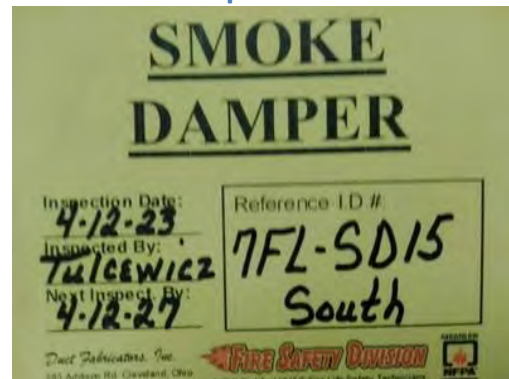

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

Northwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD16 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

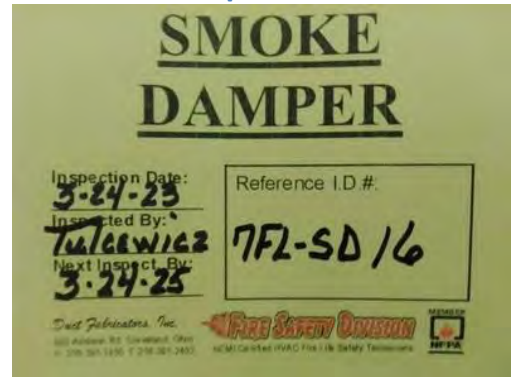

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

Northwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD16 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

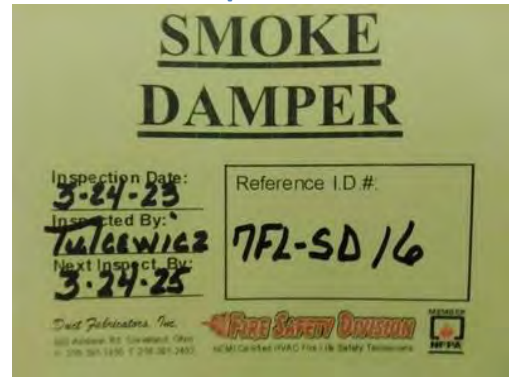

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD16 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6" x 5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

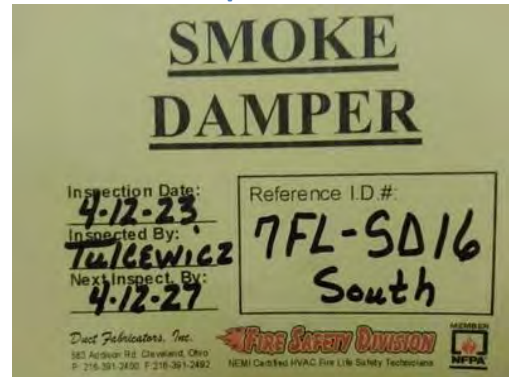

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-12

**Facility Location**

Jail 1

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD17 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

28" x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

5" x 4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

7FL-SD18 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

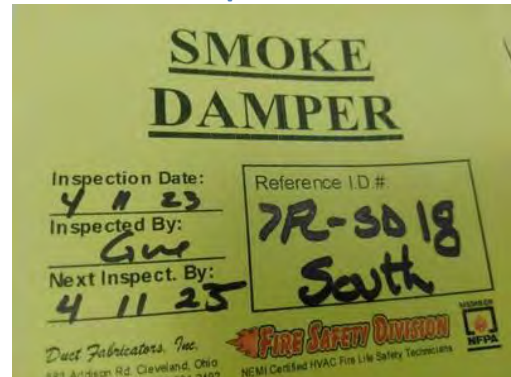

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule G

**Inspector Name**

Julie Gue

**Damper I.D. #**

7FL-SD18 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

15x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

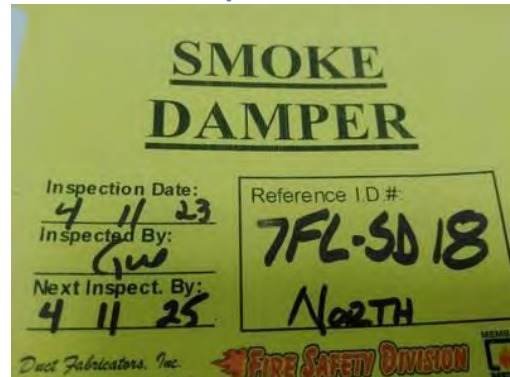



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

7FL-SD19 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

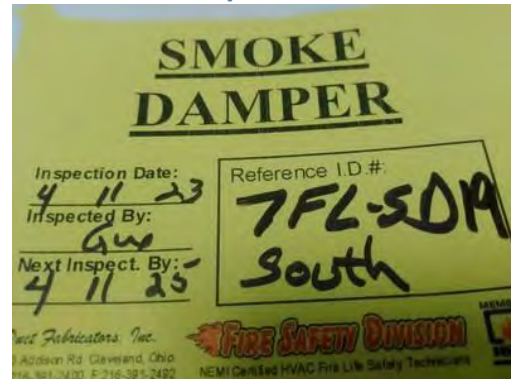

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD20 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10" x 5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

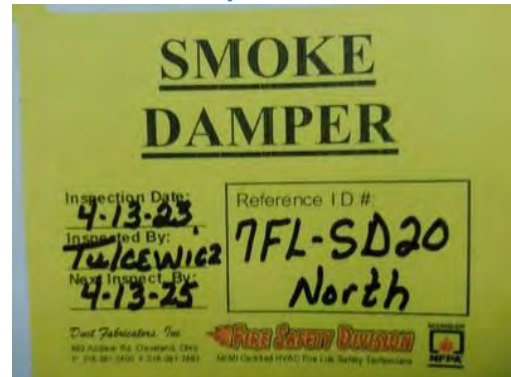

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule A/B

**Inspector Name**

Julie Gue

**Damper I.D. #**

7FL-SD20 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

44x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10x7

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

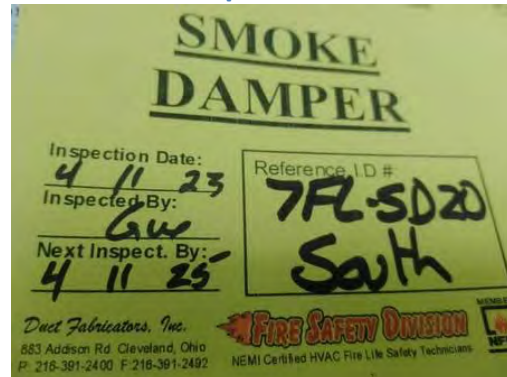

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD21 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48" x 12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" x 12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

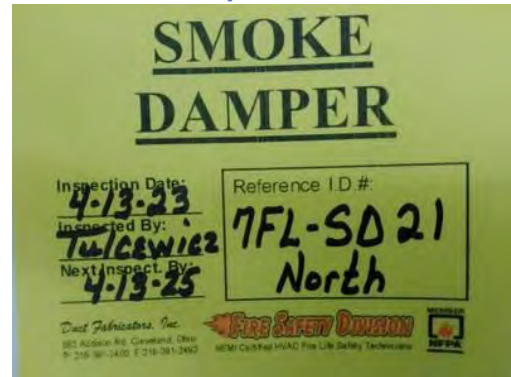

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD22 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

26" x 12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

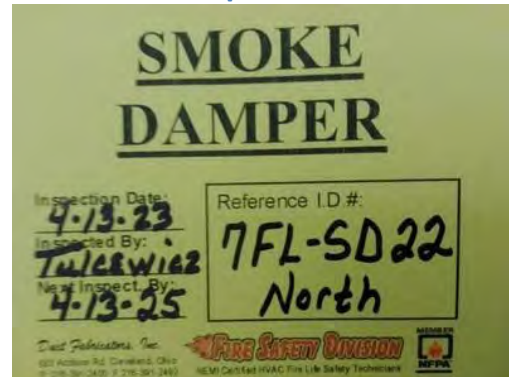

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule A/B

**Inspector Name**

Julie Gue

**Damper I.D. #**

7FL-SD22 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

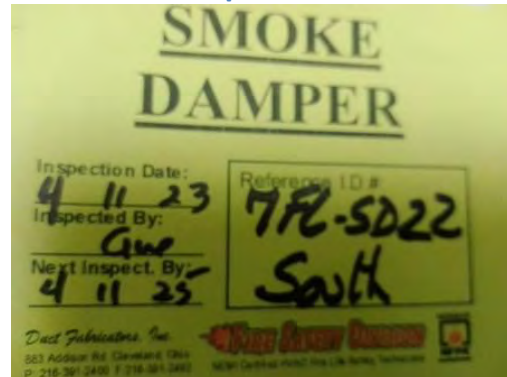

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD23 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

30" x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

18" x 8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

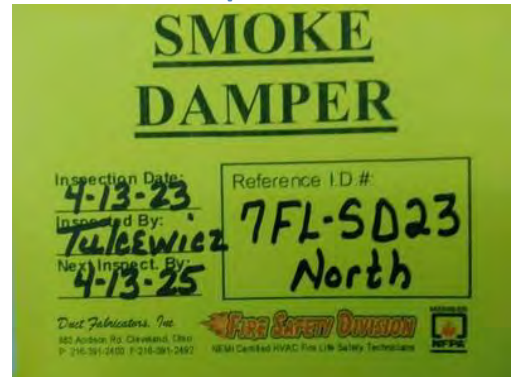

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Pod H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD24 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

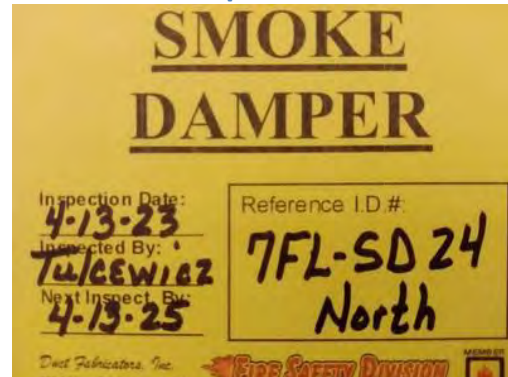



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-13

**Facility Location**

Jail 1

**Damper Location**

Rm #712

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-SD27 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

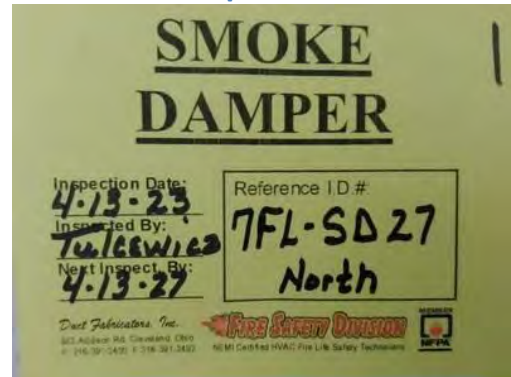

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

North Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-FD1 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

5" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the flex

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

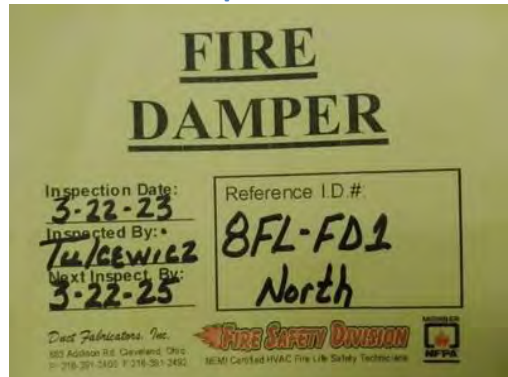

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-FD1 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

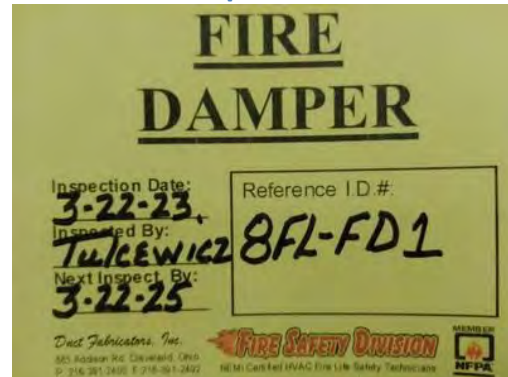

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-FD2 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

26"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-FD3 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

16"x6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

North Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-FD4 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

26"x11"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

7"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

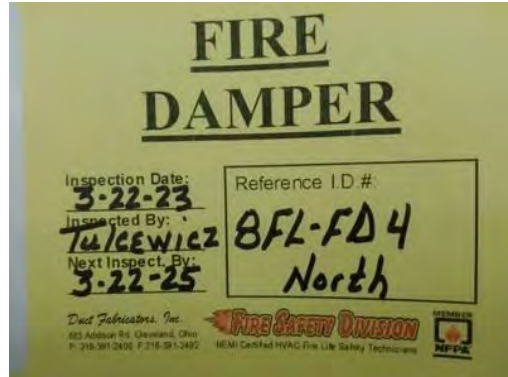

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-FD4 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

60"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

16"x11

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-FD5 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

17" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

North Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-FD7 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

18"x12"

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD20

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

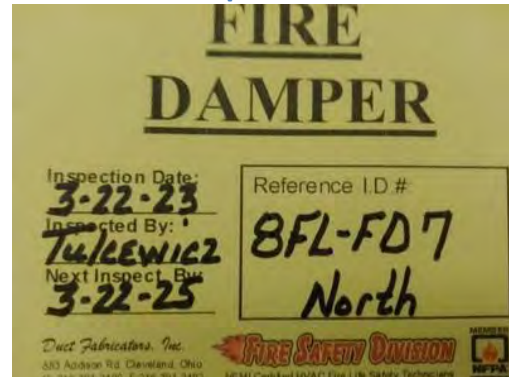

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-22

### Facility Location

Jail 1

### Damper Location

South Corridor

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

8FL-FD7 South

### Damper Type

Vertical Fire Damper

### Damper Size

18"x12"

### Damper Manufacturer

Prefco Products

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

Open

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None

### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-03

**Facility Location**

Jail 1

**Damper Location**

Room#811

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-FD21 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

13"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

Cut in new access door

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-03

**Facility Location**

Jail 1

**Damper Location**

Room #811

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-FD22 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

54"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

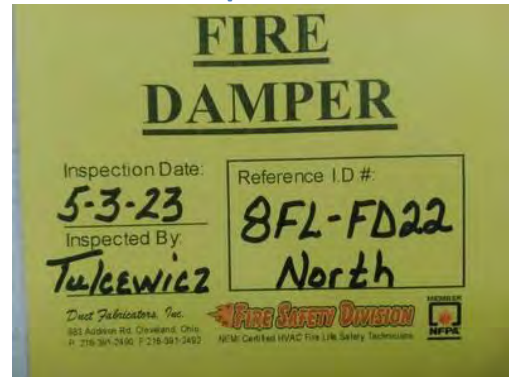

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-05-08

### Facility Location

Jail 1

### Damper Location

In front of pod G/H

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

8FL-FSD1 North

### Damper Type

Vertical Smoke Damper

### Damper Size

6"x6"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

N/A

### Access Door Size

4"x4"

### Pass / Fail / Abandoned

Fail

### Comments / Corrections

Need to order new 6"x6" damper with 18" long sleeve raw on both ends.


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

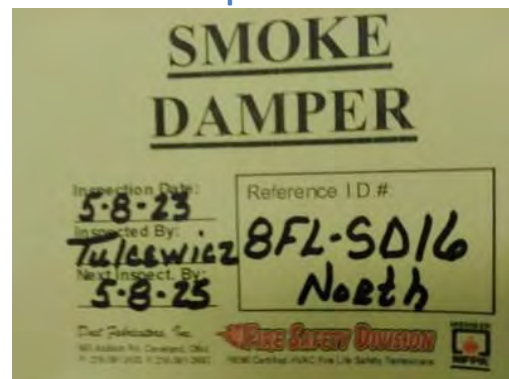

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-SD1 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

16" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

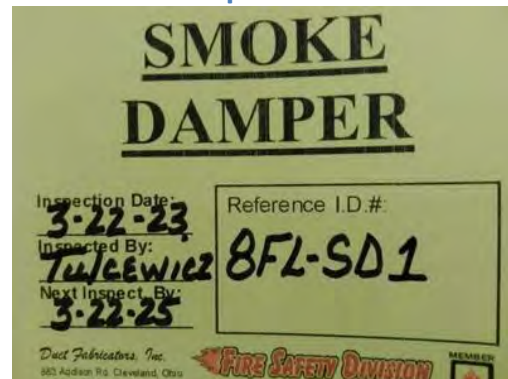

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

North Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-SD2 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

54"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

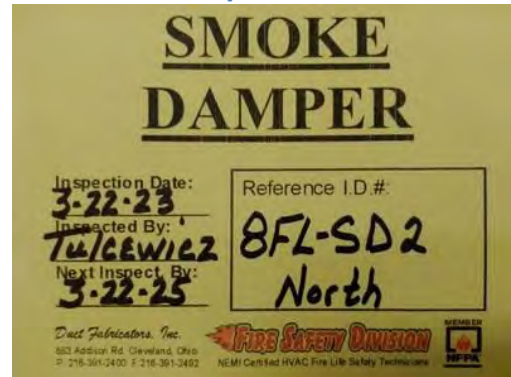

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

North Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-SD3 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

9" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

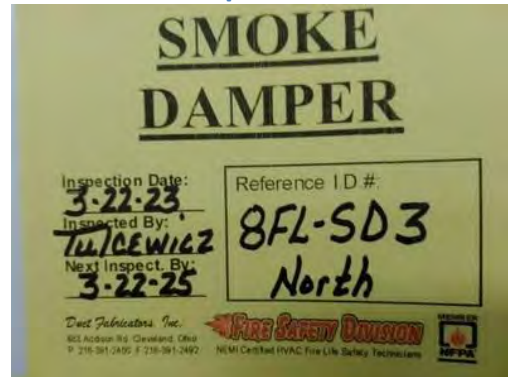



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-SD4 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

60"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

16"x11"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

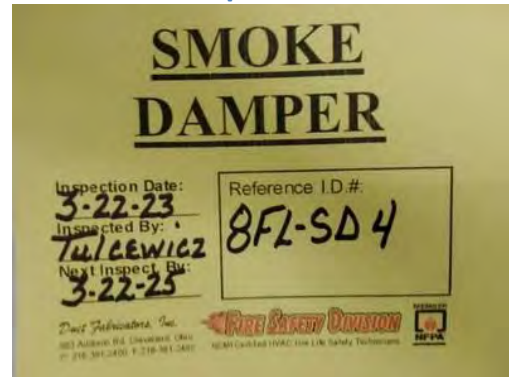

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-SD5 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

17" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-04-25

### Facility Location

Jail 1

### Damper Location

NW corridor

### Inspector Name

Julie Gue

### Damper I.D. #

8FL-SD6 North

### Damper Type

Vertical Smoke Damper

### Damper Size

12" Round

### Damper Manufacturer

Unknown

### Damper Model #

Unknown

### Fusible Link Temperature

N/A

### Access Door Size

8" x 5"

### Pass / Fail / Abandoned

Fail

### Comments / Corrections

Actuator not functioning.  
Damper/actuator repaired.  
Not functioning. Not enough air

### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-22

### Facility Location

Jail 1

### Damper Location

North Corridor

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

8FL-SD6 North

### Damper Type

Vertical Smoke Damper

### Damper Size

14"x14"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

N/A

### Access Door Size

8"x5"

### Pass / Fail / Abandoned

Fail


### Comments / Corrections

Need to address accuator  
Found in closed position


### Exterior Picture of Damper



### Interior Picture of Damper

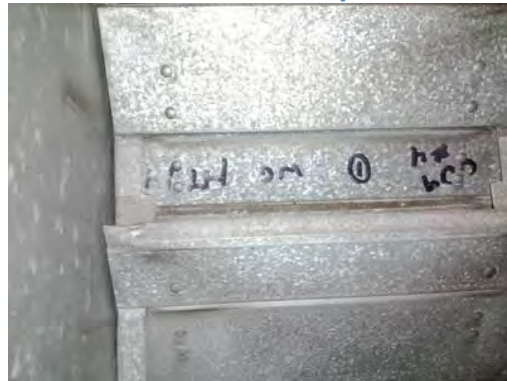

### Picture of Damper I.D. Label

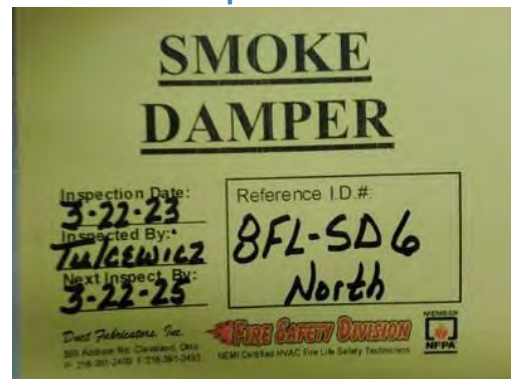

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-SD6 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

18"x18"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

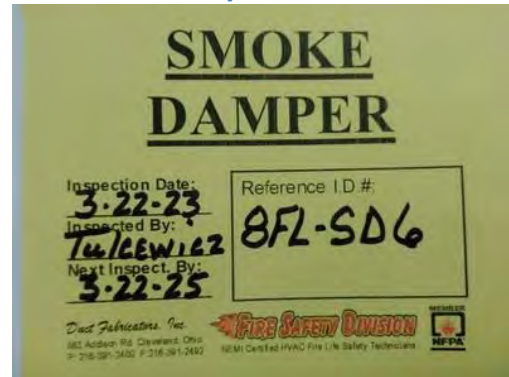

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD8 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10x6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

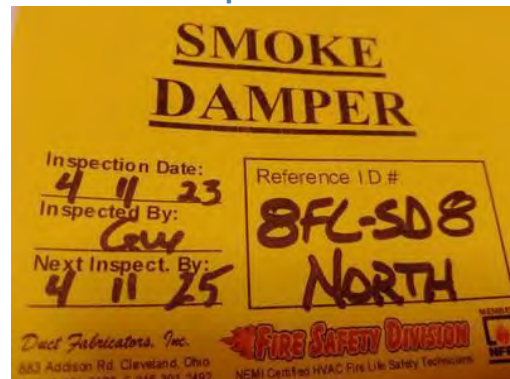

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-23

**Facility Location**

Jail 1

**Damper Location**

Southwest Corridor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-SD8 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

8" Round

**Damper Manufacturer**

Ruskin

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

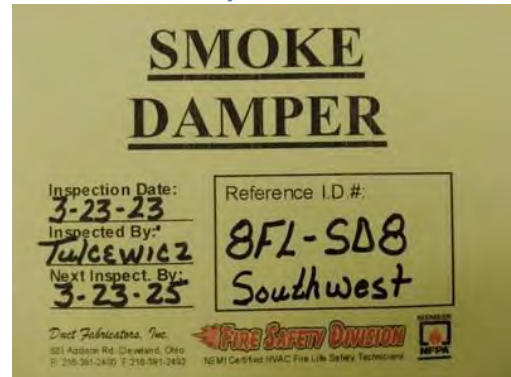

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD9 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

24x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

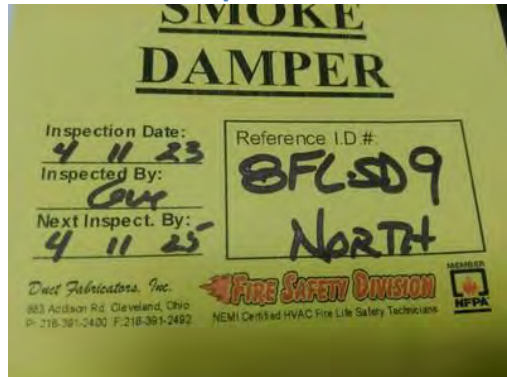



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule A/B

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD9 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

17x4

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

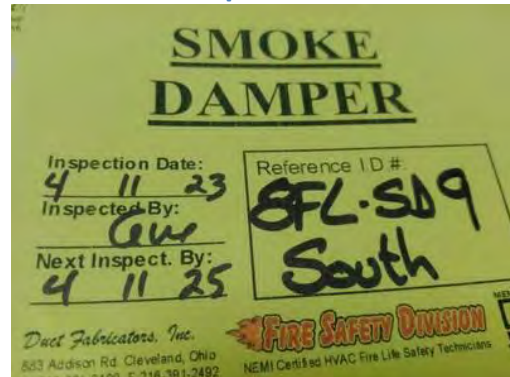

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD10 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

54x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

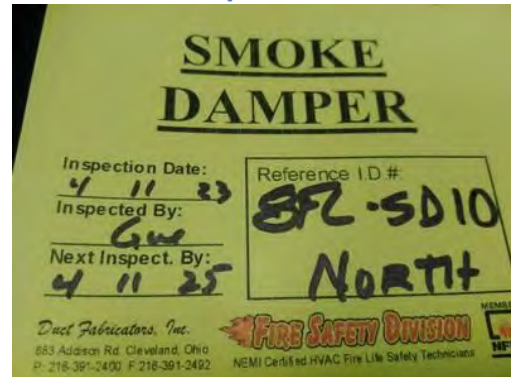

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule A/B

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD10 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6x6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

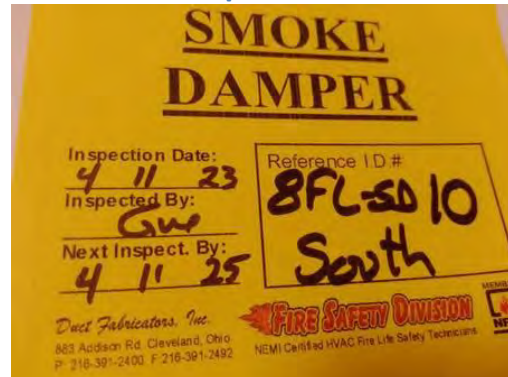

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD11 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

24x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

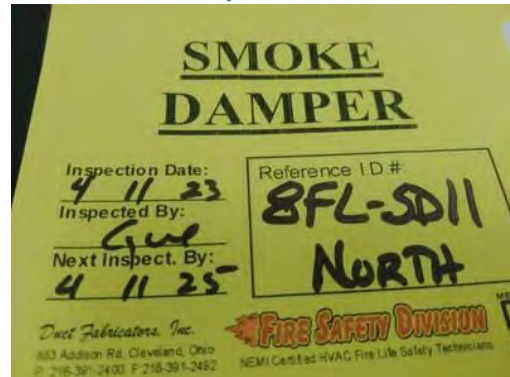

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD12 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

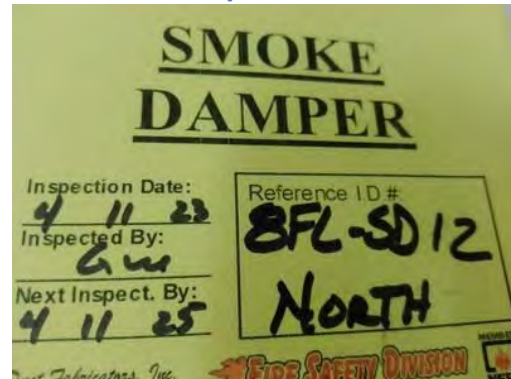

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-25

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD13 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6x5

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

Bad actuator


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

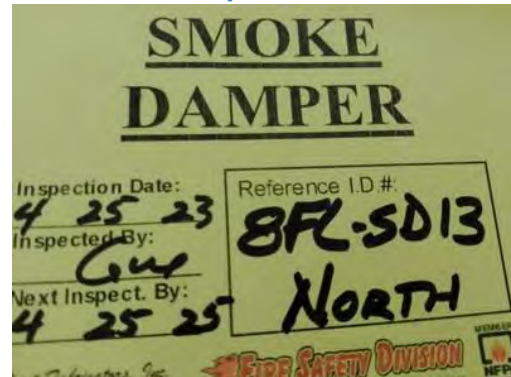

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-05-03

### Facility Location

Jail 1

### Damper Location

Vestibule E/F

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

8FL-SD13 North

### Damper Type

Vertical Smoke Damper

### Damper Size

8" Round

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

N/A

### Access Door Size

5"x6"

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

Replaced actuator. Damper is opening and closing properly.


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

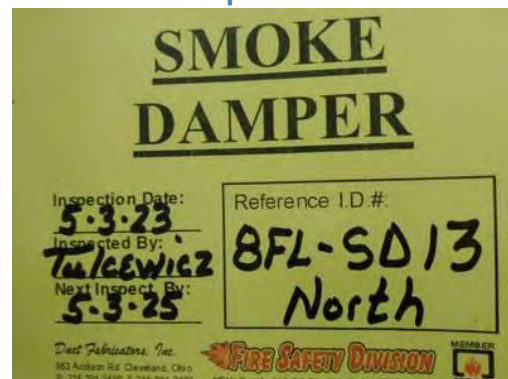

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-08

**Facility Location**

Jail 1

**Damper Location**

Vestibule G/H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-SD14 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

30" x 11"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

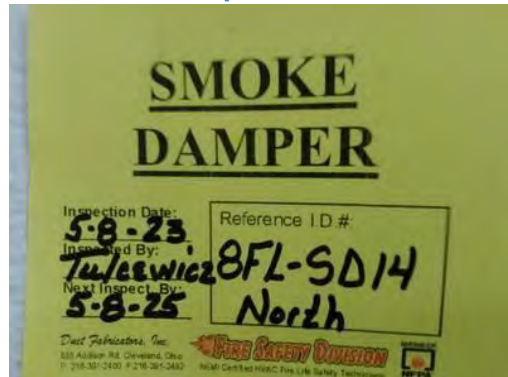



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD14 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

18x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

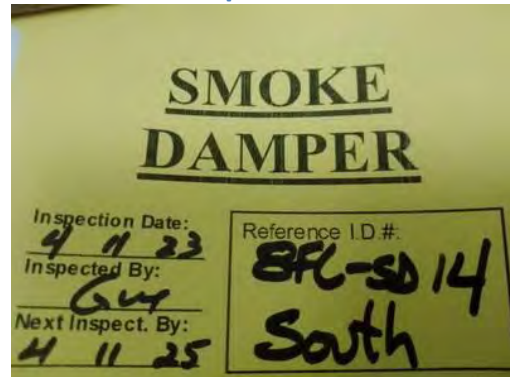

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD15 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

26x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

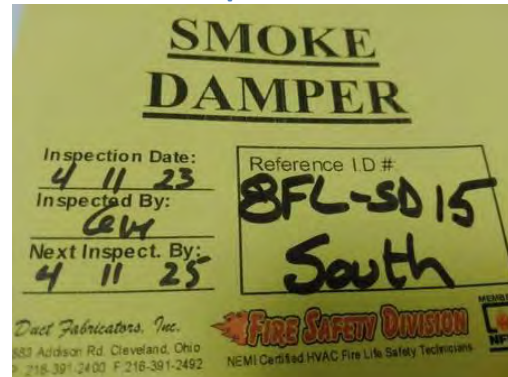

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-08

**Facility Location**

Jail 1

**Damper Location**

Vestibule G/H

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-SD15 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

17"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD16 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

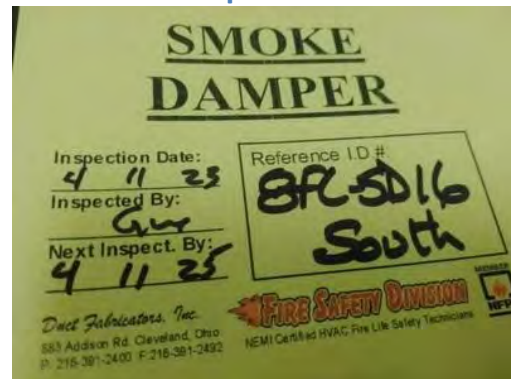

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-08

**Facility Location**

Jail 1

**Damper Location**

Outside EF pod

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-SD17 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8x6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

Installed new access door


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

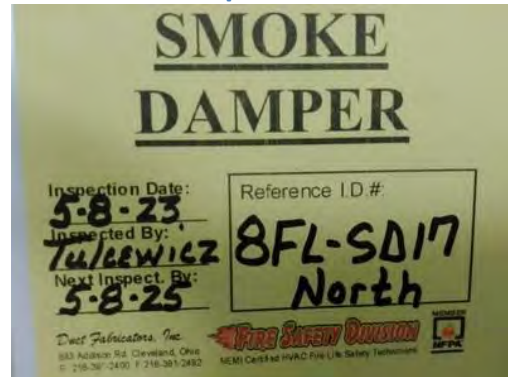

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD17 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

26x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8x6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

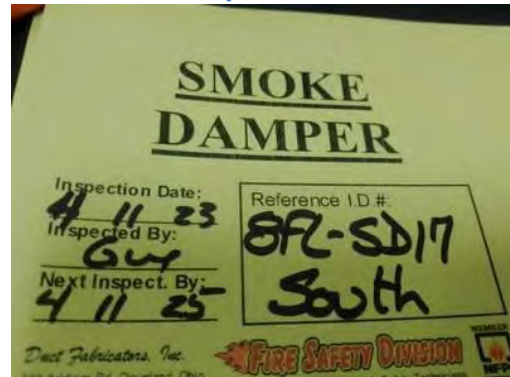

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD18 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

19x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

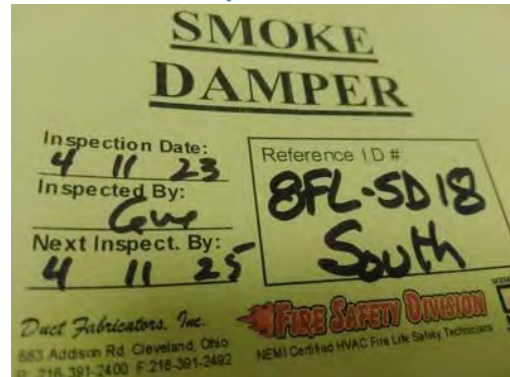

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-11

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-SD19 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

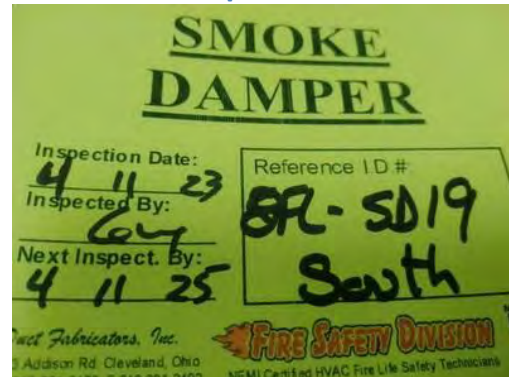



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-03

**Facility Location**

Jail 1

**Damper Location**

Room #811

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

8FL-SD21 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

Repaired linkage  
of actuator.


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

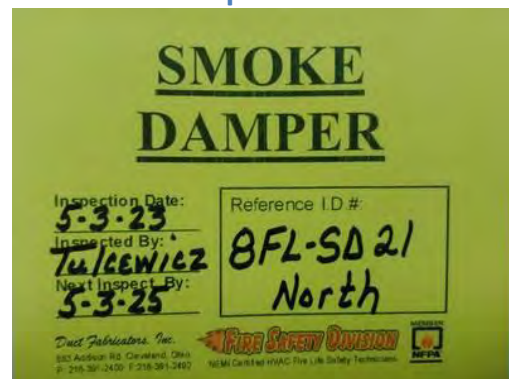

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD1 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

6" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the flex

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

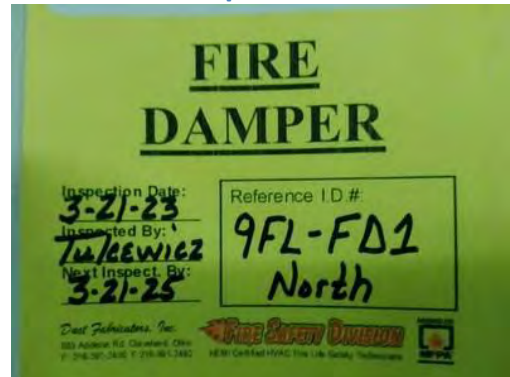

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD1 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD2 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

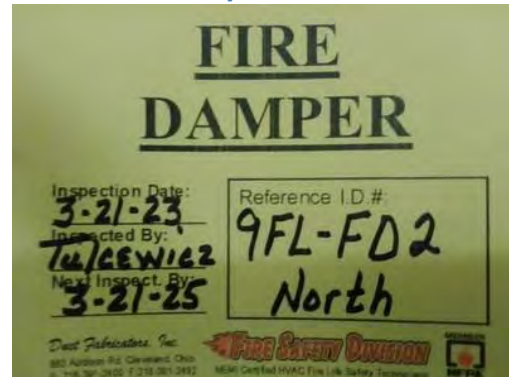

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD2 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

22"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

13"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-21

### Facility Location

Jail 1

### Damper Location

9FL North

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

9FL-FD3 North

### Damper Type

Vertical Fire Damper

### Damper Size

48"x14"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

18"x12"

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

Label Mismarked  
Damper is FD3


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

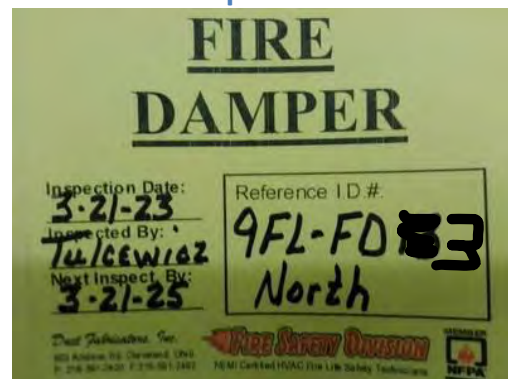

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-01

**Facility Location**

Jail 1

**Damper Location**

Arraignment

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD5 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

5" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

5"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD6 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

17"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

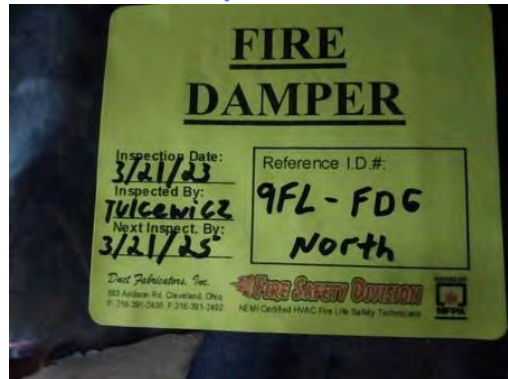



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-01

**Facility Location**

Jail 1

**Damper Location**

Arraignment

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD6 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

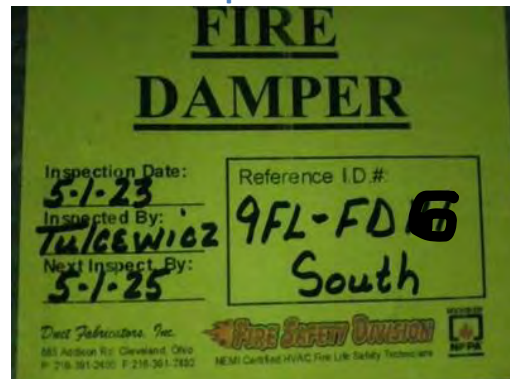

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD7 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

22"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD9 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

12"x6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-25

**Facility Location**

Jail 1

**Damper Location**

H Pod

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-FD10 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

30" x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

7" x 6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-21

### Facility Location

Jail 1

### Damper Location

9FL South

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

9FL-FD10 South

### Damper Type

Vertical Fire Damper

### Damper Size

22"x8"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

12"x12"

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

Mismarked this is FD10 S


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

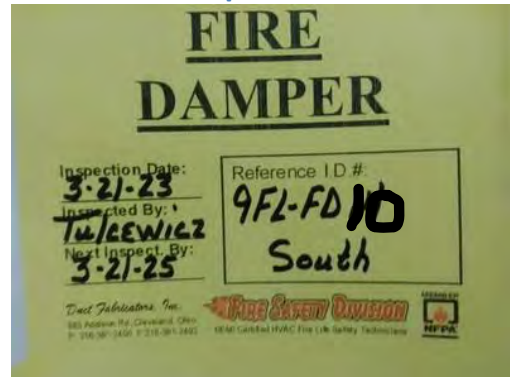

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-25

**Facility Location**

Jail 1

**Damper Location**

H Pod

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-FD11 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

48" x 12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

17" x 14"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD13 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

44"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18"x9"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

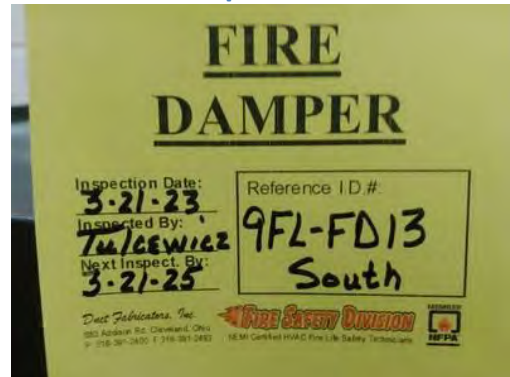

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-25

**Facility Location**

Jail 1

**Damper Location**

H Pod

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-FD14 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

8" x 6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8" x 5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-25

**Facility Location**

Jail 1

**Damper Location**

H Pod

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-FD19 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

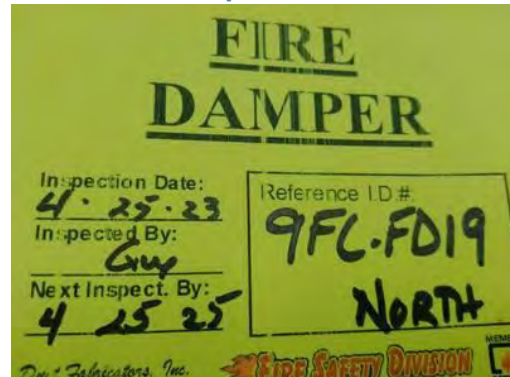

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-02

**Facility Location**

Jail 1

**Damper Location**

9FL Visitation North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD20 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

5" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

5"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

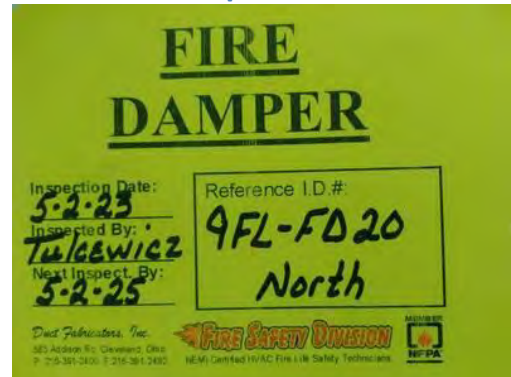

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-02

**Facility Location**

Jail 1

**Damper Location**

Room #9H16

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FD21 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

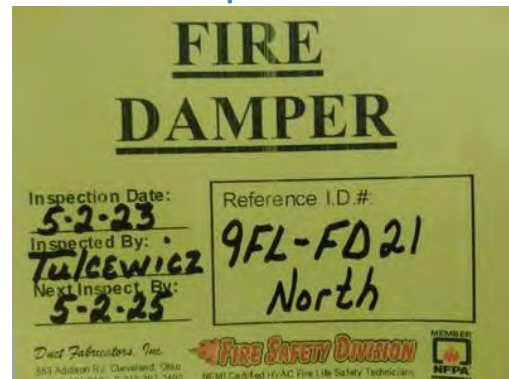

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FSD1 North

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

12"x8"

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD1 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

10"x8"

**Damper Manufacturer**

Nailor

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

7"x7"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

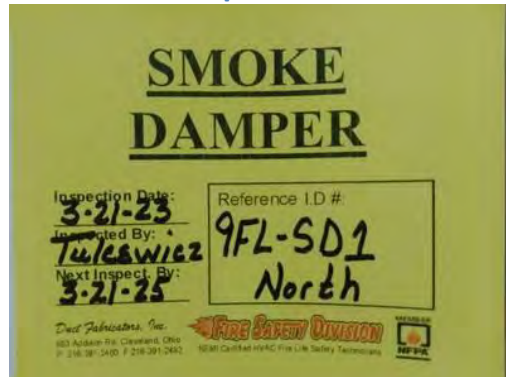

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD1 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-24

**Facility Location**  
Jail 1

**Damper Location**  
North #912

**Inspector Name**  
Dan Tulcewicz

**Damper I.D. #**  
9FL-SD2 North

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
12" Round

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
7" x 5"

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

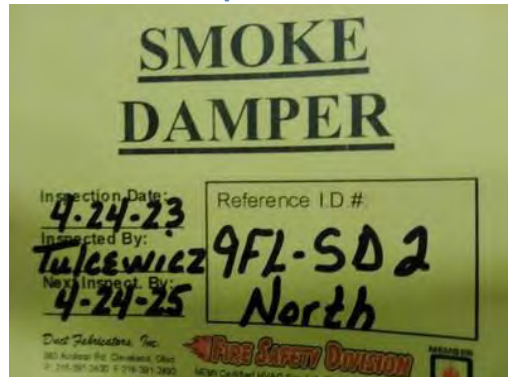

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-24

**Facility Location**

Jail 1

**Damper Location**

North #912

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD3 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48"x14"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

18"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

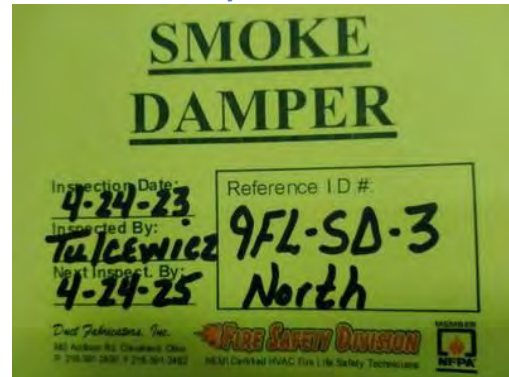



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD3 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

28"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

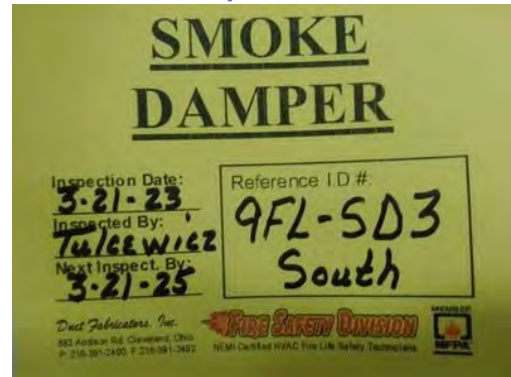

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD4 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

7"x5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-01

**Facility Location**

Jail 1

**Damper Location**

Arrestment

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD4 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

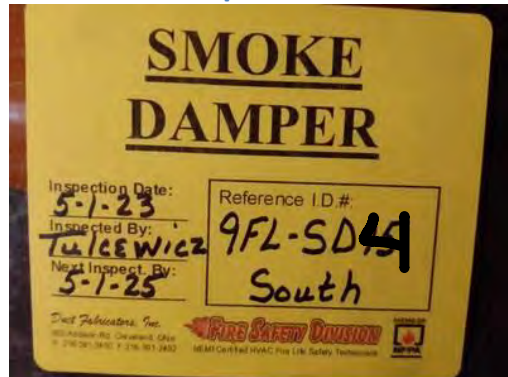

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-01

**Facility Location**

Jail 1

**Damper Location**

Arraignment

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD5 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

5" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

5" x 5"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

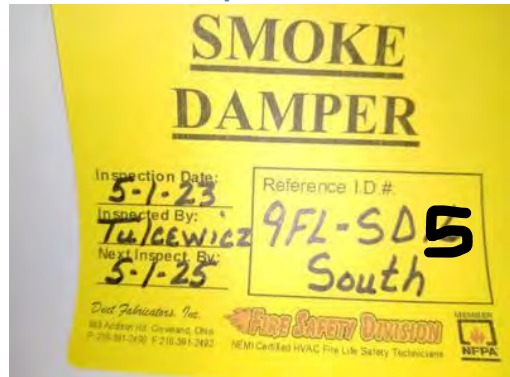

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD6 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

17" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-01

**Facility Location**

Jail 1

**Damper Location**

Arrestment

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD6 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

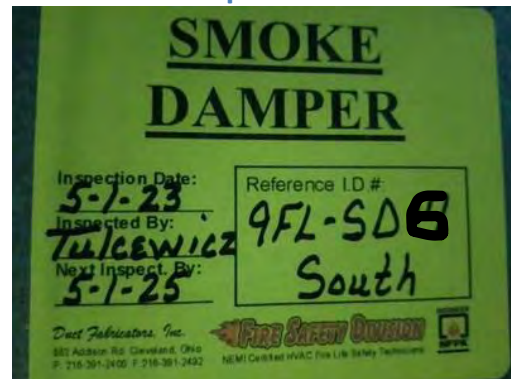

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD8 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12"x8"

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

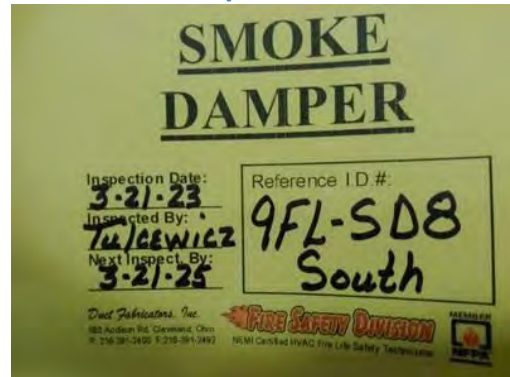

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

9FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD9 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

6"x6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

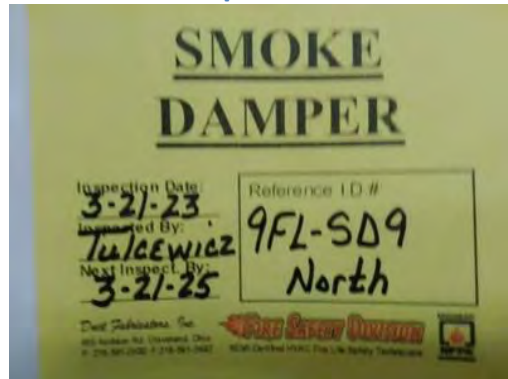



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-03-21

**Facility Location**  
Jail 1

**Damper Location**  
9FL South

**Inspector Name**  
Dan Tulcewicz

**Damper I.D. #**  
9FL-SD9 South

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
12"x8"

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
Open

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

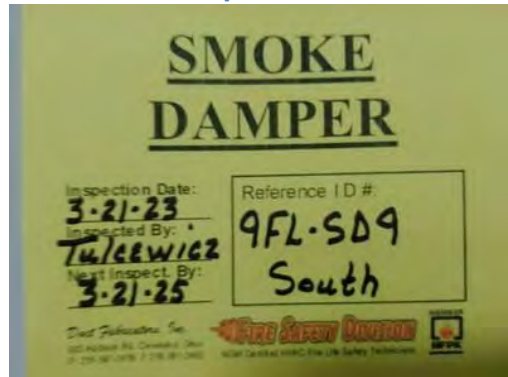

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-25

**Facility Location**

Jail 1

**Damper Location**

H Pod Arraignment

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-SD10 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

28" x 11"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

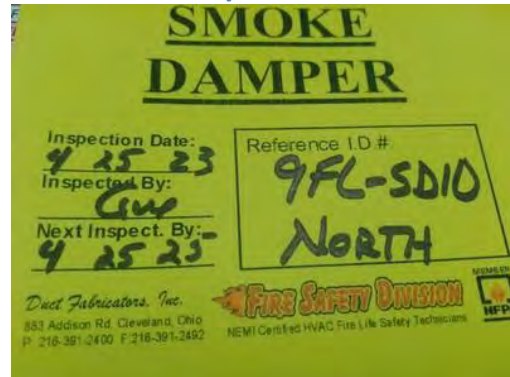

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-25

**Facility Location**

Jail 1

**Damper Location**

H Pod

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-SD11 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48" x 12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

17" x 14"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

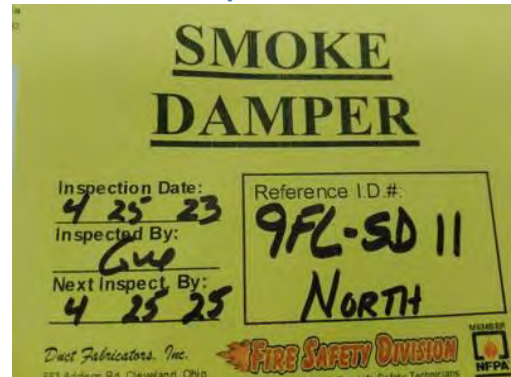

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-21

**Facility Location**

Jail 1

**Damper Location**

Arrestment #9A3

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD12 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

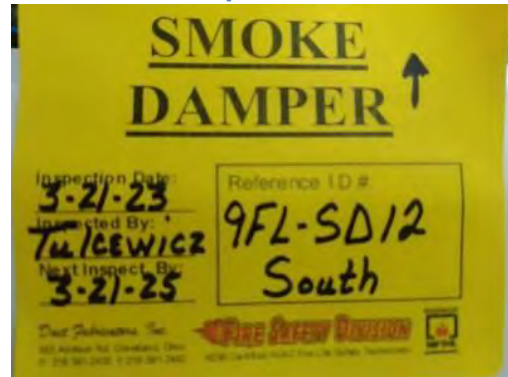

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-10

**Facility Location**  
Jail 1

**Damper Location**  
Vestibule C

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
9FL-SD14 South

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
22x8

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
8x8

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule F

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-SD15 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8x5

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

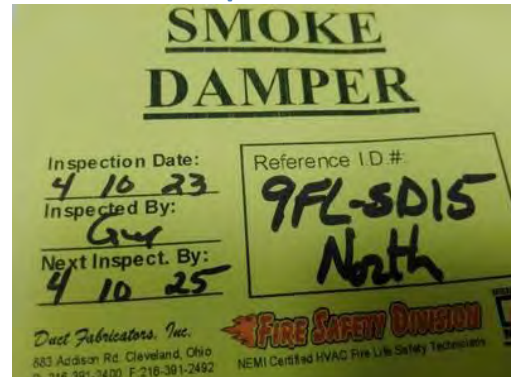

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Pod C

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-SD15 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

26x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

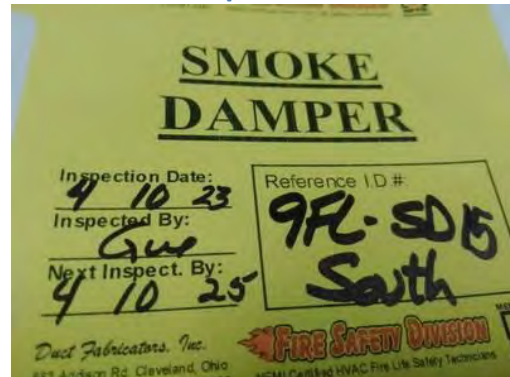

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-10

**Facility Location**  
Jail 1

**Damper Location**  
Vestibule F

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
9FL-SD16 North

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
28x12

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
Open

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

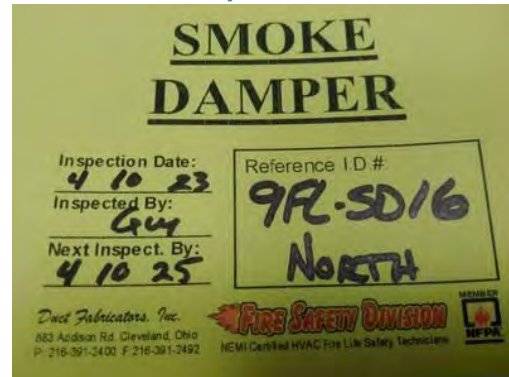



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule B

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-SD16 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

32x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

Needs new actuator


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

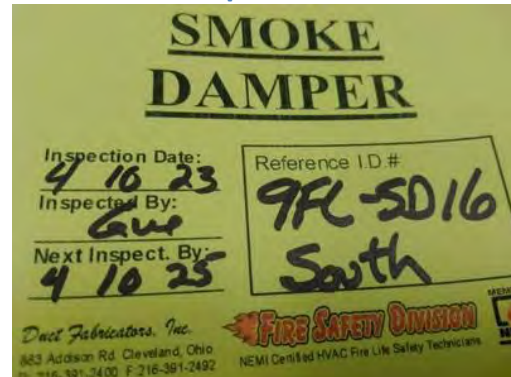

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule G

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-SD17 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

7x7

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

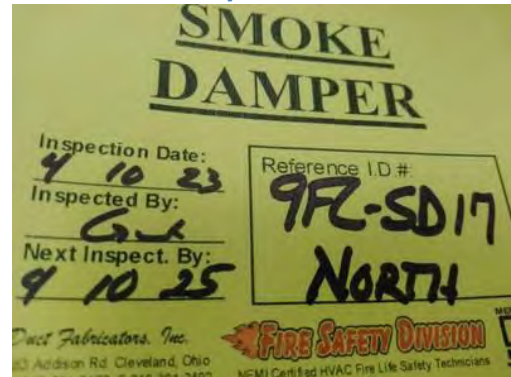

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule B

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-SD17 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-10

**Facility Location**  
Jail 1

**Damper Location**  
Vestibule G

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
9FL-SD18 North

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
26x12

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
7x7

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

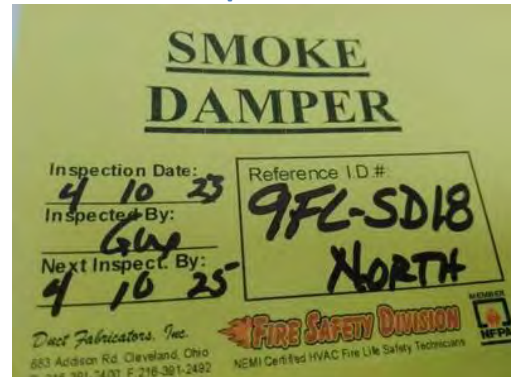

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-25

**Facility Location**

Jail 1

**Damper Location**

H Pod

**Inspector Name**

Julie Gue

**Damper I.D. #**

9FL-SD19 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

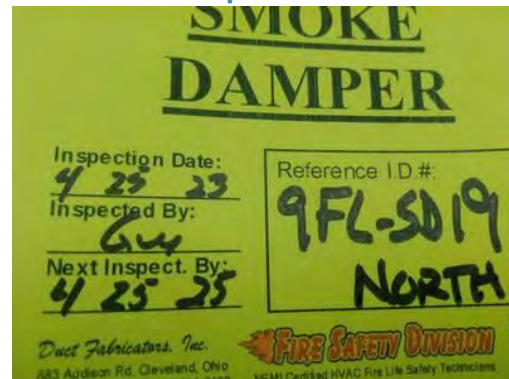

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-05-02

**Facility Location**  
Jail 1

**Damper Location**  
Visitation

**Inspector Name**  
Dan Tulcewicz

**Damper I.D. #**  
9FL-SD20 North

**Damper Type**  
Vertical Smoke Damper

**Damper Size**  
5" Round

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
N/A

**Access Door Size**  
5"x5"

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

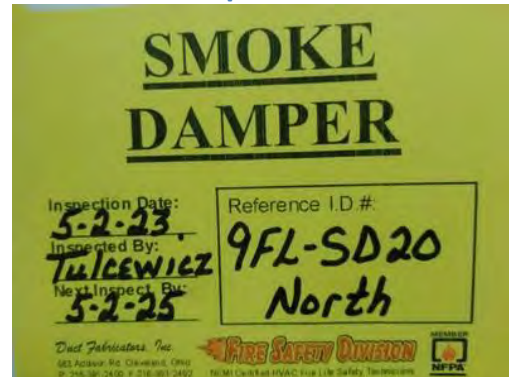

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-05-02

**Facility Location**

Jail 1

**Damper Location**

Room #9H16

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-SD21 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

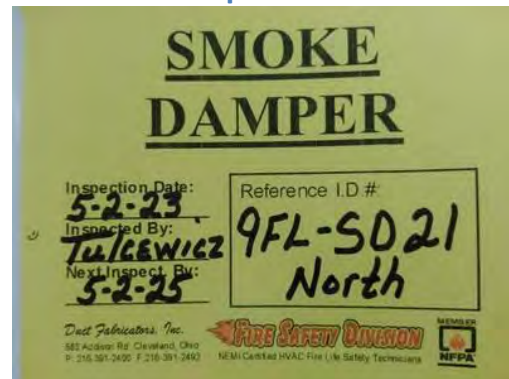

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-20

### Facility Location

Jail 1

### Damper Location

10FL South

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

10FL-FD1 South

### Damper Type

Vertical Fire Damper

### Damper Size

15" Round

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

12" Round

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

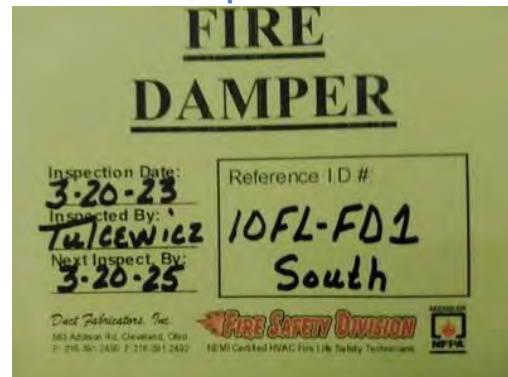



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL-North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-FD2 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

5"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the flex

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

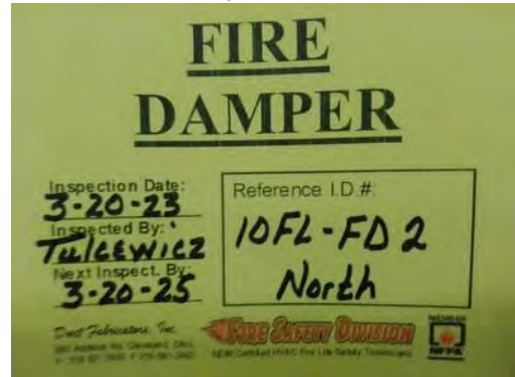

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-FD2 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

26"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

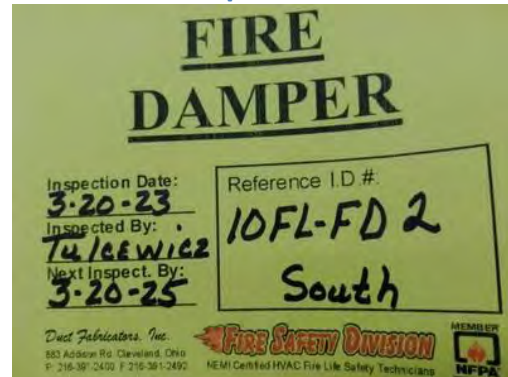

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-FD3 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

60"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

16"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

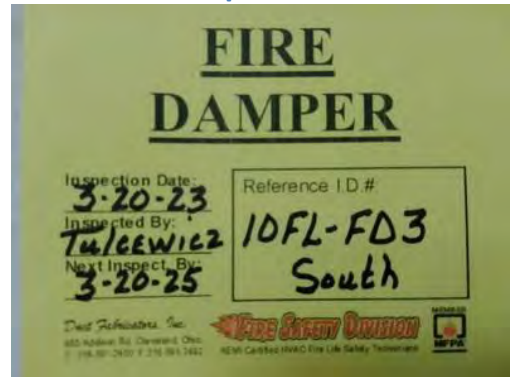

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL South

**Inspector Name**

Larry Coreno

**Damper I.D. #**

10FL-FD4 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

17" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-FD5 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

13" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

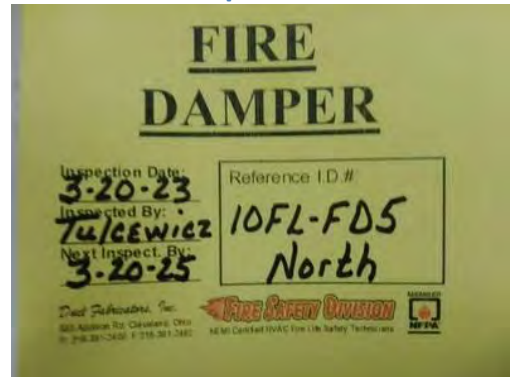

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-FD6 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

54"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

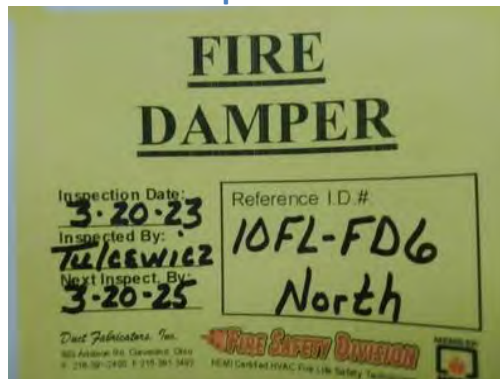

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-FD7 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

26"x11"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-SD1 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

13"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8"x8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

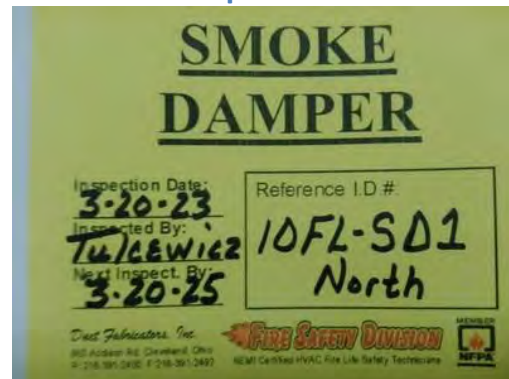



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-SD1 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

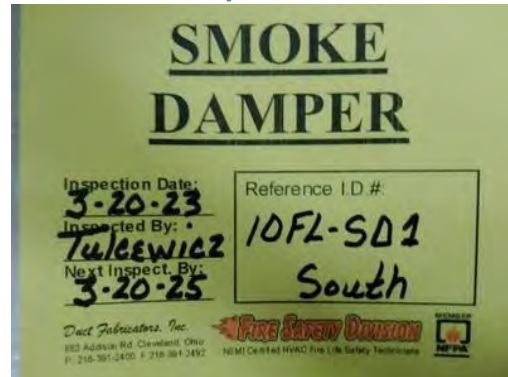

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-SD3 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

54"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

17"x11"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

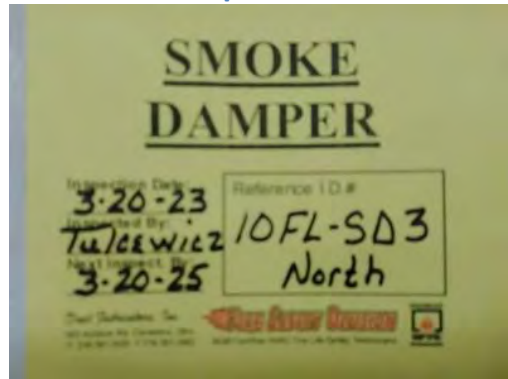

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-20

### Facility Location

Jail 1

### Damper Location

10FL South

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

10FL-SD3 South

### Damper Type

Vertical Smoke Damper

### Damper Size

60"x12"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

N/A

### Access Door Size

16"x4"

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

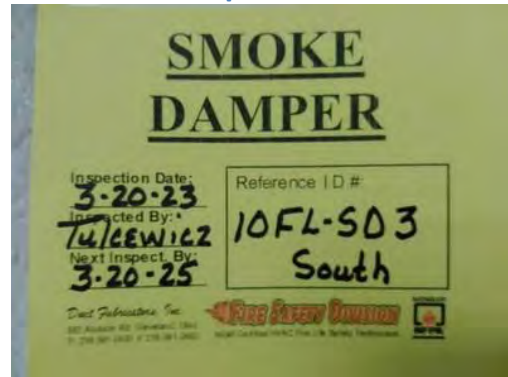

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-SD6 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

26"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

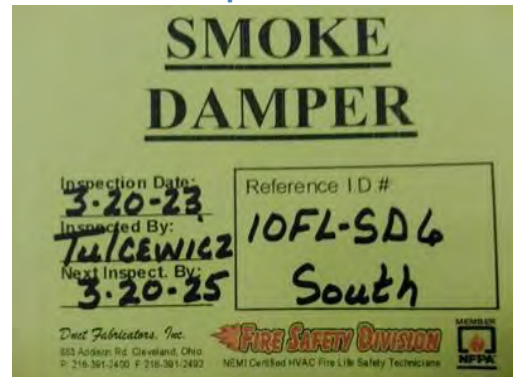

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-SD8 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

10"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

7"x7"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

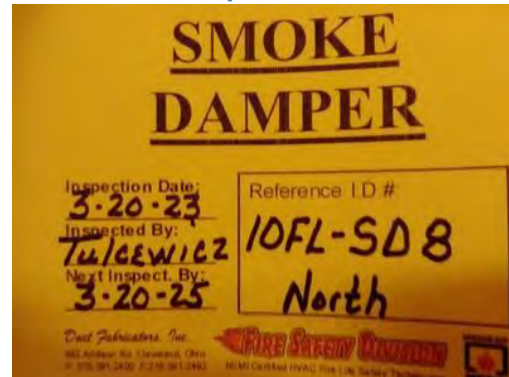

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

10FL-SD8 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

10"x8"

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8"x8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

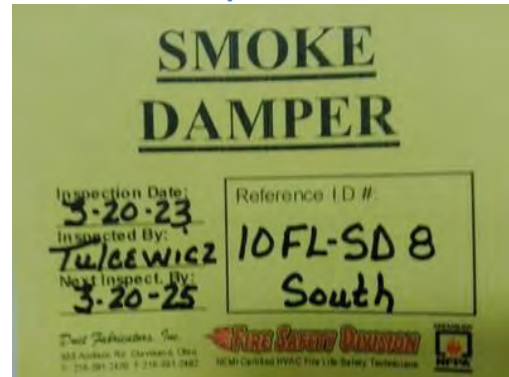

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD9 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD9 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD10 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

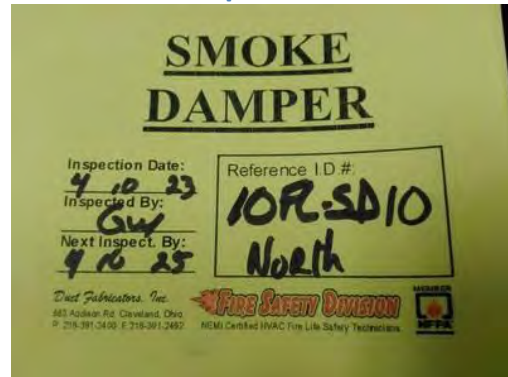

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD10 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

26x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

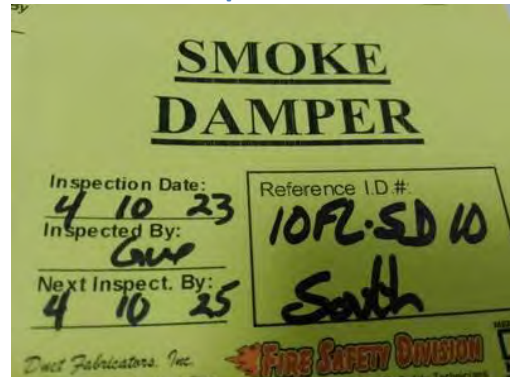

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD11 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

24x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

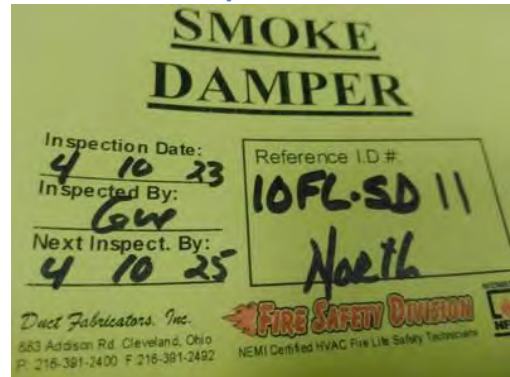

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD11 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

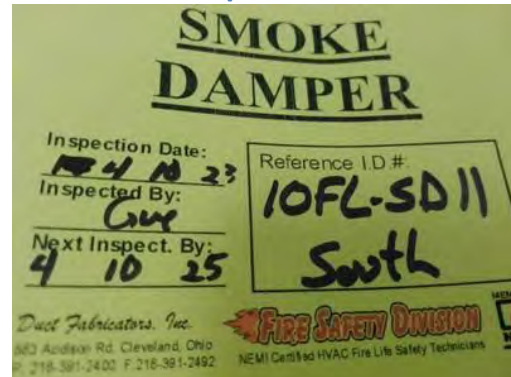

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD12 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

24x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD12 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

26x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

12,13,14 on same pneumatic  
Need more investigation.  
Zone 7


Exterior Picture of Damper



Interior Picture of Damper



Picture of Damper I.D. Label

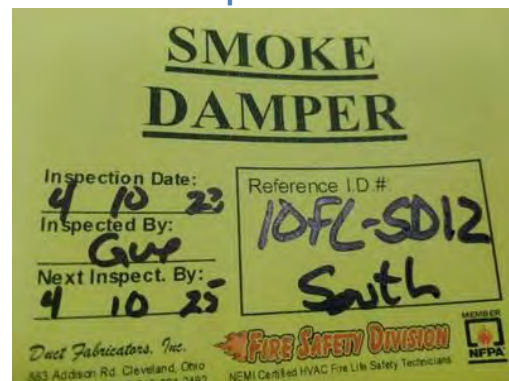

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD13 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

54x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

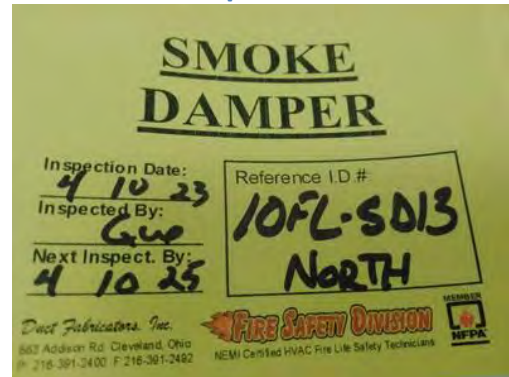

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD13 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

8x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10x6

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

Pneumatic lines have air.  
SD12,13,14 all on same line

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule E/F

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD14 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

8x8

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6x6

**Pass / Fail / Abandoned**

Pass


**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**

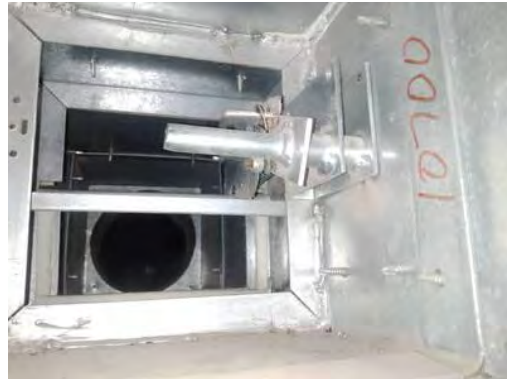

**Picture of Damper I.D. Label**

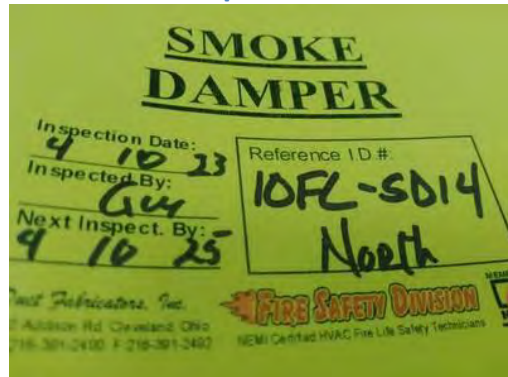

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD14 South

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10x17

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

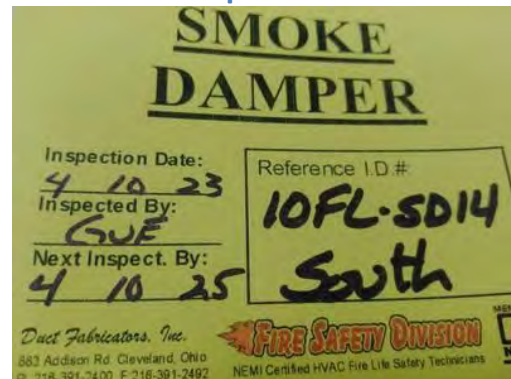

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

G Pod

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD15 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

30x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

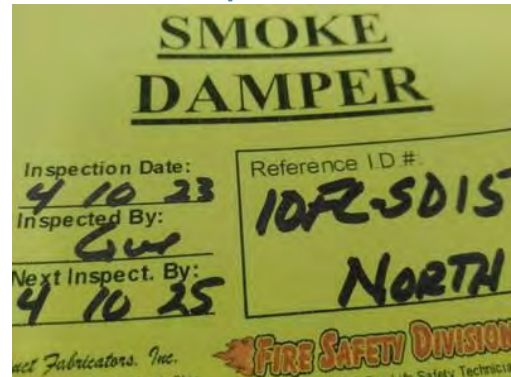

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule A/B

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD15 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule G/H

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD16 North

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22 x 8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10 x 10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule A/B

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD16 South

**Damper Type**

Vertical Smoke Damper

**Damper Size**

22 x 8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

10 x 10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-10

**Facility Location**

Jail 1

**Damper Location**

Vestibule H

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-SD17 North

**Damper Type**

Horizontal Smoke Damper

**Damper Size**

24x14

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

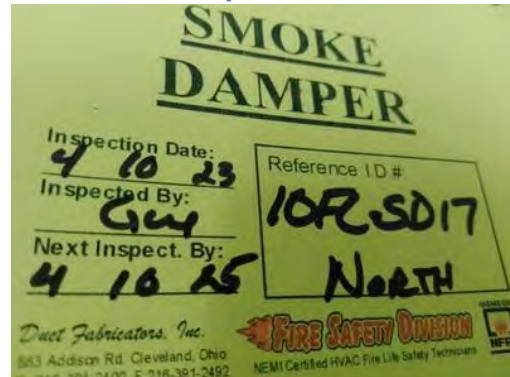

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC 7A RTN

**Damper Type**

Horizontal Fire Damper

**Damper Size**

31x34

**Damper Manufacturer**

Ruskin

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

22x22

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC 7A- S1

**Damper Type**

Horizontal Fire Damper

**Damper Size**

18" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12 x 12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

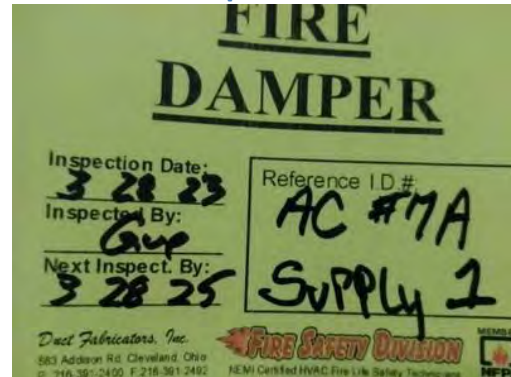

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F:216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC 7A- S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

18" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

13 x 10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC 7- S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

30" round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" round

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC 8- S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

22" round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC 29 Return

**Damper Type**

Horizontal Fire Damper

**Damper Size**

32x14

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC7 - S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

30" round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

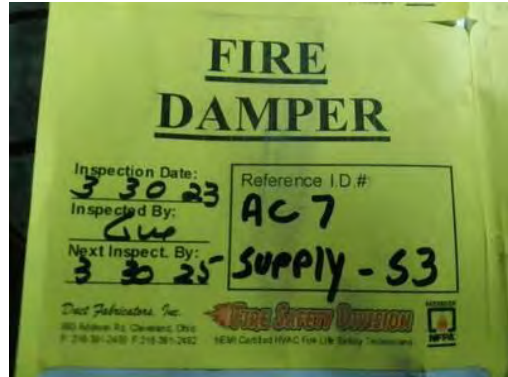

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Justice Center Court Towers

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC7 Return

**Damper Type**

Vertical Fire Damper

**Damper Size**

60x54

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

20x20

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC7- S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

24" round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC7A- S3

**Damper Type**

Horizontal Fire Damper

**Damper Size**

18" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

14 x 12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC7-S4

**Damper Type**

Vertical Fire Damper

**Damper Size**

20". Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

The label is inaccurate.  
Damper is AC7-S4


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

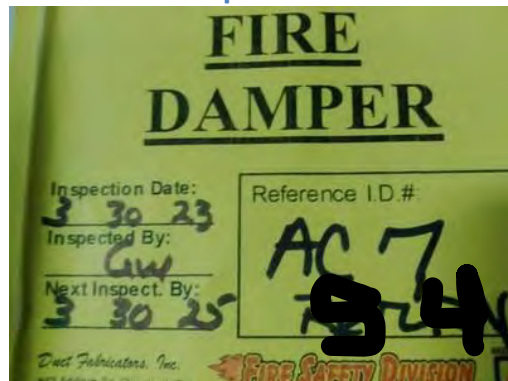

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC10- S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

25" round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC10- S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

28" round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC10-R 1

**Damper Type**

Horizontal Fire Damper

**Damper Size**

44 x 24

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD20

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18 x 18

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

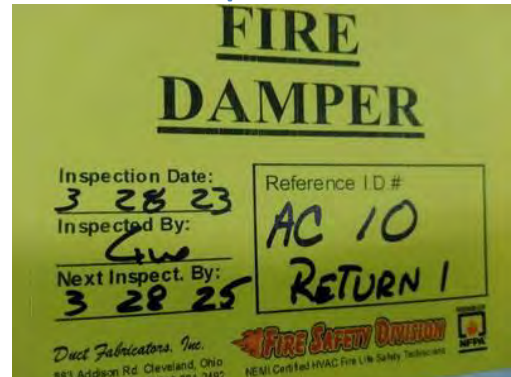

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC10-Return

**Damper Type**

Vertical Fire Damper

**Damper Size**

60 x 54

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

20 x 20

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

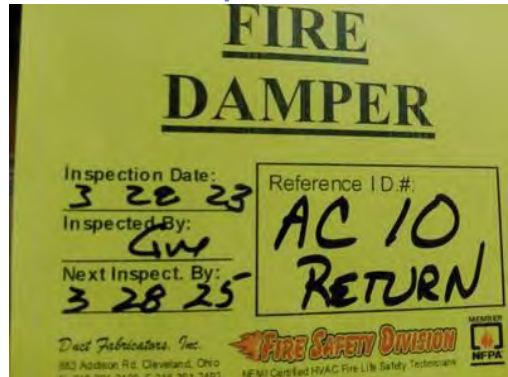

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC10-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

18" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC10-S4

**Damper Type**

Vertical Fire Damper

**Damper Size**

30" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC11-Return

**Damper Type**

Vertical Fire Damper

**Damper Size**

60x60

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

20x20

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

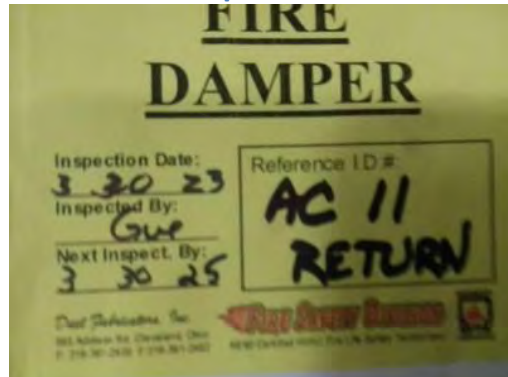

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC11-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

28" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC11-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

26" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

This label is inaccurate.  
Damper is AC11-S2

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC11-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

24" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC11-S4

**Damper Type**

Vertical Fire Damper

**Damper Size**

24" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC12- S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

32" round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC12-Return

**Damper Type**

Vertical Fire Damper

**Damper Size**

60x54

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

20x20

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC12-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

28" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC12-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

22" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-03-30

**Exterior Picture of Damper**

**Facility Location**  
Jail 1



**Damper Location**  
Mechanical room

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
AC12-S3

**Interior Picture of Damper**

**Damper Type**  
Vertical Fire Damper



**Damper Size**  
28" round

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Picture of Damper I.D. Label**

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
18" round



**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

AC29 Supply

**Damper Type**

Horizontal Fire Damper

**Damper Size**

32 x 14

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

14 x 14

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Galleria Elevator room

**Inspector Name**

Julie Gue

**Damper I.D. #**

G- Elev RM supply

**Damper Type**

Vertical Fire Damper

**Damper Size**

30x16

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD40

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

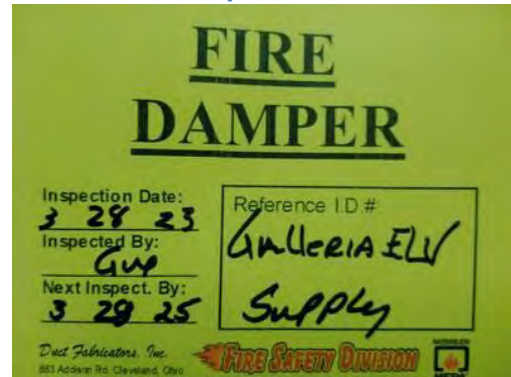

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-28

**Facility Location**

Jail 1

**Damper Location**

Galleria elevator room

**Inspector Name**

Julie Gue

**Damper I.D. #**

G-Elv RM-Return

**Damper Type**

Vertical Fire Damper

**Damper Size**

30 x 16

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD40

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

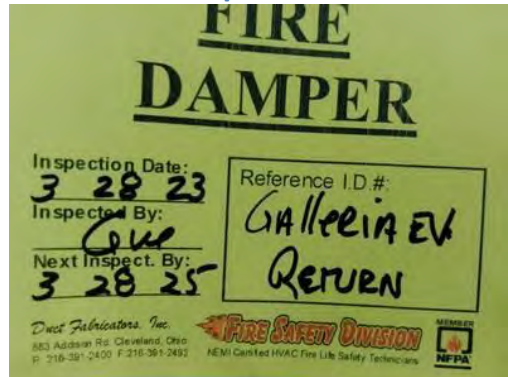

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-30

**Facility Location**

Jail 1

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

Inmate Elevator Return

**Damper Type**

Vertical Fire Damper

**Damper Size**

16 x 18

**Damper Manufacturer**

Ruskin

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-30

### Facility Location

Jail 1

### Damper Location

Mechanical room

### Inspector Name

Julie Gue

### Damper I.D. #

Inmate Elevator supply

### Damper Type

Vertical Fire Damper

### Damper Size

20 x 18

### Damper Manufacturer

Ruskin

### Damper Model #

IBD40

### Fusible Link Temperature

165 Degrees

### Access Door Size

8 x 12

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

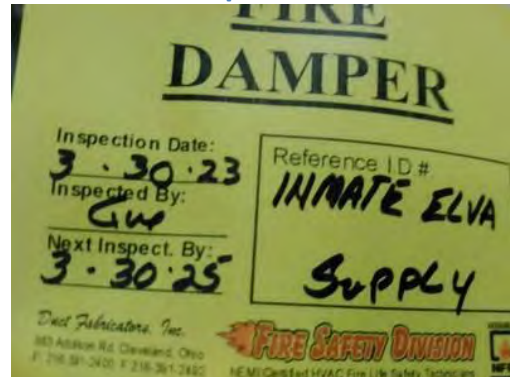

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 6FL-FD2

**Damper Type**

Vertical Fire Damper

**Damper Size**

26"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

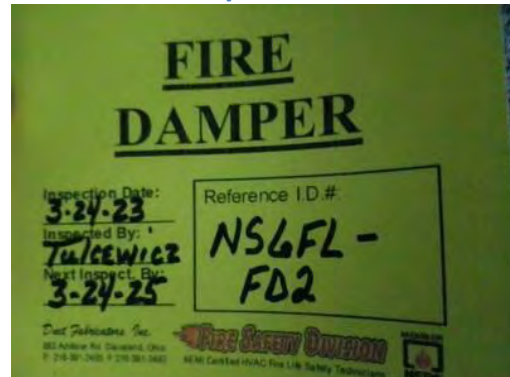



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 6FL-FD4

**Damper Type**

Vertical Fire Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

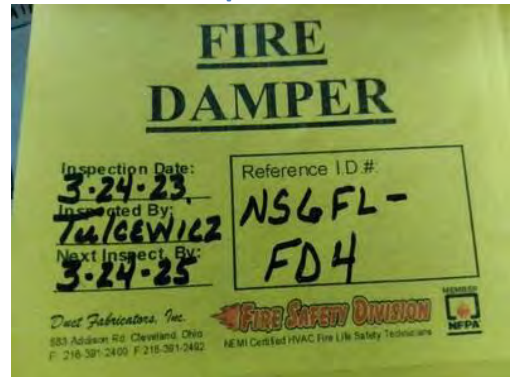

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 6FL-FSD1

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

17" Round

**Damper Manufacturer**

Ruskin

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

5"x4"

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

Need access installed in Pod  
by County Carpenters

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 6FL-FSD2

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

36"x10"

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 6FL-FSD3

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

12"x6"

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

5"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

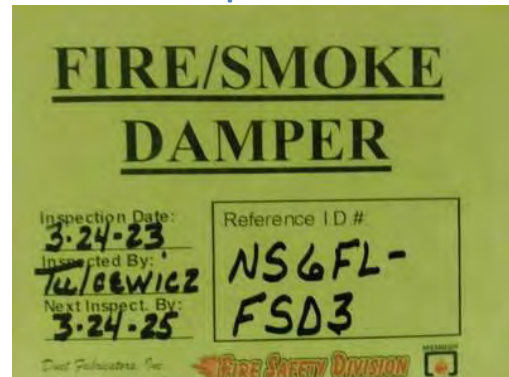

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 6FL-SD3

**Damper Type**

Vertical Smoke Damper

**Damper Size**

60"x15"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-24

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 6FL-SD4

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

Not sure if repair was done.

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 8FL-FD1

**Damper Type**

Vertical Fire Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass


**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**

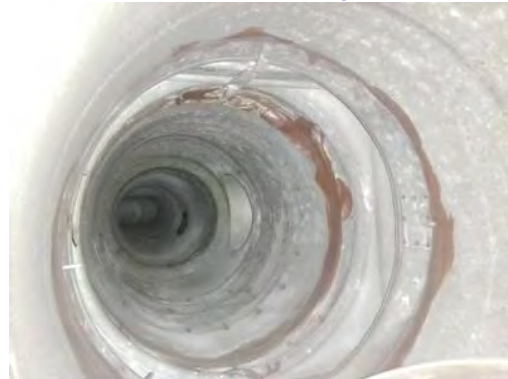

**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 8FL-FD2

**Damper Type**

Vertical Fire Damper

**Damper Size**

30"x10"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 8FL-FD3

**Damper Type**

Vertical Fire Damper

**Damper Size**

48"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-22

### Facility Location

Jail 1

### Damper Location

North Stairwell

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

NS 8FL-FD4

### Damper Type

Vertical Fire Damper

### Damper Size

8" Round

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

6" Round

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

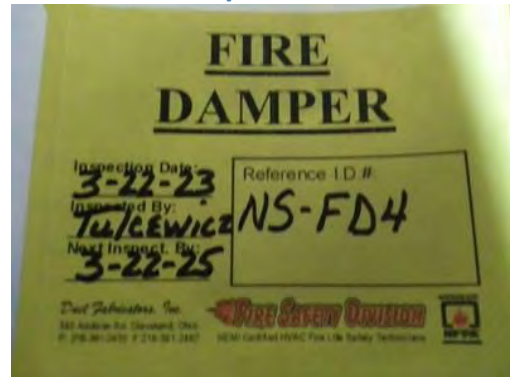

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 8FL-FD5

**Damper Type**

Vertical Fire Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9"x6" oval

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 8FL-SD1

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12"Round

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

Need to replace accuator


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

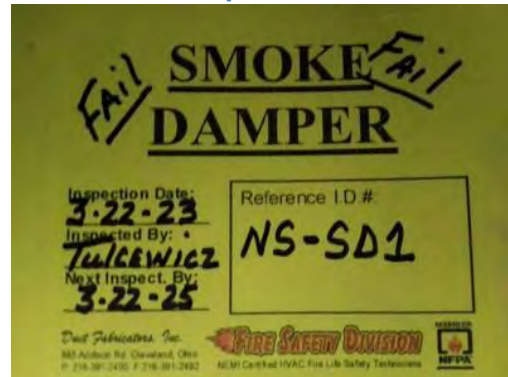

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS 8FL-SD4

**Damper Type**

Vertical Smoke Damper

**Damper Size**

8" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

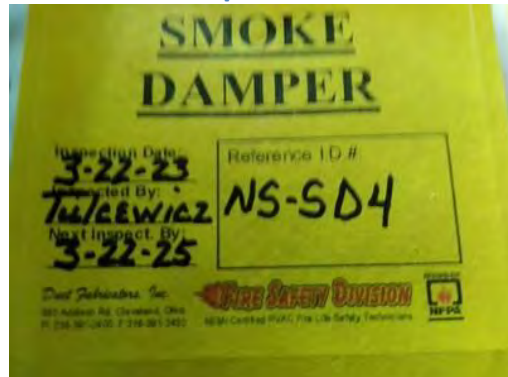

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS10FL-FD1 North

**Damper Type**

Vertical Fire Damper

**Damper Size**

15"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

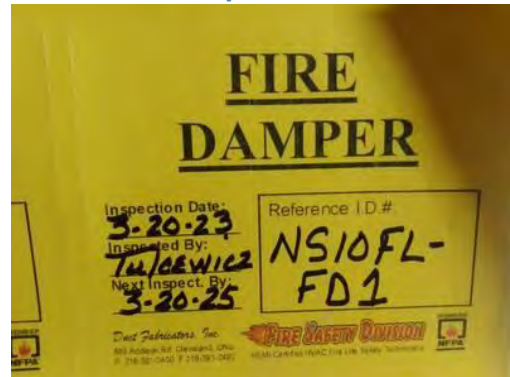

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS10FL-FD2

**Damper Type**

Vertical Fire Damper

**Damper Size**

30"x10"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS10FL-FD3

**Damper Type**

Vertical Fire Damper

**Damper Size**

48"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-20

### Facility Location

Jail 1

### Damper Location

10FL North Stairwell

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

NS10FL-FD4

### Damper Type

Vertical Fire Damper

### Damper Size

15" Round

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

12" Round

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

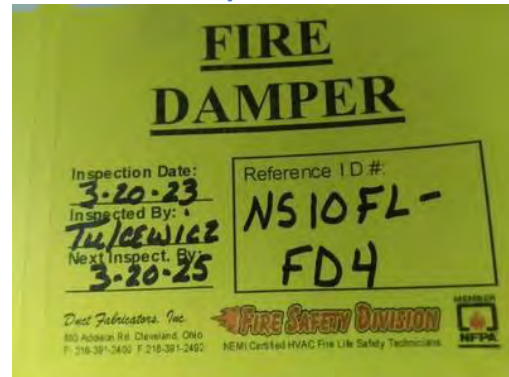

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS10FL-SD1

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS10FL-SD3

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

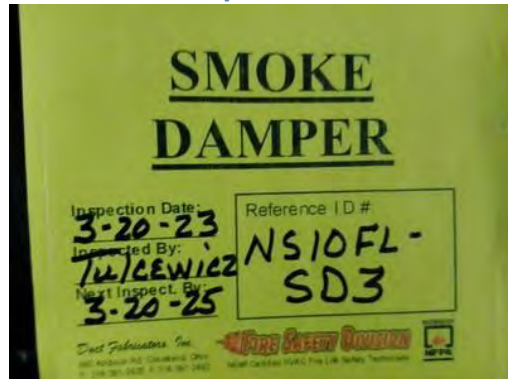

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL North Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

NS10FL-SD4

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Sallyport

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-FD1

**Damper Type**

Vertical Fire Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Across from escorts office.

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-FD2

**Damper Type**

Vertical Fire Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Sallyport

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-FD3

**Damper Type**

Vertical Fire Damper

**Damper Size**

30" x 12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8" x 8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Sallyport

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-FD4

**Damper Type**

Vertical Fire Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

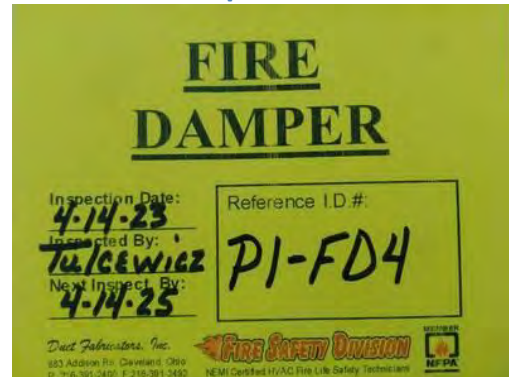



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Sallyport

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-FD5

**Damper Type**

Vertical Fire Damper

**Damper Size**

24" x 10"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18" x 8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

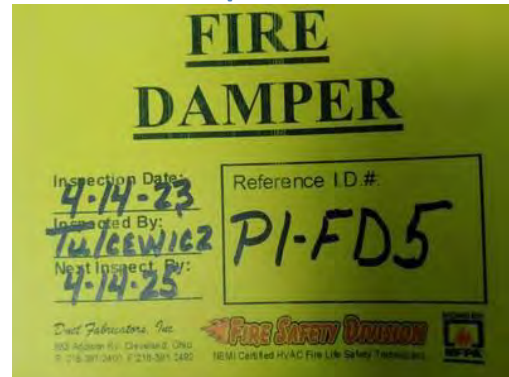

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Sallyport

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-FD6

**Damper Type**

Vertical Fire Damper

**Damper Size**

8" x 6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

14" x 4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

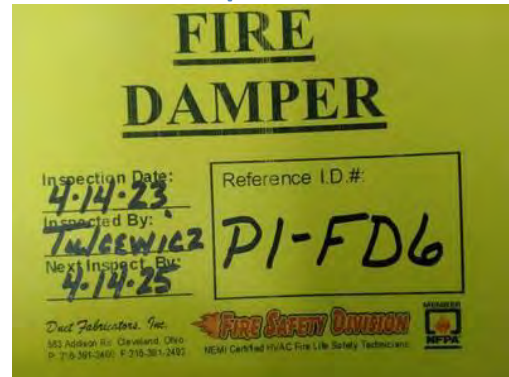

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Sallyport

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-FSD1

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Ruskin

**Damper Model #**

FSD60

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8" x 8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Sallyport

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-FSD2

**Damper Type**

Vertical Fire / Smoke Damper

**Damper Size**

9" Round

**Damper Manufacturer**

Ruskin

**Damper Model #**

FSD60

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

5" x 5"

**Pass / Fail / Abandoned**

Pass


**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**

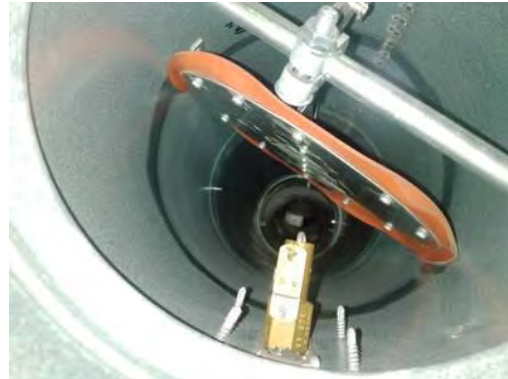

**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Across from escorts office.

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-SD1

**Damper Type**

Vertical Smoke Damper

**Damper Size**

12" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

9" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

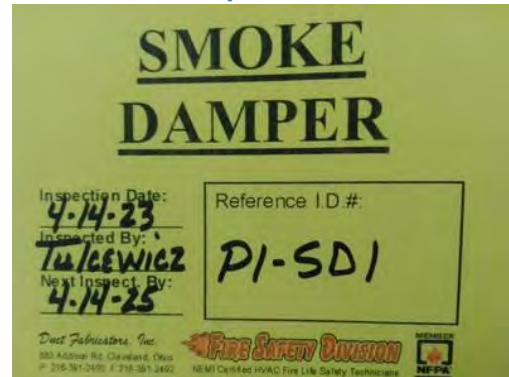

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Across from escorts office.

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-SD2

**Damper Type**

Vertical Smoke Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

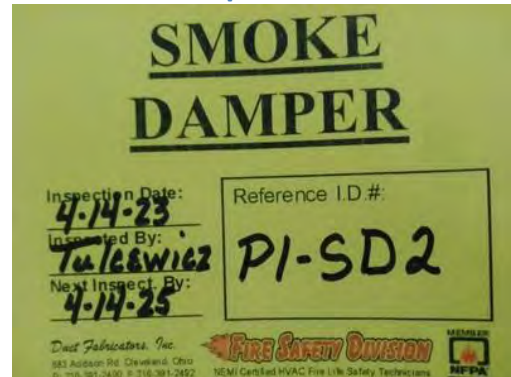

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Sallyport

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-SD3

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14" x 8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8" x 8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Sallyport

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-SD4

**Damper Type**

Vertical Smoke Damper

**Damper Size**

26"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

8"x8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

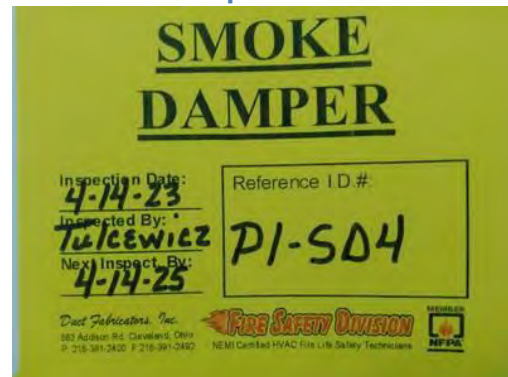



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Sallyport

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

P1-SD5

**Damper Type**

Vertical Smoke Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Penthouse

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

PH-FD1

**Damper Type**

Vertical Fire Damper

**Damper Size**

12" x 12"

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD2

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10" x 10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Penthouse

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

PH-FD2

**Damper Type**

Vertical Fire Damper

**Damper Size**

12" x 12"

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD2

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10" x 10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

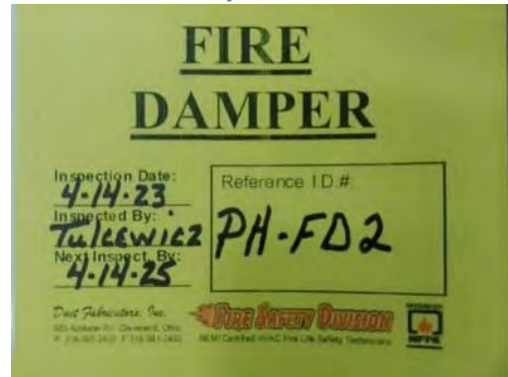

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Penthouse

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

PH-FD3

**Damper Type**

Vertical Fire Damper

**Damper Size**

15" x 12"

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD2

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10" x 10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Penthouse

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

PH-FD4

**Damper Type**

Horizontal Fire Damper

**Damper Size**

12" x 12"

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" x 12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-14

**Facility Location**

Jail 1

**Damper Location**

Penthouse

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

PH-FD5

**Damper Type**

Horizontal Fire Damper

**Damper Size**

12" x 12"

**Damper Manufacturer**

Prefco Products

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" x 12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

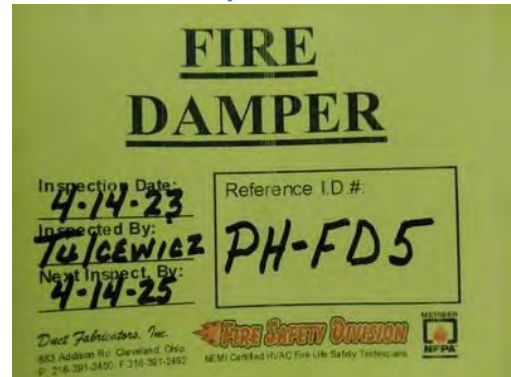

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-22

### Facility Location

Jail 1

### Damper Location

South Stairwell

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

SS 8FL- FD1

### Damper Type

Vertical Fire Damper

### Damper Size

14" Round

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

12" Round

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

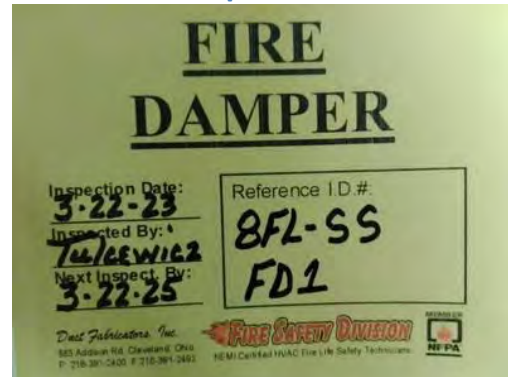

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL- FD2

**Damper Type**

Vertical Fire Damper

**Damper Size**

30"x10"

**Damper Manufacturer**

Advanced Air

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

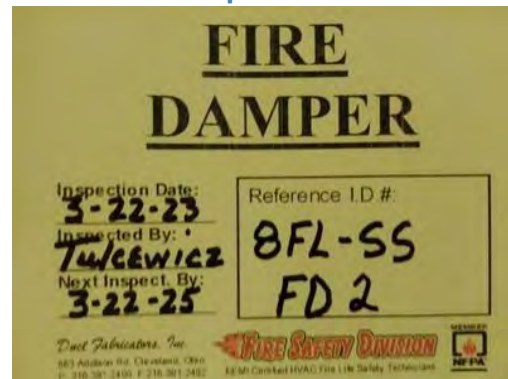



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL- FD3

**Damper Type**

Vertical Fire Damper

**Damper Size**

9"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

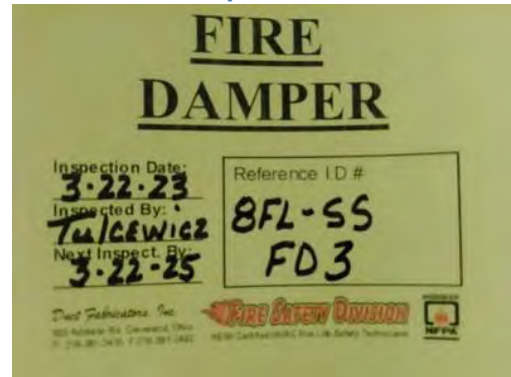

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL- FD4

**Damper Type**

Vertical Fire Damper

**Damper Size**

48"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

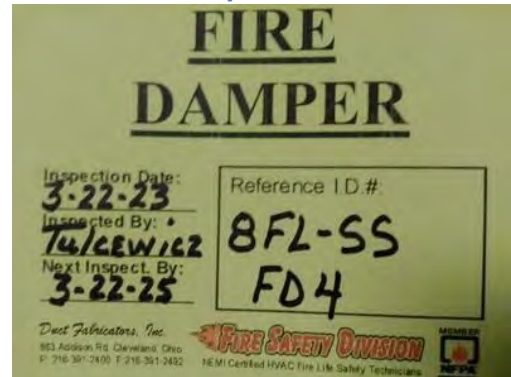

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL- FD5

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL- SD1

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Fail

**Comments / Corrections**

No Air to accuator  
This was addressed with  
JCI and the Fitters

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL- SD3

**Damper Type**

Vertical Smoke Damper

**Damper Size**

9"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL- SD5

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-22

### Facility Location

Jail 1

### Damper Location

South Stairwell

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

SS 8FL-FD1

### Damper Type

Vertical Fire Damper

### Damper Size

14" Round

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

12" Round

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

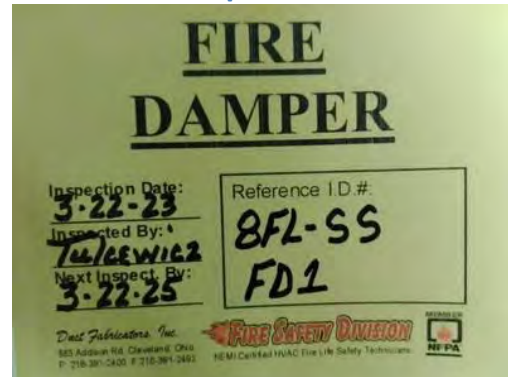

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

8FL Stairwell South

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL-FD2

**Damper Type**

Vertical Fire Damper

**Damper Size**

30"x10"

**Damper Manufacturer**

Advanced Air

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

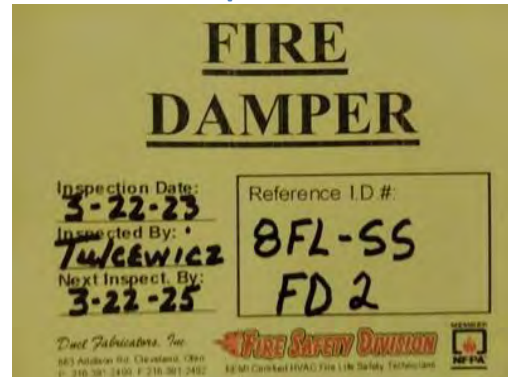



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL-FD3

**Damper Type**

Vertical Fire Damper

**Damper Size**

9"Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

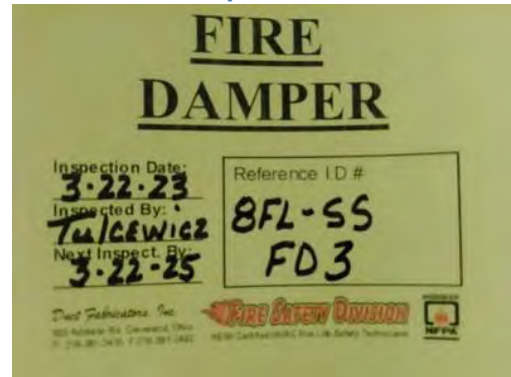

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL-FD4

**Damper Type**

Vertical Fire Damper

**Damper Size**

48"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

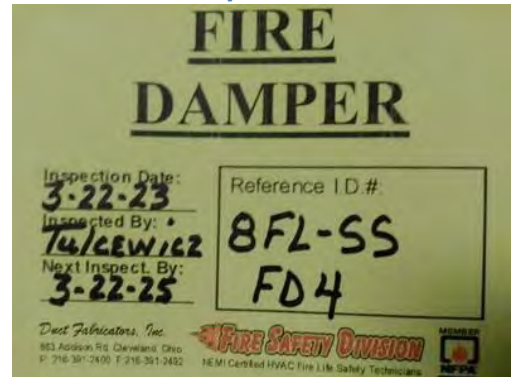

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL-FD5

**Damper Type**

Vertical Fire Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL-SD4

**Damper Type**

Vertical Smoke Damper

**Damper Size**

48"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-22

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 8FL-SD5

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS 10FL-FD2

**Damper Type**

Vertical Fire Damper

**Damper Size**

30x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-20

### Facility Location

Jail 1

### Damper Location

10FL South Stairwell

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

SS10FL-FD1

### Damper Type

Vertical Fire Damper

### Damper Size

14" Round

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

12" Round

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None

### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS10FL-FD3

**Damper Type**

Vertical Fire Damper

**Damper Size**

48"X12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

20"x11"

**Pass / Fail / Abandoned**

Pass


**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**

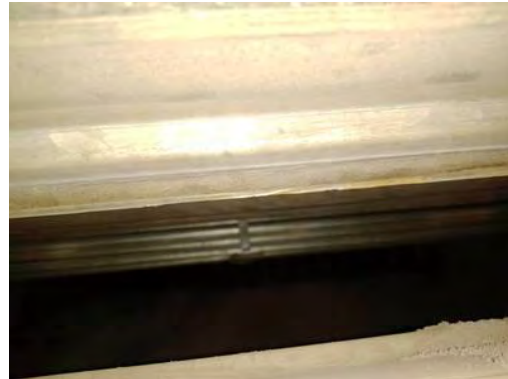

**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS10FL-FD4

**Damper Type**

Vertical Fire Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS10FL-SD1

**Damper Type**

Vertical Smoke Damper

**Damper Size**

14" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

12" Round

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

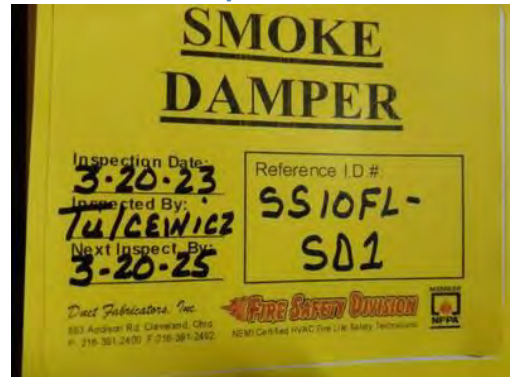

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS10FL-SD3

**Damper Type**

Vertical Fire Damper

**Damper Size**

48"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

20"x11"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-20

**Facility Location**

Jail 1

**Damper Location**

10FL South Stairwell

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

SS10FL-SD4

**Damper Type**

Vertical Smoke Damper

**Damper Size**

15" Round

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

N/A

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

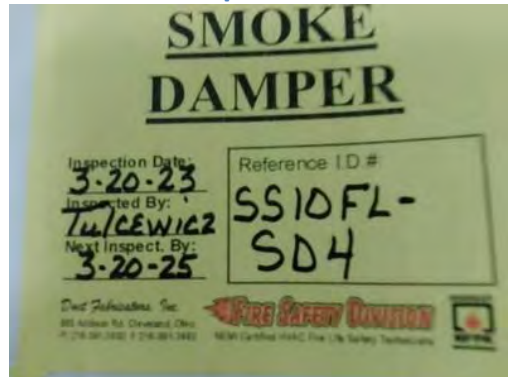

Cuyahoga County

Jail II

1215 W 3<sup>rd</sup> St.

Cleveland, Ohio 44113

Visual

Fire/Smoke Damper Inspection Report

*Duct Fabricators, Inc.*

**FIRE SAFETY DIVISION**





Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
FD	2FL-AHU2.1-S1	10X10	Air Balance	Unknown	Pass	N/A	None
FD	2FL-AHU2.1-S2	16X12	Air Balance	Unknown	Pass	N/A	None
FD	2FL-AHU2.1-S3	18X12	Air Balance	Unknown	Pass	N/A	None
FD	2FL-AHU2.1-S4	14X10	Air Balance	Unknown	Pass	N/A	None
FD	2FL-AHU2.1-S5	12X10	Air Balance	Unknown	Pass	N/A	None
FD	2FL-AHU2.1-S6	24X14	Air Balance	Unknown	Pass	N/A	None
FD	2FL-AHU2.2-S1	10X10	Air Balance	Unknown	Pass	N/A	None
FD	2FL-AHU2.2-S2	16X12	Air Balance	Unknown	Pass	N/A	None
FD	2FL-AHU2.2-S3	18X12	Air Balance	Unknown	Pass	N/A	None
FD	2FL-AHU2.2-S4	16x12	Air Balance	Unknown	Pass	N/A	None
FD	2FL-AHU2.2-S5	12X10	Air Balance	Unknown	Pass	N/A	None
FD	2FL-EX-1	12X12	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz  
Inspection Dates: 9/12/2022  
Facility: Justice Center Jail 2

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
FD	3FL-AHU3.1-S1	10x10	Air Balance	Unknown	Pass	N/A	None
FD	3FL-AHU3.1-S2	16x12	Air Balance	Unknown	Pass	N/A	None
FD	3FL-AHU3.1-S3	18x12	Air Balance	Unknown	Pass	N/A	None
FD	3FL-AHU3.1-S4	14x10	Air Balance	Unknown	Pass	N/A	None
FD	3FL-AHU3.1-S5	12x10	Air Balance	Unknown	Pass	N/A	None
FD	3FL-AHU3.1-S6	24x14	Air Balance	Unknown	Pass	N/A	None
FD	3FL-AHU3.2-S1	10x10	Air Balance	Unknown	Pass	N/A	None
FD	3FL-AHU3.2-S2	16x12	Air Balance	Unknown	Pass	N/A	None
FD	3FL-AHU3.2-S3	18x12	Air Balance	Unknown	Pass	N/A	None
FD	3FL-AHU3.2-S4	14x10	Air Balance	Unknown	Pass	N/A	None
FD	3FL-AHU3.2-S5	12x12	Air Balance	Unknown	Pass	N/A	None
FD	3FL-EX1	12x12	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue  
Inspection Dates: 9/12/2022  
Facility: Justice Center Jail 2

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
FD	4FL-AHU-4.1-R1	14X12	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.1-S1	8x8	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.1-S2	8x8	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.1-S3	60x20	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.1-S4	20x14	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.1-S5	10x10	Air Balance	Unknown	Pass	N/A	Fire wall needs fixed
FD	4FL-AHU-4.1-S6	42x20	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.1-S7	16x12	Air Balance	Unknown	Pass	N/A	Fire Barrier has Damage
FD	4FL-AHU-4.1-S8	10x8	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.1-S9	10x10	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.1-S10	26x10	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.1-S11	8x8	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.1-S12	8x8	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.1-S13	26x14	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.2-R1	24X22	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.2-S1	24X24	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.2-S2	8X8	Air Balance	Unknown	Pass	N/A	None
FD	4FL-AHU-4.3-R1	16x12	Air Balance	Unknown	Pass	N/A	Fire barrier incomplete
FD	4FL-AHU-4.3-S1	10x10	Air Balance	Unknown	Pass	N/A	Fire barrier incomplete
FD	4FL-N-EX	10x8	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/Dan Tulcewicz/Larry Coreno  
Inspection Dates: 9/12/2022  
Facility: Justice Center Jail 2

SA = Supply Air  
 RA = Return Air  
 EA = Exhaust Air  
 FD = Fire Damper  
 SD = Smoke Damper  
 FSD = Fire Smoke Damper



Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
65	FD	6FL-C-R1	30x12	Air Balance	Unknown	Pass	N/A	None
66	FD	6FL-AHU6.3-S1	16X14	Air Balance	Unknown	Pass	N/A	None
67	FD	6FL-AHU6.3-S2	16X10	Air Balance	Unknown	Pass	N/A	None
68	FD	6FL-AHU6.3-S3	24X12	Air Balance	Unknown	Pass	N/A	None
69	FD	6FL-RF-R1	22X20	Air Balance	Unknown	Fail	N/A	None
70	FD	6FL-E-R1	12x16	Air Balance	Unknown	Pass	N/A	None
71	FD	6FL-E-R2	16x12	Air Balance	Unknown	Pass	N/A	None
72	FD	6FL-E-R3	48X24	Air Balance	Unknown	Fail	N/A	None
73	FD	6FL-E-R4	48X24	Air Balance	Unknown	Fail	N/A	None
74	FD	6FL-E-S1	14X12	Air Balance	Unknown	Pass	N/A	None
75	FD	6FL-E-S2	22X12	Air Balance	Unknown	Pass	N/A	None
76	FD	6FL-E-S3	16X12	Air Balance	Unknown	Pass	N/A	None
77	FD	6FL-E-S4	12X10	Air Balance	Unknown	Pass	N/A	None
78	FD	6FL-E-S5	16X12	Air Balance	Unknown	Pass	N/A	None
79	FD	6FL-E-S6	14X12	Air Balance	Unknown	Pass	N/A	None
80	FD	6FL-E-S7	22X12	Air Balance	Unknown	Pass	N/A	None
81	FD	6FL-E-S8	10X6	Air Balance	Unknown	Pass	N/A	None
82	FD	6FL-E-R1	12X16	Air Balance	Unknown	Pass	N/A	None
83	FD	6FL-W-R2	16X12	Air Balance	Unknown	Pass	N/A	None
84	FD	6FL-W-R3	48X24	Air Balance	Unknown	Fail	N/A	None

Inspector: Julie Gue/Dan Tulcewicz/Larry Coreno  
Inspection Dates: 9/9/2022  
Facility: Justice Center Jail 2

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper







Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
FD	8FL-AHU8.3-S1	16x14	Air Balance	Unknown	Fail	N/A	None
FD	8FL-AHU8.3-S2	16X10	Air Balance	Unknown	Pass	N/A	None
FD	8FL-AHU8.3-S3	24x12	Air Balance	Unknown	Pass	N/A	None
FD	8FL-C-Relief	30x12	Air Balance	Unknown	Pass	N/A	None
FD	8FL-RF-R1	22x20	Air Balance	Unknown	Fail	N/A	None
FD	8FL-E-R1	12x16	Air Balance	Unknown	Pass	N/A	None
FD	8FL-E-R2	16x12	Air Balance	Unknown	Pass	N/A	None
FD	8FL-E-R3	48x24	Air Balance	Unknown	Fail	N/A	None
FD	8FL-E-R4	48x24	Air Balance	Unknown	Fail	N/A	None
FD	8FL-E-S1	14X12	Air Balance	Unknown	Pass	N/A	None
FD	8FL-E-S2	22X12	Air Balance	Unknown	Pass	N/A	None
FD	8FL-E-S3	16X12	Air Balance	Unknown	Pass	N/A	None
FD	8FL-E-S4	12X10	Air Balance	Unknown	Pass	N/A	None
FD	8FL-E-S5	16x12	Air Balance	Unknown	Pass	N/A	None
FD	8FL-E-S6	14x12	Air Balance	Unknown	Pass	N/A	None
FD	8FL-E-S7	22x12	Air Balance	Unknown	Pass	N/A	None
FD	8FL-E-S8	10x6	Air Balance	Unknown	Pass	N/A	None
FD	8FL-W-R1	12X16	Air Balance	Unknown	Pass	N/A	None
FD	8FL-W-R2	16X12	Air Balance	Unknown	Pass	N/A	None
FD	8FL-W-R3	48X24	Air Balance	Unknown	Fail	N/A	None

Inspector: Julie Gue/Dan Tulcewicz  
Inspection Dates: 9/8/2022  
Facility: Justice Center Jail 2

SA = Supply Air  
 RA = Return Air  
 EA = Exhaust Air  
 FD = Fire Damper  
 SD = Smoke Damper  
 FSD = Fire Smoke Damper





Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
FD	10FL-AHU10.3-S1	16x14	Air Balance	Unknown	Pass	N/A	None
FD	10FL-AHU10.3-S2	16x10	Air Balance	Unknown	Pass	N/A	None
FD	10FL-AHU10.3-S3	24x12	Air Balance	Unknown	Pass	N/A	None
FD	10FL-C-Relief	30x12	Air Balance	Unknown	Pass	N/A	None
FD	10FL-E-R1	12x16	Air Balance	Unknown	Pass	N/A	None
FD	10FL-E-R2	16x12	Air Balance	Unknown	Pass	N/A	None
FD	10FL-E-R3	48x24	Air Balance	Unknown	Pass	N/A	None
FD	10FL-E-R4	48x24	Air Balance	Unknown	Pass	N/A	None
FD	10FL-E-S1	14x12	Air Balance	Unknown	Pass	N/A	None
FD	10FL-E-S2	22x12	Air Balance	Unknown	Pass	N/A	None
FD	10FL-E-S3	16x12	Air Balance	Unknown	Pass	N/A	None
FD	10FL-E-S4	11.5x9.5	Ruskin	IBD20	Pass	N/A	None
FD	10FL-E-S5	16x12	Air Balance	Unknown	Pass	N/A	None
FD	10FL-E-S6	14x12	Air Balance	Unknown	Pass	N/A	None
FD	10FL-E-S7	22x12	Air Balance	Unknown	Pass	N/A	None
FD	10FL-E-S8	10x8	Air Balance	Unknown	Pass	N/A	None
FD	10FL RF-R1	22x20	Air Balance	Unknown	Pass	N/A	None
FD	10FL-W-R1	12x16	Air Balance	Unknown	Pass	N/A	None
FD	10FL-W-R2	16x12	Air Balance	Unknown	Pass	N/A	None
FD	10FL-W-R3	48x24	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz  
Inspection Dates: 9/8/2022  
Facility: Justice Center Jail 2

SA = Supply Air  
 RA = Return Air  
 EA = Exhaust Air  
 FD = Fire Damper  
 SD = Smoke Damper  
 FSD = Fire Smoke Damper





Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
FD	12FL-C-Relief	32x12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-RF-R1	22X20	Air Balance	Unknown	Pass	N/A	None
FD	12FL-AHU-12.3-S1	16X14	Air Balance	Unknown	Pass	N/A	None
FD	12FL-AHU-12.3-S2	16X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-AHU-12.3-S3	28X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-R1	12x16	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-R2	16x12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-R3	48X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-R4	48X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-S1	14x12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-S2	22X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-S3	16X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-S4	12X10	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-S5	16X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-S6	14x12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-S7	22x12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-E-S8	10X8	Air Balance	Unknown	Pass	N/A	None
FD	12FL-W-R1	12x16	Air Balance	Unknown	Pass	N/A	None
FD	12FL-W-R2	16x12	Air balance	Unknown	Pass	N/A	None
FD	12FL-W-R3	48X24	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/Dan Tulcewicz/ Larry Coreno  
Inspection Dates: 9/13/2022  
Facility: Justice Center Jail 2

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
FD	12FL-W-R4	48X24	Air Balance	Unknown	Pass	N/A	None
FD	12FL-W-S1	14X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-W-S2	22X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-W-S3	16X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-W-S4	12X10	Air Balance	Unknown	Pass	N/A	None
FD	12FL-W-S5	16X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-W-S6	16X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-W-S7	22X12	Air Balance	Unknown	Pass	N/A	None
FD	12FL-W-S8	12x10	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz/ Larry Coreno  
Inspection Dates: 9/8/2022  
Facility: Justice Center Jail 2

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
FD	STR#1-12FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#1-10FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#1-8FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#1-6FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#1-4FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#1-3FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#1-2FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#1-1FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#1-BL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#2-12FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#2-10FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#2-8FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#2-6FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#2-4FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#2-3FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#2-2FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#2-1FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#2-BL	24X24	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz/ Larry Coreno  
Inspection Dates: 9/30/2022, 3/9/2023  
Facility: Justice Center Jail 2

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
FD	STR#3-12FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#3-10FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#3-8FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#3-6FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#3-4FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#3-3FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#3-2FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#3-1FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#3-BL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#4-12FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#4-10FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#4-8FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#4-6FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#4-4FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#4-3FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#4-2FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#4-1FL	24X24	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz/ Larry Coreno  
Inspection Dates: 9/30/2022, 3/8/2023  
Facility: Justice Center Jail 2

SA = Supply Air      FD = Fire Damper  
 RA = Return Air      SD = Smoke Damper  
 EA = Exhaust Air      FSD = Fire Smoke Damper

Duct Fabricators, Inc.  
 883 Addison Rd. Cleveland, Ohio  
 P: 216-391-2400 F:216-391-2492



Fire / Smoke / Fire & Smoke Damper  
Composite Inspection Report

<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
FD	STR#5-12FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#5-10FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#5-8FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#5-6FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#5-4FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#5-3FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#5-2FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#5-1FL	24X24	Air Balance	Unknown	Pass	N/A	None
FD	STR#5-BL	24X24	Air Balance	Unknown	Pass	N/A	None

Inspector: Julie Gue/ Dan Tulcewicz/ Larry Coreno  
Inspection Dates: 3/7/2023  
Facility: Justice Center Jail 2

SA = Supply Air  
 RA = Return Air  
 EA = Exhaust Air  
 FD = Fire Damper  
 SD = Smoke Damper  
 FSD = Fire Smoke Damper





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-15

**Facility Location**

Jail 2

**Damper Location**

Men's locker room

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-EX1

**Damper Type**

Vertical Fire Damper

**Damper Size**

10" Round

**Damper Manufacturer**

Greenheck

**Damper Model #**

1FD150RV

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the Elbow

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-15

### Facility Location

Jail 2

### Damper Location

Men's locker room

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

1FL-S1

### Damper Type

Vertical Fire Damper

### Damper Size

18"x12"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

12"x12"

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

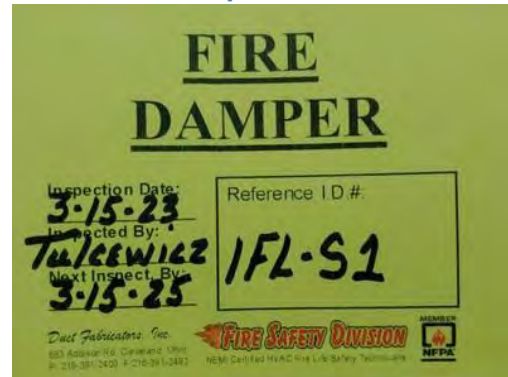

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-15

**Facility Location**

Jail 2

**Damper Location**

Men's locker room

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

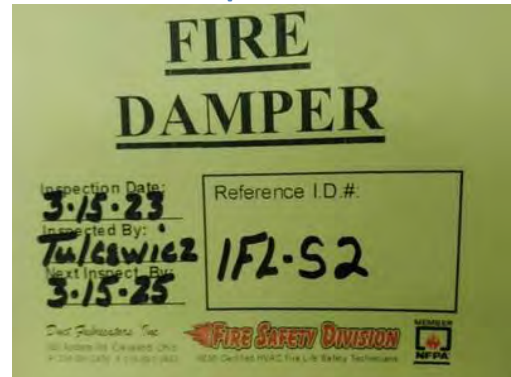

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-15

**Facility Location**

Jail 2

**Damper Location**

Men's locker room

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

18"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-15

**Facility Location**

Jail 2

**Damper Location**

Men's locker room

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-S4

**Damper Type**

Vertical Fire Damper

**Damper Size**

8"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-15

**Facility Location**

Jail 2

**Damper Location**

1FL-Hallway

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

36"x14"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

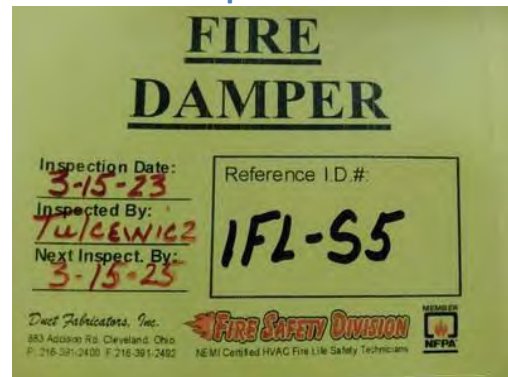

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-15

**Facility Location**

Jail 2

**Damper Location**

1FL hallway

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

1FL-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

36"x14"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

7"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-15

### Facility Location

Jail 2

### Damper Location

Men's locker room

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

1FL-TA1

### Damper Type

Vertical Fire Damper

### Damper Size

24"x24"

### Damper Manufacturer

Greenheck

### Damper Model #

2FD150AV

### Fusible Link Temperature

165 Degrees

### Access Door Size

Open

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None

### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-AHU2.1-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

10x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

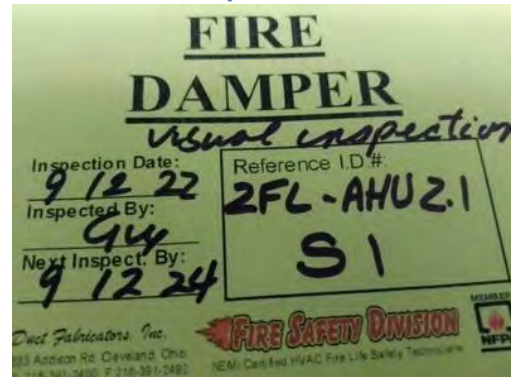

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room 2

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-AHU2.1-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

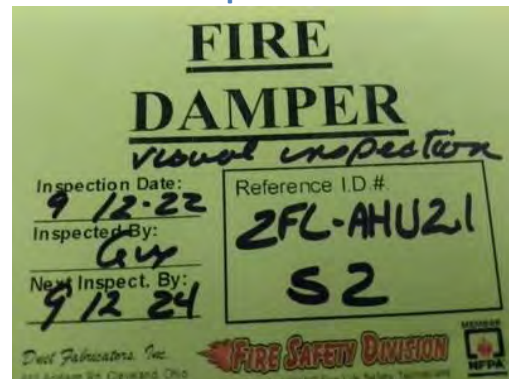

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-AHU2.1-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

18x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-AHU2.1-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x14

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-AHU2.2-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

10x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

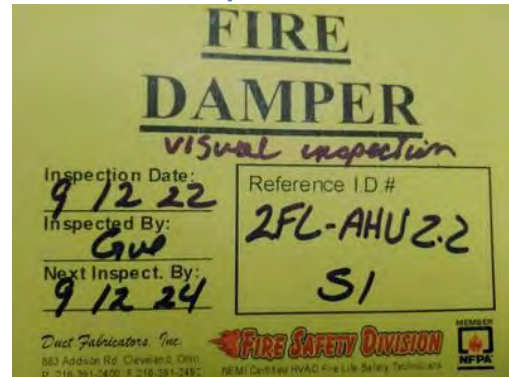

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-AHU2.2-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

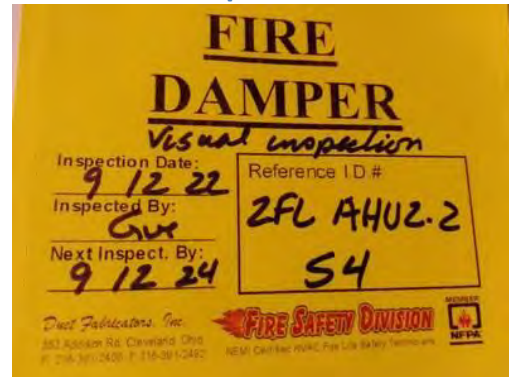

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-AHU2.2-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

18x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

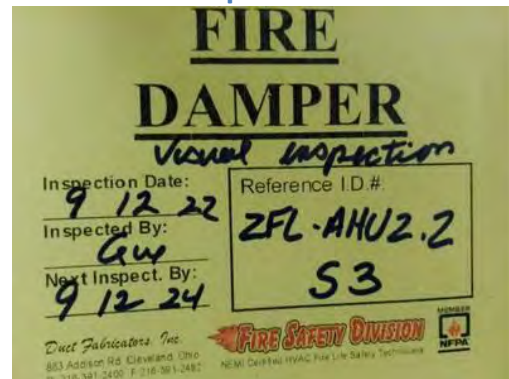



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-AHU2.2-S4

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

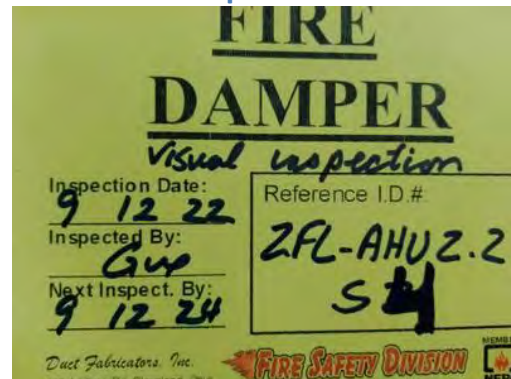

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

2FL-AHU2.2-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

12x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-AHU3.1-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

10x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-AHU3.1-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

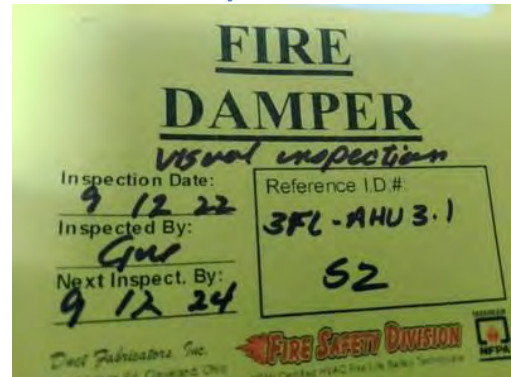

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-AHU3.1-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

18x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

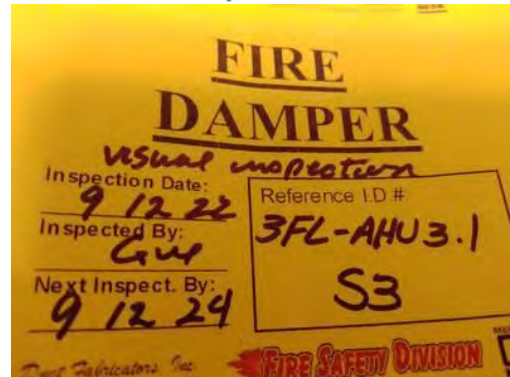

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-AHU3.1-S4

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-AHU3.1-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

12x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

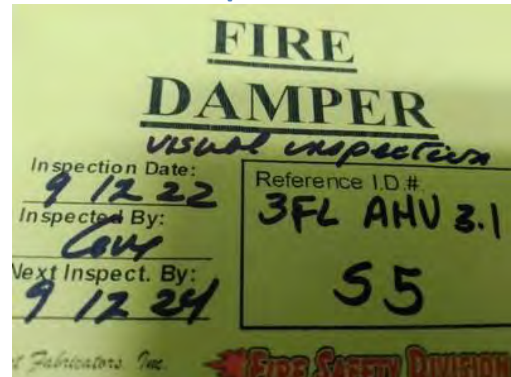

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-AHU3.1-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x14

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

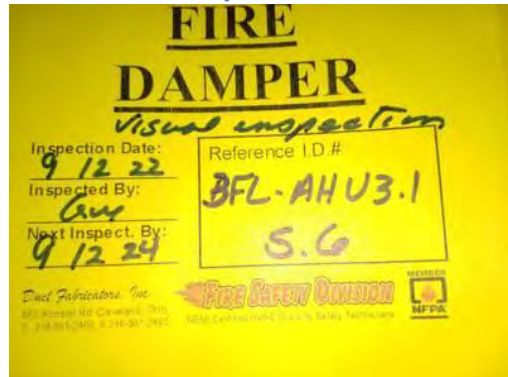



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-AHU3.2-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

10x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

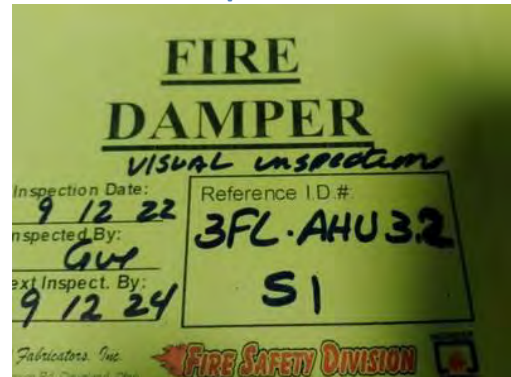

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-AHU3.2-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

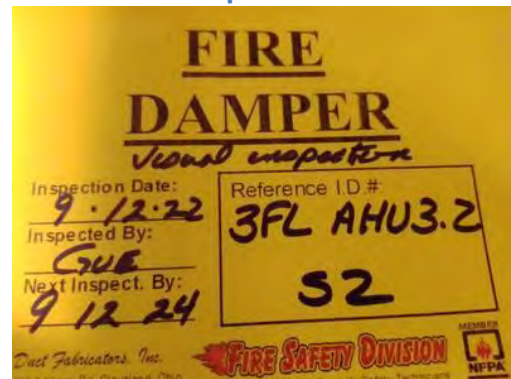

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-AHU3.2-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

18x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

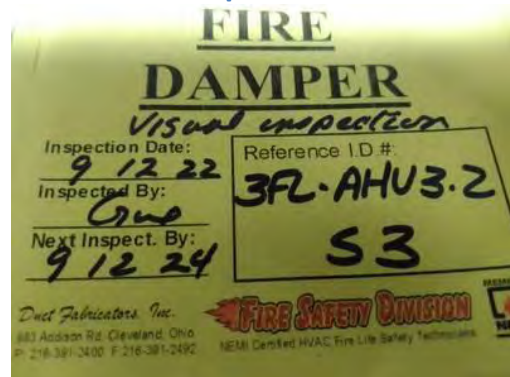

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-AHU3.2-S4

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x10

**Damper Manufacturer**

Advanced Air

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

3FL-AHU3.2-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

12x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

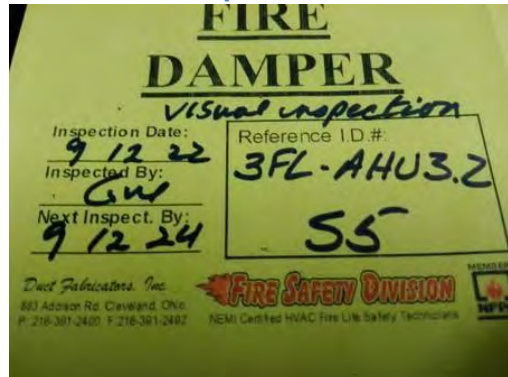

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

Closet

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4 .1-S8

**Damper Type**

Vertical Fire Damper

**Damper Size**

10x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

Outside of women's room

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.1 R

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

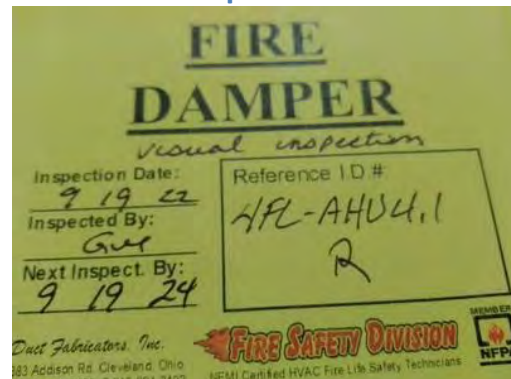

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

Electrical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.1-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

8x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.1-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

60x20

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

2-12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.1-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

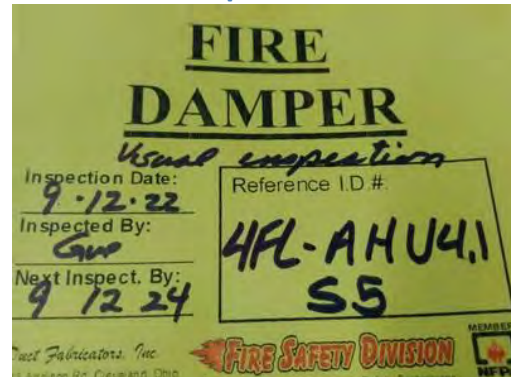

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

Video visitation

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.1-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

42x20

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

14x14

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

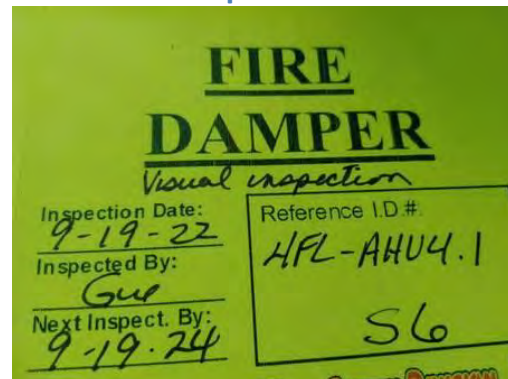

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

Outside of 45A

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.1-S7

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

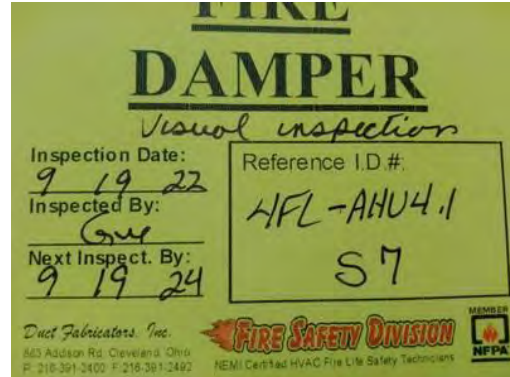

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

Plumbing closet

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.1-S9

**Damper Type**

Vertical Fire Damper

**Damper Size**

10x10

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD2

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass


**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**

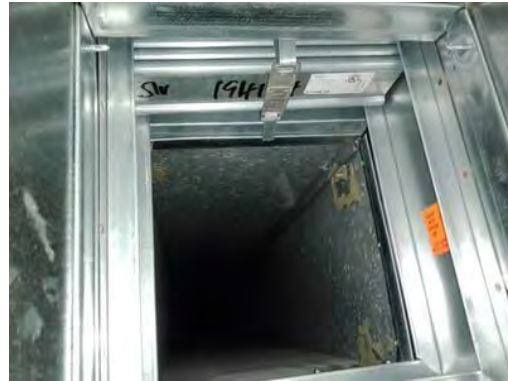

**Picture of Damper I.D. Label**

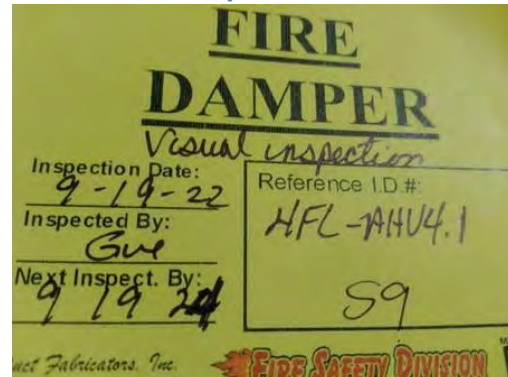

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

Video visitation

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.1-S13

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x16

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

14x14

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.2 R1

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x22

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-12

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.2-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

Electrical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.2-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

8x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

Front of master control

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.3-R1

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

Fire barrier issues

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

Master control

**Inspector Name**

Julie Gue

**Damper I.D. #**

4FL-AHU4.3-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

10x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2022-09-19

**Facility Location**  
Jail 2

**Damper Location**  
Closet

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
4FL-N-EX

**Damper Type**  
Vertical Fire Damper

**Damper Size**  
10x8

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
6x6

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

<b>FIRE DAMPER</b>	
<i>Visual inspection</i>	
Inspection Date: <i>9/19/22</i>	Reference I.D. #: <i>4FL-N-EX</i>
Inspected By: <i>Gue</i>	
Next Inspect. By: <i>9/19/24</i>	

Duct Fabricators, Inc.  
883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER  
**NFPA**

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-13

**Facility Location**

Jail 2

**Damper Location**

Pod A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

5FL-EX-A

**Damper Type**

Vertical Fire Damper

**Damper Size**

16"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

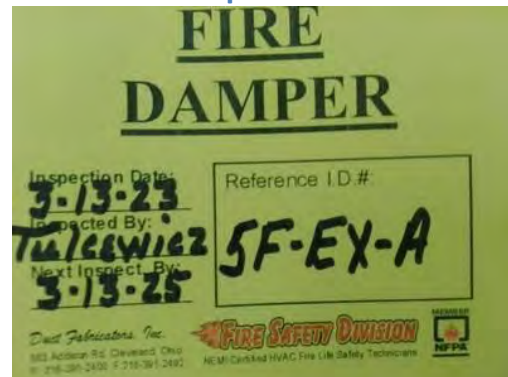

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-13

**Facility Location**

Jail 2

**Damper Location**

Pod D

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

5FL-EX-D

**Damper Type**

Vertical Fire Damper

**Damper Size**

10"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8"x8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-AHU6.3-S1

**Damper Type**

Horizontal Fire Damper

**Damper Size**

15.5x13.5

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD2

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-AHU6.3-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

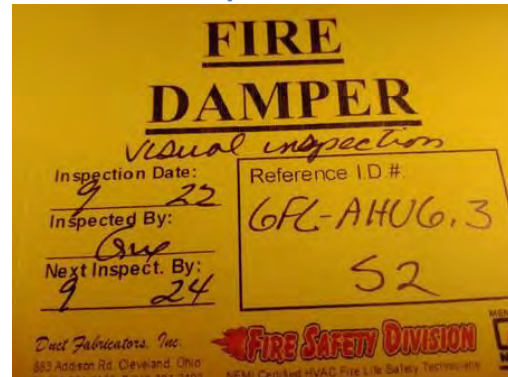



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-AHU6.3-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-C-Relief

**Damper Type**

Vertical Fire Damper

**Damper Size**

30x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

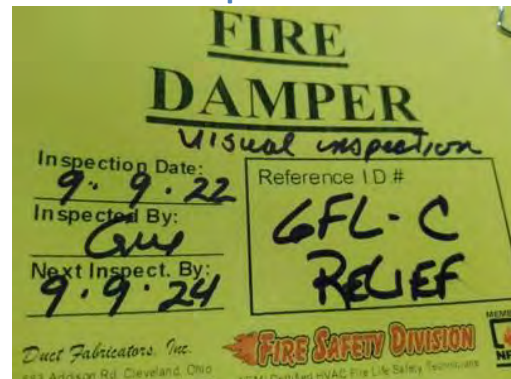

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2022-09-09

**Facility Location**  
Jail 2

**Damper Location**  
East mechanical room

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
6FL-E-R1

**Damper Type**  
Vertical Fire Damper

**Damper Size**  
12x16

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
10x10

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-E-R2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

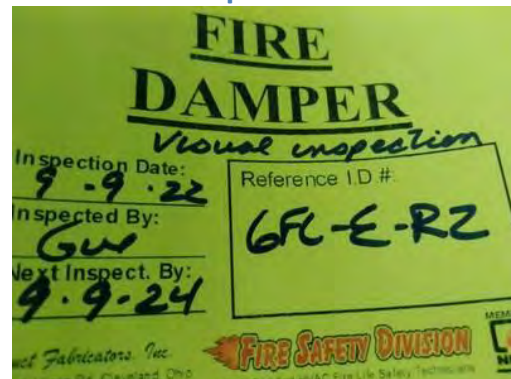

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-E-R3

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-E-R4

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-E-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

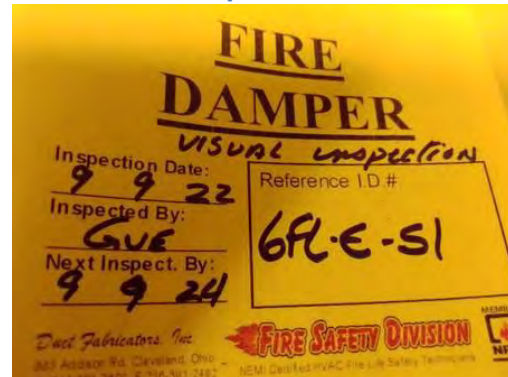

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-E-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12


**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**

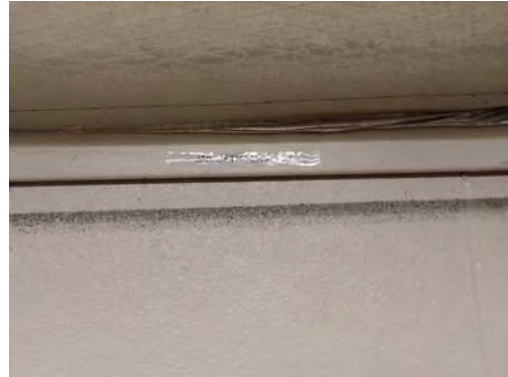

**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-E-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-E-S4

**Damper Type**

Horizontal Fire Damper

**Damper Size**

12x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-E-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-E-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

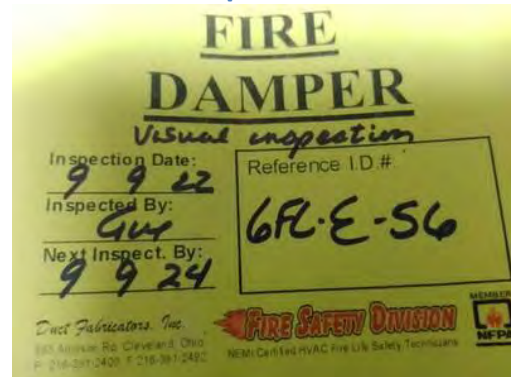

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-E-S7

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-E-S8

**Damper Type**

Horizontal Fire Damper

**Damper Size**

10x6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6x6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

<b>FIRE DAMPER</b>	
<i>Visual inspection</i>	
Inspection Date: <b>9 9 22</b>	Reference I.D.#:
Inspected By: <b>GUE</b>	<b>6FL-E-S8</b>
Next Inspect. By: <b>9 9 24</b>	
Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492	
<b>FIRE SAFETY DIVISION</b> NEMI Certified HVAC Fire Life Safety Technicians	
MEMBER <b>NFPA</b>	

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-RF-R1

**Damper Type**

Horizontal Fire Damper

**Damper Size**

21.5x19.5

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD2

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

14x14

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

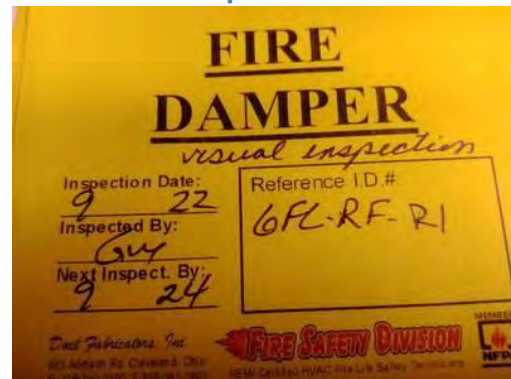

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-R1

**Damper Type**

Vertical Fire Damper

**Damper Size**

12x16

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

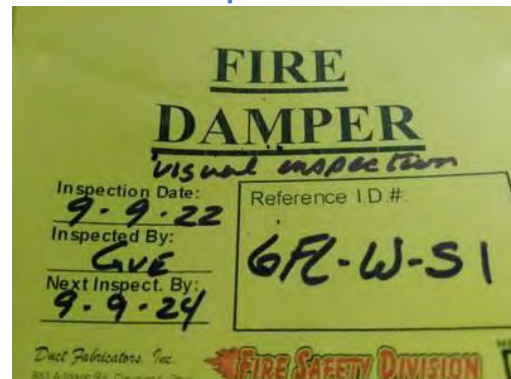



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-R2

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Ruskin

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

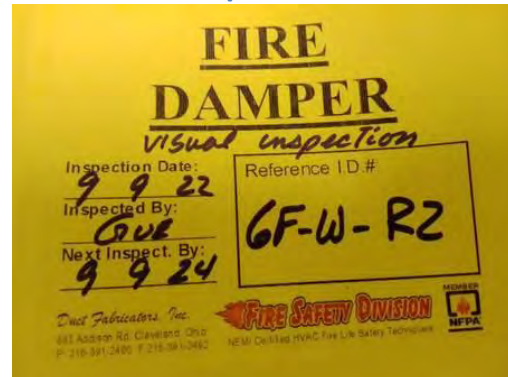

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-R3

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

20x20

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-R4

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

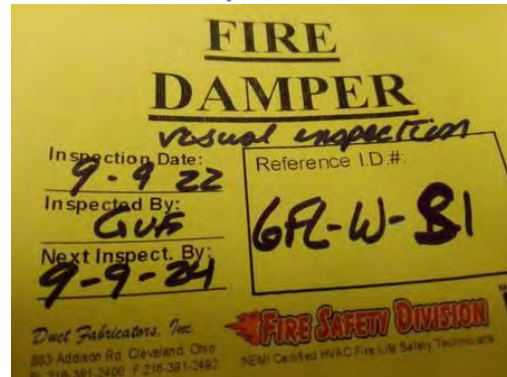

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-S4

**Damper Type**

Horizontal Fire Damper

**Damper Size**

12x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

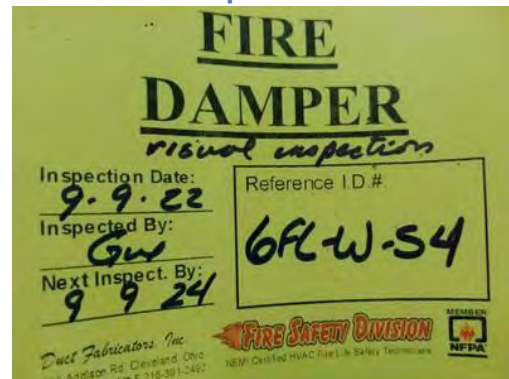

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

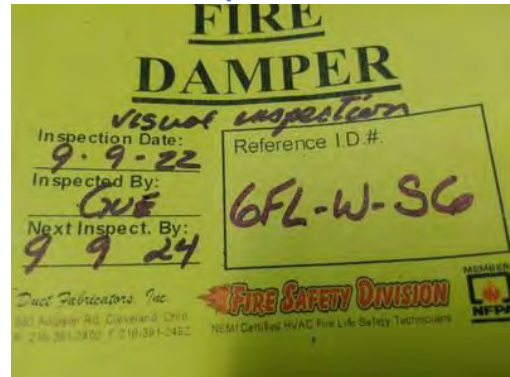

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-S7

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-09

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

6FL-W-S8

**Damper Type**

Horizontal Fire Damper

**Damper Size**

10x6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6x6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-13

**Facility Location**

Jail 2

**Damper Location**

PodA

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-EX-A

**Damper Type**

Vertical Fire Damper

**Damper Size**

16"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

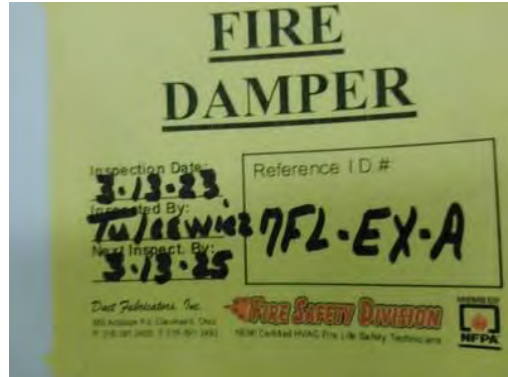

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-13

### Facility Location

Jail 2

### Damper Location

7FL Pod-D

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

7FL-EX-D

### Damper Type

Vertical Fire Damper

### Damper Size

10"x8"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

6"x6"

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None

### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-14

**Facility Location**

Jail 2

**Damper Location**

RM #702

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

10"x4"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8"x8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-13

**Facility Location**

Jail 2

**Damper Location**

Pod C+D

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

7FL-S4

**Damper Type**

Vertical Fire Damper

**Damper Size**

10"x4"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-13

### Facility Location

Justice Center Court Towers

### Damper Location

Vestibule A/B

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

7FL-S5

### Damper Type

Vertical Fire Damper

### Damper Size

10"x4"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

6"x6"

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None

### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-AHU8.3-S1

**Damper Type**

Horizontal Fire Damper

**Damper Size**

16x14

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-AHU8.3-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-AHU8.3-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

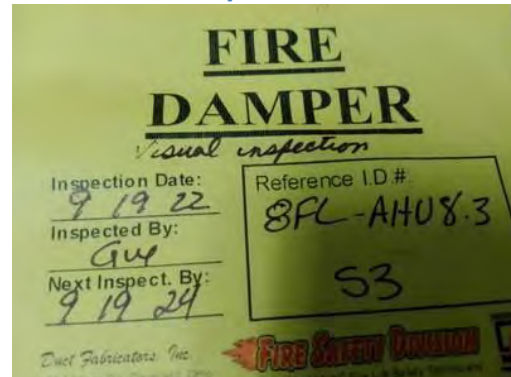

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

8FL mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-C-Relief

**Damper Type**

Vertical Fire Damper

**Damper Size**

30x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

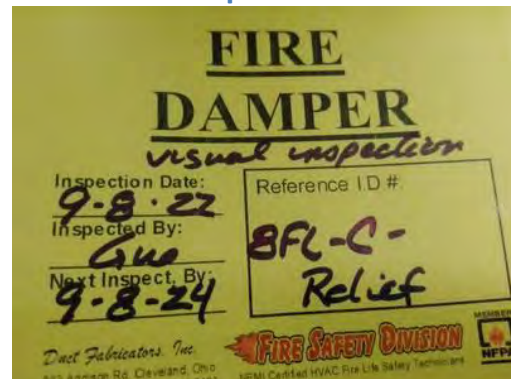

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-E-R1

**Damper Type**

Vertical Fire Damper

**Damper Size**

12x16

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

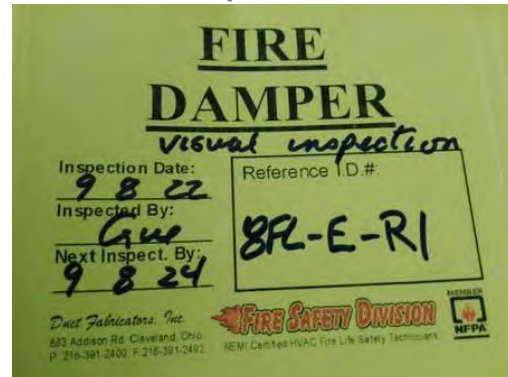

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-E-R2

**Damper Type**

Vertical Fire Damper

**Damper Size**

12x16

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

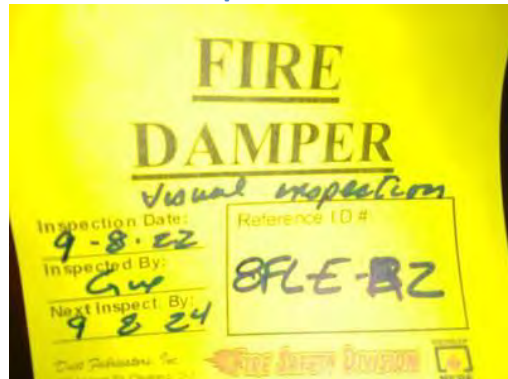

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-E-R3

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-E-R4

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

24x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-E-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-E-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-E-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-E-S4

**Damper Type**

Horizontal Fire Damper

**Damper Size**

12x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2022-09-08

**Facility Location**  
Jail 2

**Damper Location**  
East mechanical room

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
8FL-E-S5

**Damper Type**  
Vertical Fire Damper

**Damper Size**  
16x12

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
10x10

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-E-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-E-S7

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-E-S8

**Damper Type**

Horizontal Fire Damper

**Damper Size**

10x6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-RF-R1

**Damper Type**

Horizontal Fire Damper

**Damper Size**

22x20

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

18x18

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

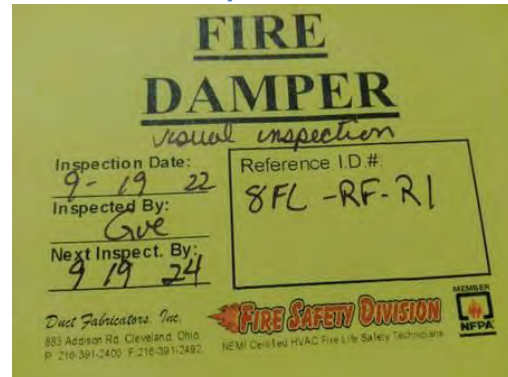

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-R1

**Damper Type**

Vertical Fire Damper

**Damper Size**

12x16

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

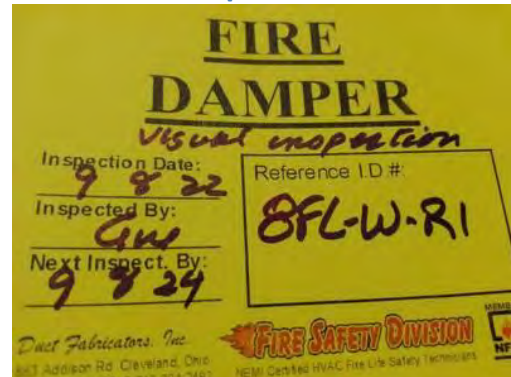

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-R2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

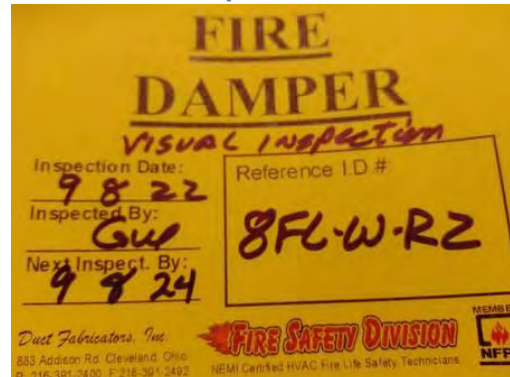

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-R3

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass


**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**

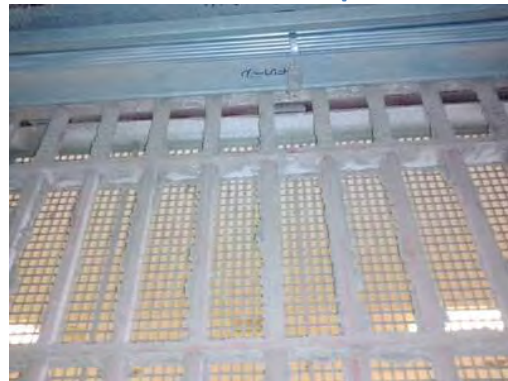

**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-R4

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass


**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**

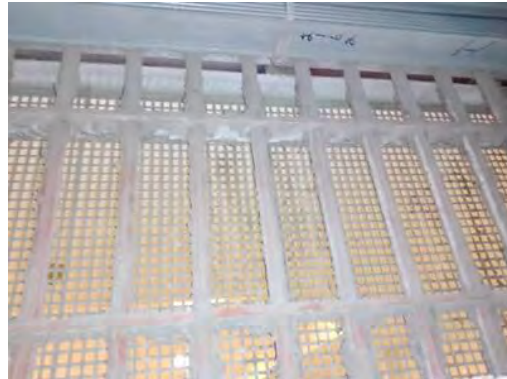

**Picture of Damper I.D. Label**

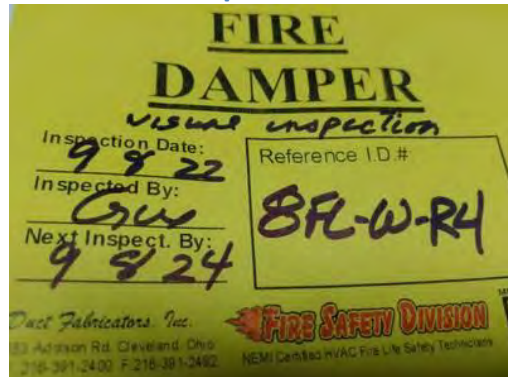

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

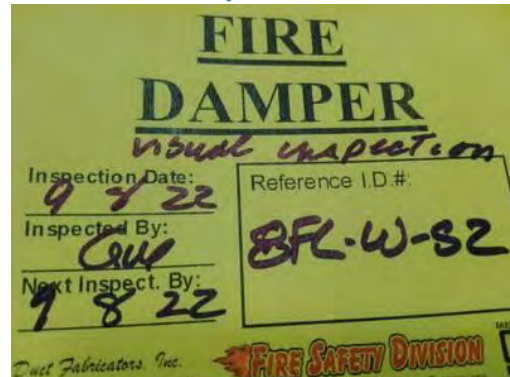

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-S4

**Damper Type**

Horizontal Fire Damper

**Damper Size**

12x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

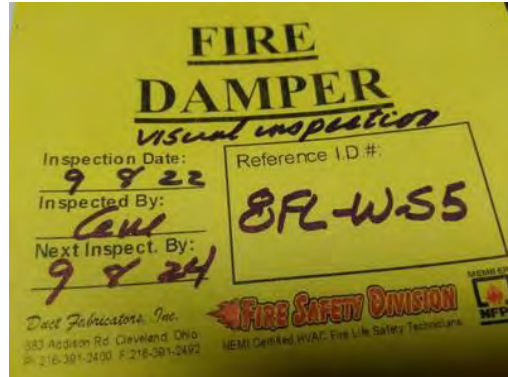

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

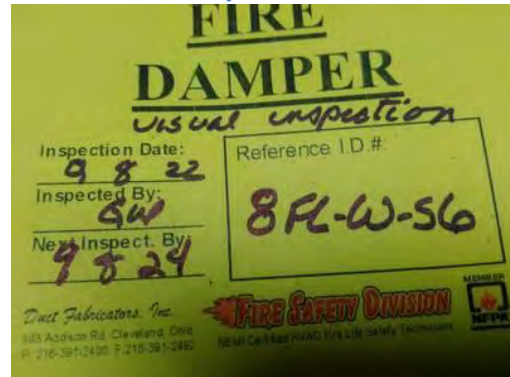

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-S7

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

8FL-W-S8

**Damper Type**

Horizontal Fire Damper

**Damper Size**

10x6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

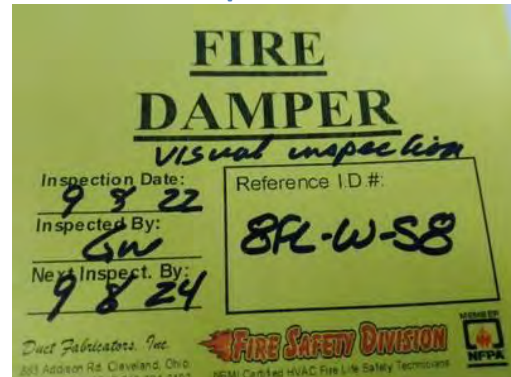

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-13

**Facility Location**

Jail 2

**Damper Location**

Pod -A

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-EX-A

**Damper Type**

Vertical Fire Damper

**Damper Size**

16"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-13

**Facility Location**

Jail 2

**Damper Location**

Pod D

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-EX-D

**Damper Type**

Vertical Fire Damper

**Damper Size**

10"x8"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-13

**Facility Location**

Jail 2

**Damper Location**

Vestibule A/B

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-FDS4

**Damper Type**

Vertical Fire Damper

**Damper Size**

10"x5"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

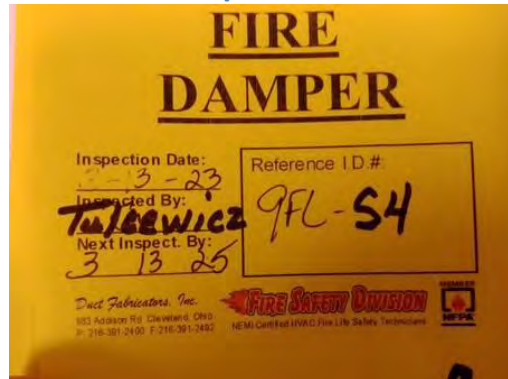



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-14

**Facility Location**

Jail 2

**Damper Location**

RM #902

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

10"x4"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8"x8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



*Duct Fabricators, Inc.*

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-13

**Facility Location**

Jail 2

**Damper Location**

Pod D/C

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

9FL-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

10"x4"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None



**Interior Picture of Damper**



**Exterior Picture of Damper**

Picture of Damper I.D. Label



## CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2022-09-19

**Facility Location**  
Jail 2

**Damper Location**  
North mechanical room

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
10FL Return Fan1

**Damper Type**  
Horizontal Fire Damper

**Damper Size**  
22x20

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
14x14

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Picture of Damper in Open Position**



**Picture of Damper in Closed Position**



**Picture of Damper I.D. Label**

**FIRE DAMPER**  
*visual inspection*

Inspection Date: *9-19-22*  
Inspected By: *GUE*  
Next Inspect. By: *9-19-24*

Reference I.D. #  
*10FL-RF-1*

Duct Fabricators, Inc.  
883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER  
**NFPA**

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-AHU10.3-S1

**Damper Type**

Horizontal Fire Damper

**Damper Size**

16x14

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

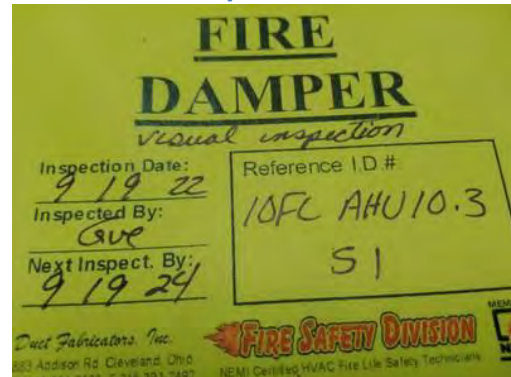

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-AHU10.3-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-19

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-AHU10.3-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

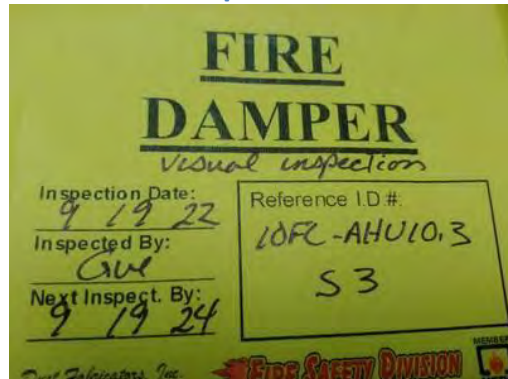

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-C-Relief

**Damper Type**

Vertical Fire Damper

**Damper Size**

30x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-R1

**Damper Type**

Vertical Fire Damper

**Damper Size**

12x16

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-R2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-R3

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

16x16

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

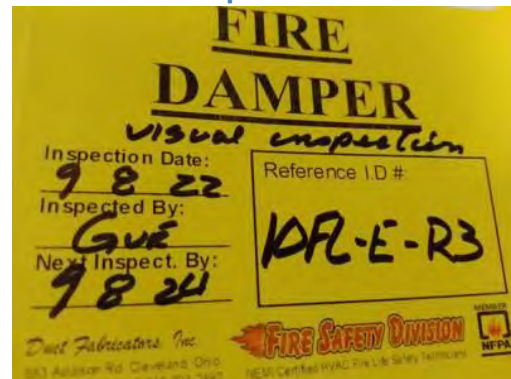

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-R4

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

16x16

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

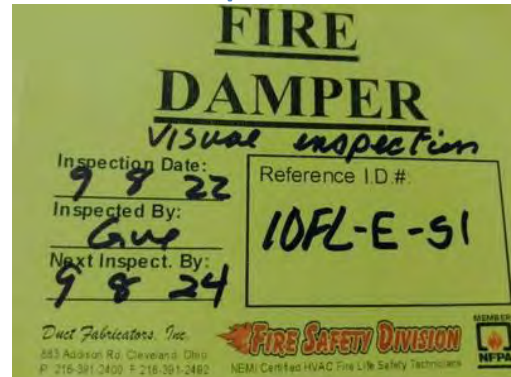

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12


**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**

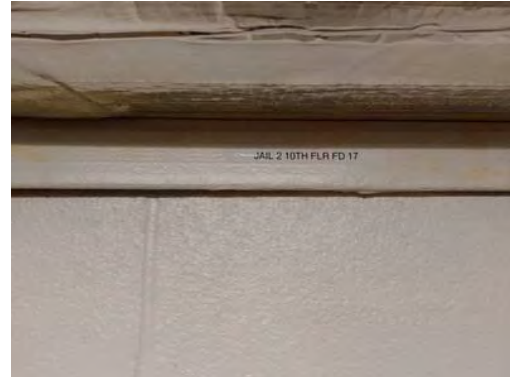

**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-S4

**Damper Type**

Horizontal Fire Damper

**Damper Size**

12x10

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD2

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

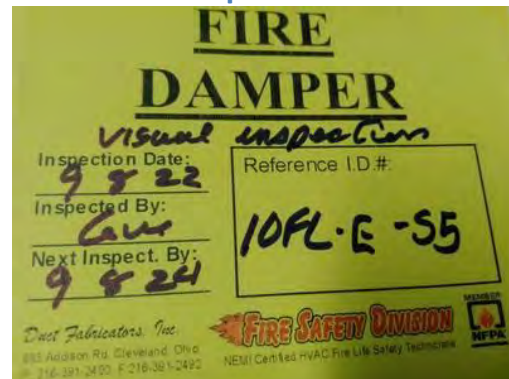

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-S7

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-E-S8

**Damper Type**

Horizontal Fire Damper

**Damper Size**

10x6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-R1

**Damper Type**

Vertical Fire Damper

**Damper Size**

12x16

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

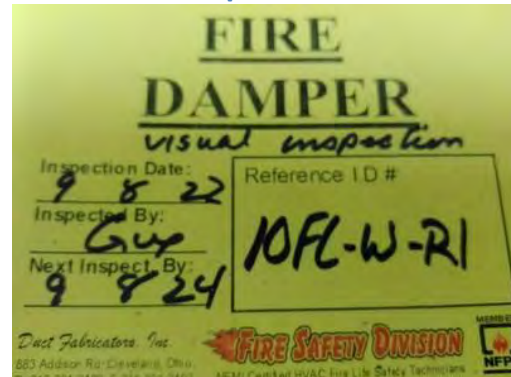

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-R2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

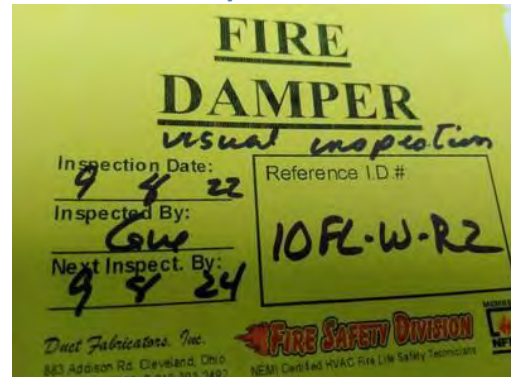

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-R3

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-R4

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

21x11

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

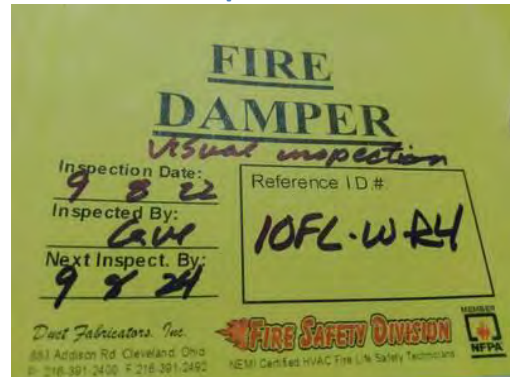



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

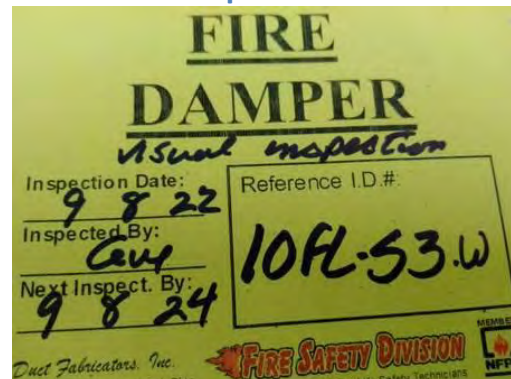

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-S4

**Damper Type**

Horizontal Fire Damper

**Damper Size**

12x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

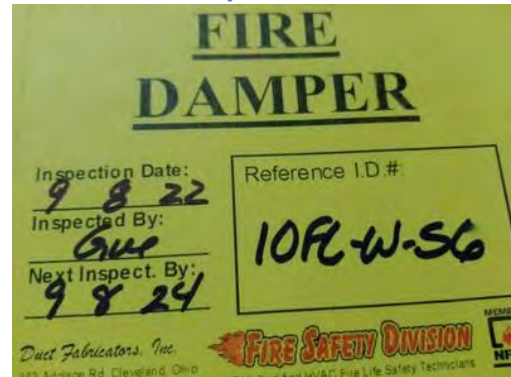

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-S7

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

10FL-W-S8

**Damper Type**

Horizontal Fire Damper

**Damper Size**

10x6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F:216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-13

### Facility Location

Jail 2

### Damper Location

PodA

### Inspector Name

Julie Gue

### Damper I.D. #

11FL-EX-A

### Damper Type

Vertical Fire Damper

### Damper Size

16"x12"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

12"x12"

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None

### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-13

**Facility Location**

Justice Center Court Towers

**Damper Location**

Pod D

**Inspector Name**

Julie Gue

**Damper I.D. #**

11FL-EX-D

**Damper Type**

Vertical Fire Damper

**Damper Size**

10x8

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

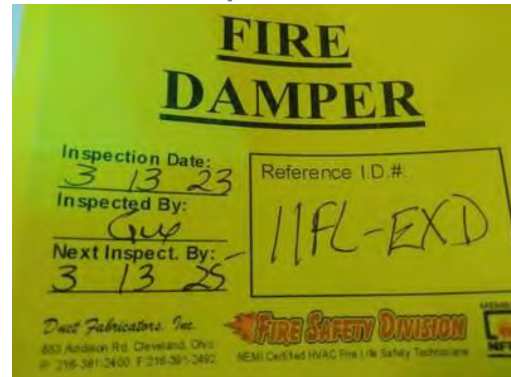

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-14

**Facility Location**

Jail 2

**Damper Location**

RM-#1102

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

11FL-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

10"x4"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8"x8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

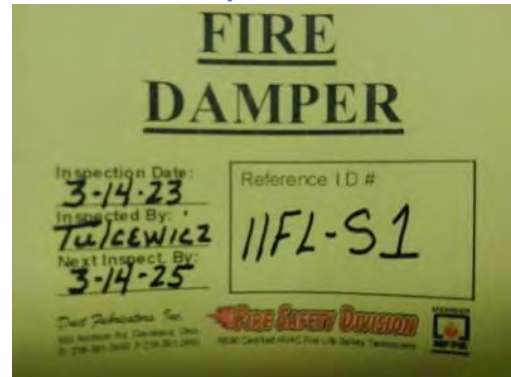

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-14

**Facility Location**

Jail 2

**Damper Location**

RM #1105

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

11FL-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

10"x9"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8"x8"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

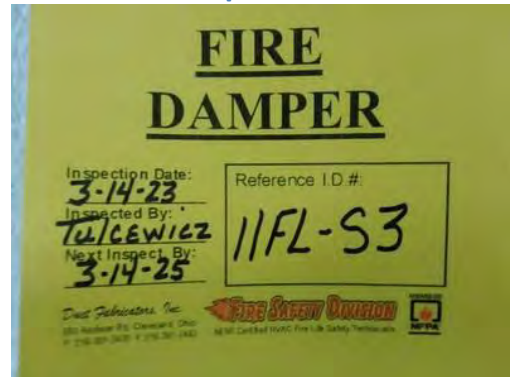

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-13

**Facility Location**

Justice Center Court Towers

**Damper Location**

Vestibule A/B

**Inspector Name**

Julie Gue

**Damper I.D. #**

11FL-S4

**Damper Type**

Vertical Fire Damper

**Damper Size**

10x4

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6x6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-13

**Facility Location**

Jail 2

**Damper Location**

Vestibule C/D

**Inspector Name**

Julie Gue

**Damper I.D. #**

11FL-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

10x4

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6x6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-13

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-AHU12.3-S1

**Damper Type**

Horizontal Fire Damper

**Damper Size**

16x14

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

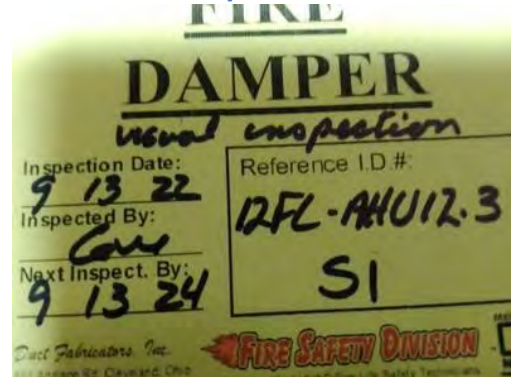

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-13

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-AHU12.3-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

IBD2

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

Center mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-C-Relief

**Damper Type**

Vertical Fire Damper

**Damper Size**

30x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-E-R1

**Damper Type**

Vertical Fire Damper

**Damper Size**

12x16

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-E-R2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

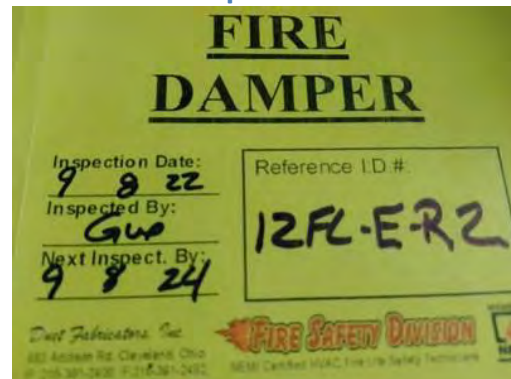

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-E-R3

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-E-R4

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass


**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**

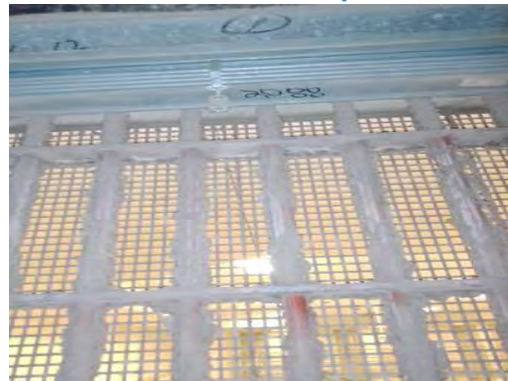

**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-07

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-E-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

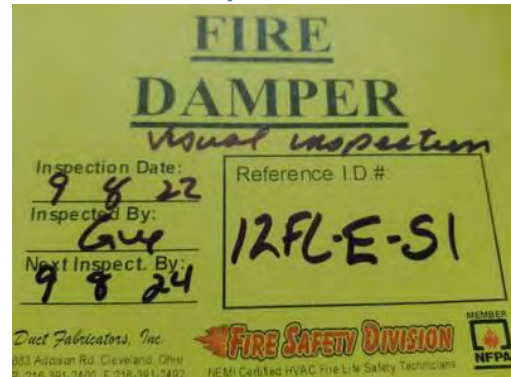

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-E-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-E-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2022-09-08

**Facility Location**  
Jail 2

**Damper Location**  
East mechanical room

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
12FL-E-S4

**Damper Type**  
Horizontal Fire Damper

**Damper Size**  
12x10

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
8x8

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

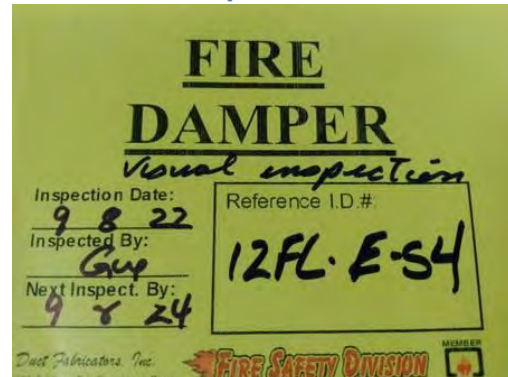

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-E-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-E-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-E-S7

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

East mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-E-S8

**Damper Type**

Horizontal Fire Damper

**Damper Size**

10x6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-13

**Facility Location**

Jail 2

**Damper Location**

North mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-RF12.3-R1

**Damper Type**

Horizontal Fire Damper

**Damper Size**

20x22

**Damper Manufacturer**

Ruskin

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

20x20

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-R1

**Damper Type**

Vertical Fire Damper

**Damper Size**

12x16

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-R2

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-R3

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10x10

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-R4

**Damper Type**

Vertical Fire Damper

**Damper Size**

48x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

21x11

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

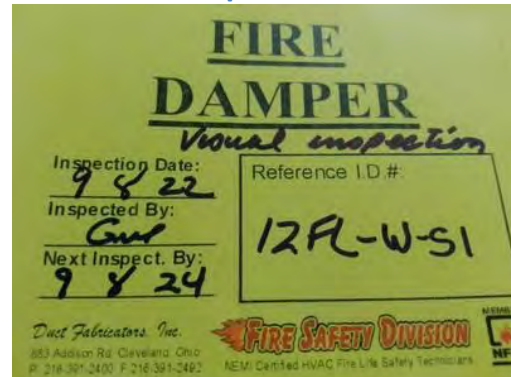

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-07

**Facility Location**

Jail 2

**Damper Location**

West Mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-S4

**Damper Type**

Horizontal Fire Damper

**Damper Size**

12x10

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-S5

**Damper Type**

Vertical Fire Damper

**Damper Size**

16x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-S6

**Damper Type**

Vertical Fire Damper

**Damper Size**

14x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-S7

**Damper Type**

Vertical Fire Damper

**Damper Size**

22x12

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12x12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-08

**Facility Location**

Jail 2

**Damper Location**

West mechanical room

**Inspector Name**

Julie Gue

**Damper I.D. #**

12FL-W-S8

**Damper Type**

Horizontal Fire Damper

**Damper Size**

10x6

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

8x8

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-14

**Facility Location**

Jail 2

**Damper Location**

Basement storage

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

BL-S1

**Damper Type**

Vertical Fire Damper

**Damper Size**

9"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-14

**Facility Location**

Jail 2

**Damper Location**

Basement storage

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

BL-S2

**Damper Type**

Vertical Fire Damper

**Damper Size**

10"x6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

4"x4"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-14

**Facility Location**

Jail 2

**Damper Location**

Basement laundry entrance

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

BL-S3

**Damper Type**

Vertical Fire Damper

**Damper Size**

8"x6"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6"x6"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-14

**Facility Location**

Jail 2

**Damper Location**

Laundry

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

BL-S4

**Damper Type**

Vertical Fire Damper

**Damper Size**

10"x15"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

10"x10"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

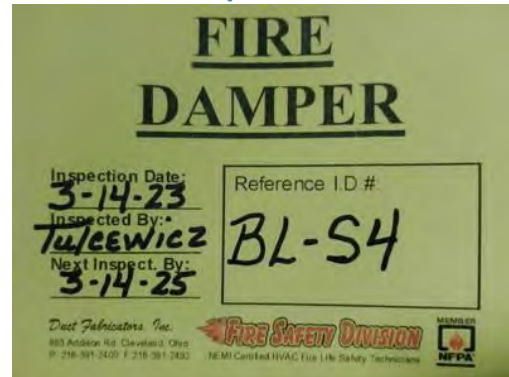

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-14

**Facility Location**

Jail 2

**Damper Location**

Laundry storage

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

BL-TA-1

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"X56"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-14

### Facility Location

Jail 2

### Damper Location

Plumbing room

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

BL-TA-2

### Damper Type

Vertical Fire Damper

### Damper Size

24"X56"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

Remove the grille

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None

### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-14

**Facility Location**

Jail 2

**Damper Location**

Plumbing room

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

BL-TA-3

**Damper Type**

Vertical Fire Damper

**Damper Size**

20"x40"

**Damper Manufacturer**

Ruskin

**Damper Model #**

IBD2

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-06

**Facility Location**

Jail 2

**Damper Location**

Kitchen

**Inspector Name**

Julie Gue

**Damper I.D. #**

Kitchen FD2

**Damper Type**

Vertical Fire Damper

**Damper Size**

40 x 18

**Damper Manufacturer**

Greenheck

**Damper Model #**

FD150BV

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-06

**Facility Location**  
Jail 2

**Damper Location**  
Kitchen

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
Kitchen FD1

**Damper Type**  
Vertical Fire Damper

**Damper Size**  
40 x 8

**Damper Manufacturer**  
Greenheck

**Damper Model #**  
FD150VB

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
10 x 10

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-06

**Facility Location**

Jail 2

**Damper Location**

Kitchen Electrical Closet

**Inspector Name**

Julie Gue

**Damper I.D. #**

Kitchen FD3

**Damper Type**

Vertical Fire Damper

**Damper Size**

8 x 8

**Damper Manufacturer**

Greenheck

**Damper Model #**

FD150BV

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

6 x 6

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-06

**Facility Location**

Jail 2

**Damper Location**

Kitchen Electrical Closet

**Inspector Name**

Julie Gue

**Damper I.D. #**

Kitchen FD4

**Damper Type**

Vertical Fire Damper

**Damper Size**

24 x 24

**Damper Manufacturer**

Greenheck

**Damper Model #**

FD150BV

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Open

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-04-06

**Facility Location**

Jail 2

**Damper Location**

Kitchen

**Inspector Name**

Julie Gue

**Damper I.D. #**

Kitchen FD5

**Damper Type**

Vertical Fire Damper

**Damper Size**

36 x 12

**Damper Manufacturer**

Greenheck

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12 x 12

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-06

**Facility Location**  
Jail 2

**Damper Location**  
Kitchen

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
Kitchen FD6

**Damper Type**  
Vertical Fire Damper

**Damper Size**  
28 x 12

**Damper Manufacturer**  
Greenheck

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
12 x 12


**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Exterior Picture of Damper**



**Interior Picture of Damper**

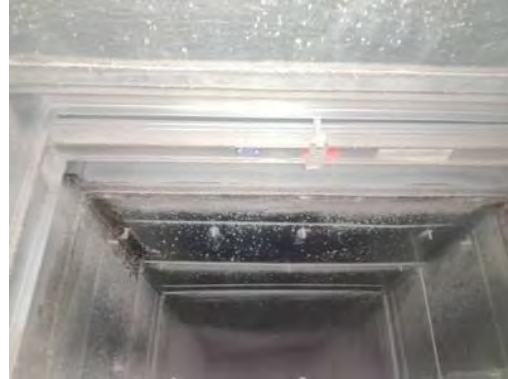

**Picture of Damper I.D. Label**

<b>FIRE DAMPER</b>	
Inspection Date: <u>4-6-23</u>	Reference I.D.# <u>KITCHEN FD6</u>
Inspected By: <u>Gue</u>	
Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492	
<b>FIRE SAFETY DIVISION</b> NEMI Certified HVAC Fire Life Safety Technicians	

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-04-06

**Facility Location**  
Jail 2

**Damper Location**  
Kitchen

**Inspector Name**  
Julie Gue

**Damper I.D. #**  
Kitchen FD8

**Damper Type**  
Vertical Fire Damper

**Damper Size**  
46 x 16

**Damper Manufacturer**  
Greenheck

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
18 x 18

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-09

**Facility Location**

Jail 2

**Damper Location**

Basement Landing

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 1 FL- Basement

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

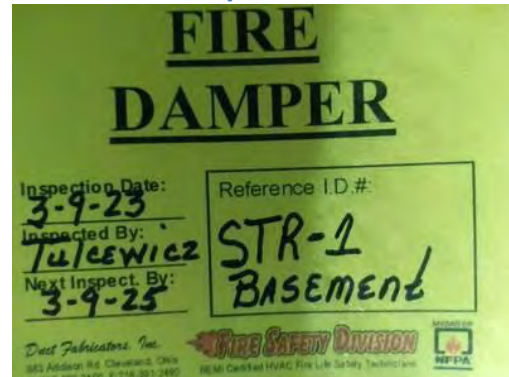

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**  
2023-03-09

**Facility Location**  
Jail 2

**Damper Location**  
Floor 1

**Inspector Name**  
Dan Tulcewicz

**Damper I.D. #**  
STR 1-10FL

**Damper Type**  
Vertical Fire Damper

**Damper Size**  
24"X24"

**Damper Manufacturer**  
Air Balance

**Damper Model #**  
Unknown

**Fusible Link Temperature**  
165 Degrees

**Access Door Size**  
Remove the grille

**Pass / Fail / Abandoned**  
Pass

**Comments / Corrections**  
None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

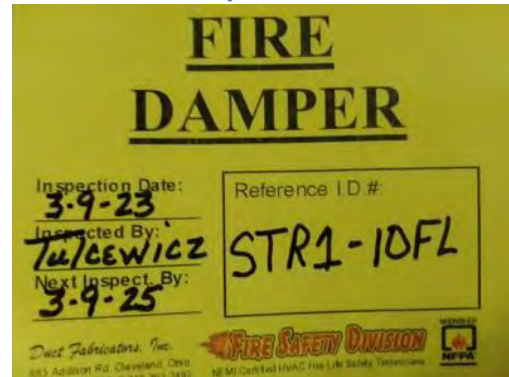

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-09

**Facility Location**

Jail 2

**Damper Location**

Floor 12

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 1-12FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

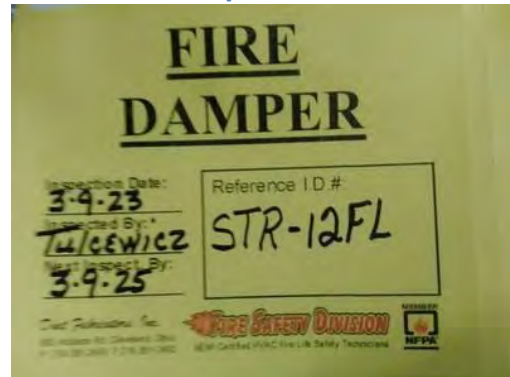

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-09

**Facility Location**

Jail 2

**Damper Location**

Floor 1

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 1-FL1

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

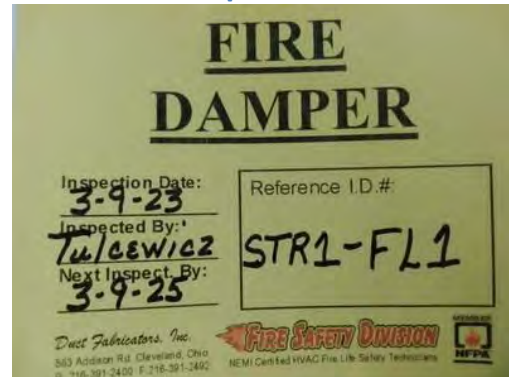

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-09

**Facility Location**

Jail 2

**Damper Location**

Floor 2

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 1-FL2

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

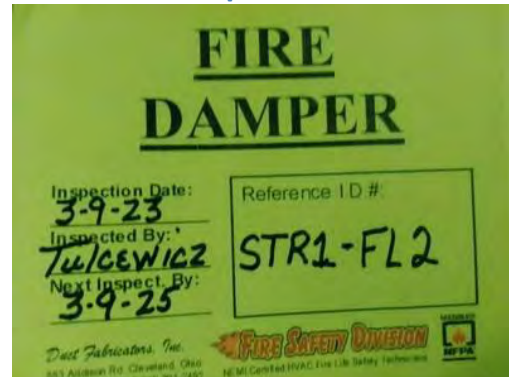

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-09

**Facility Location**

Jail 2

**Damper Location**

Floor 3

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 1-FL3

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

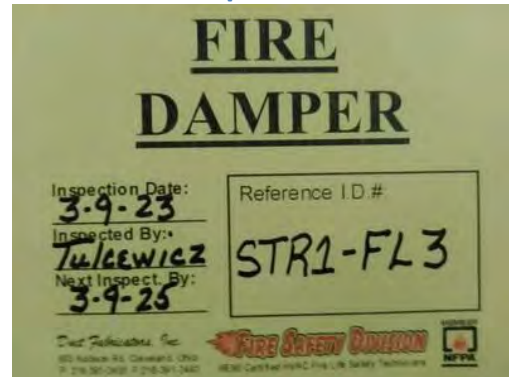

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-09

**Facility Location**

Jail 2

**Damper Location**

Floor 4

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 1-FL4

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

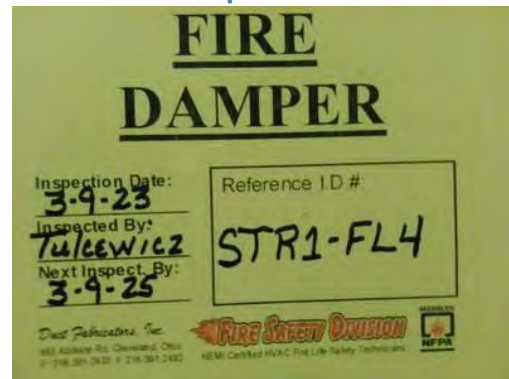

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-09

**Facility Location**

Jail 2

**Damper Location**

Floor 6

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 1-FL6

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

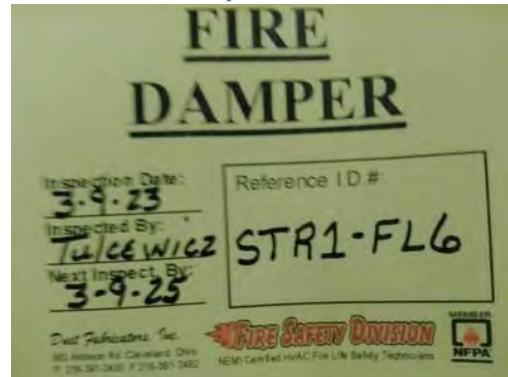



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-09

**Facility Location**

Jail 2

**Damper Location**

Floor 8

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 1-FL8

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

1st Floor Northeast

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 2-1FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

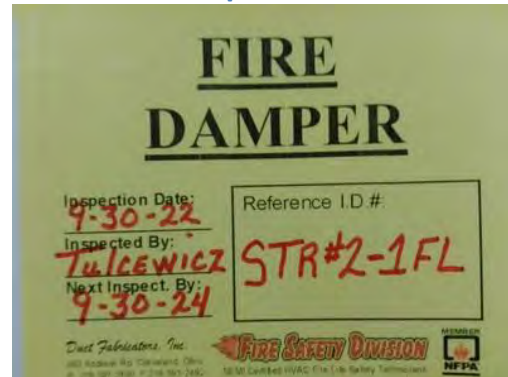

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

2nd Floor Northeast

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 2-2FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

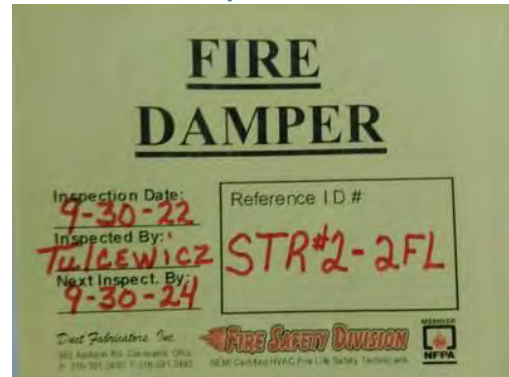

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

3rd Floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 2-3FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

4th Floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 2-4FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

,24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

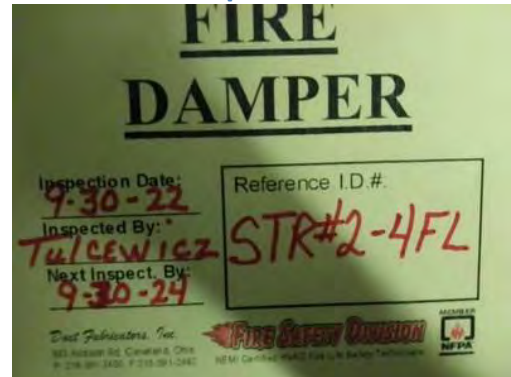

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

6th Floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 2-6FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

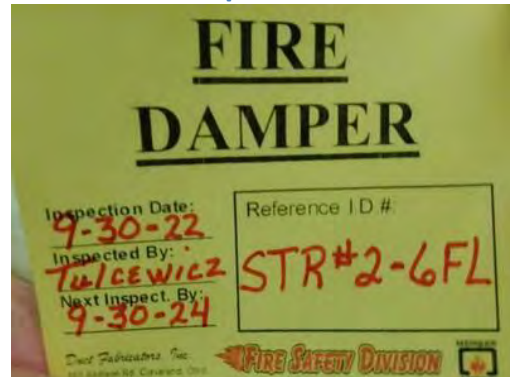

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

8th Floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 2-8FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

10th Floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 2-10FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**





Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

Floor 12

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 2-12FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 1

**Damper Location**

1st floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 3-1FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

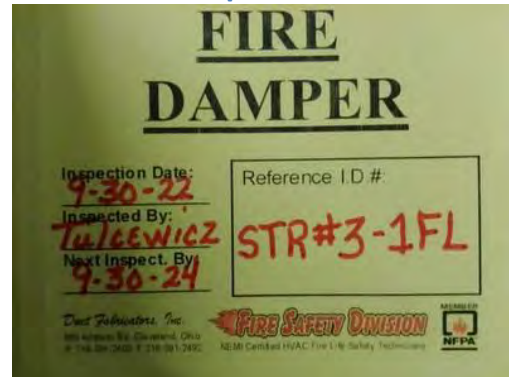

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

2nd Floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 3-2FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

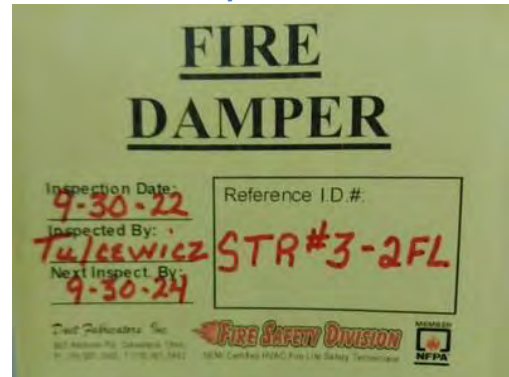

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

3rd floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 3-3FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

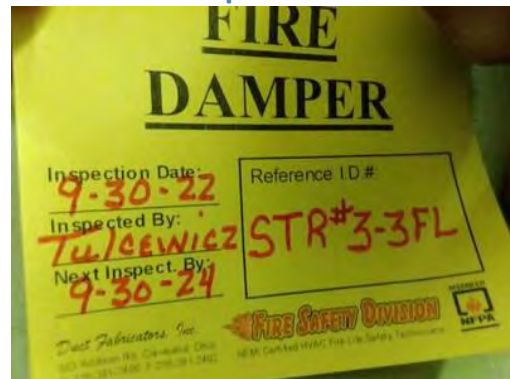

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

4th floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 3-4FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

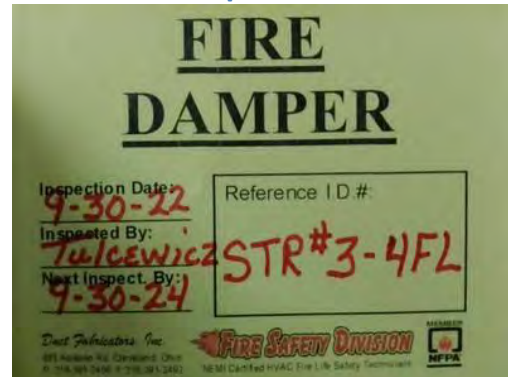

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

6th floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 3-6FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

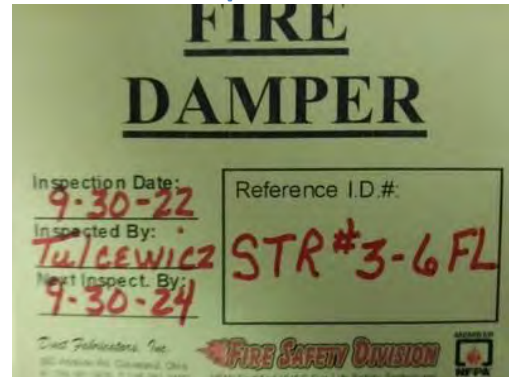

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

8th floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 3-8FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

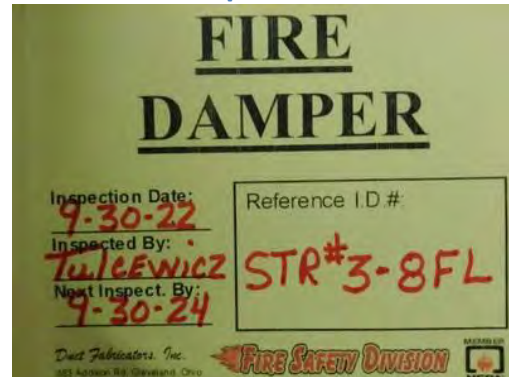

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

10th floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 3-10FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

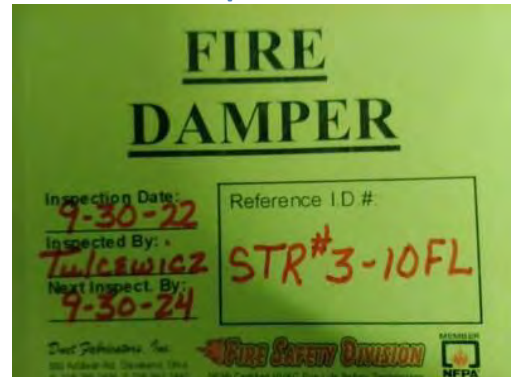



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2022-09-30

**Facility Location**

Jail 2

**Damper Location**

12th floor

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 3-12FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24x24

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Thru the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

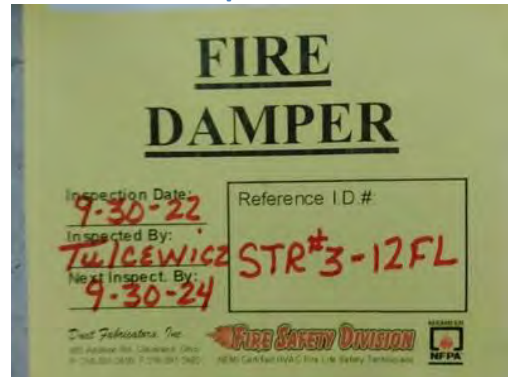

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-08

**Facility Location**

Jail 2

**Damper Location**

Floor 4

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 4 -FL4

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

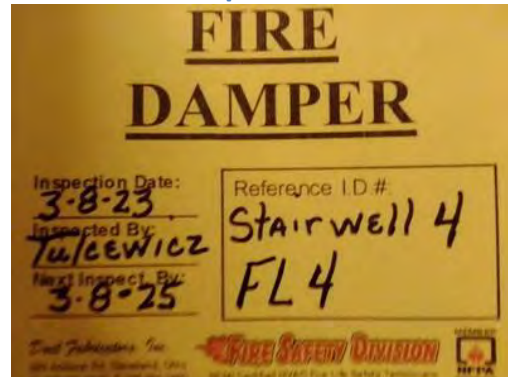

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-08

**Facility Location**

Jail 2

**Damper Location**

Floor 8

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 4- FL8

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

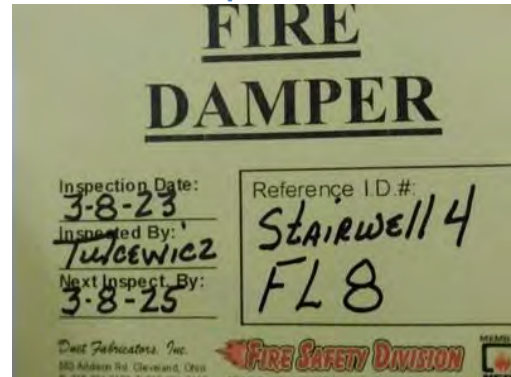

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-08

**Facility Location**

Jail 2

**Damper Location**

Stairwell 4

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 4 -TA1

**Damper Type**

Vertical Fire Damper

**Damper Size**

18"x12"

**Damper Manufacturer**

Air Balance

**Damper Model #**

119AV

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

12"x12"

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

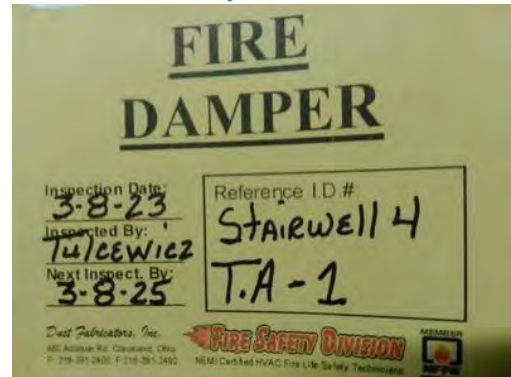

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-08

### Facility Location

Jail 2

### Damper Location

Floor 1

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

STR 4-1FL

### Damper Type

Vertical Fire Damper

### Damper Size

24"x24"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

Remove the grille

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

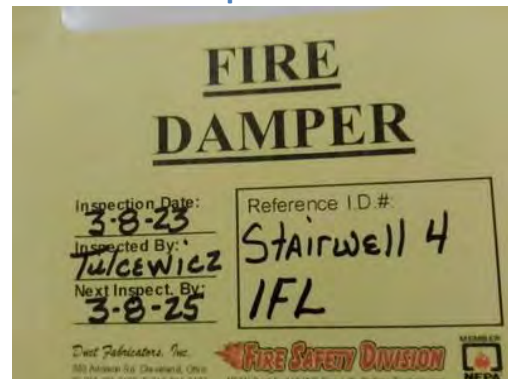

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-08

**Facility Location**

Jail 2

**Damper Location**

Floor 6

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 4-6FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

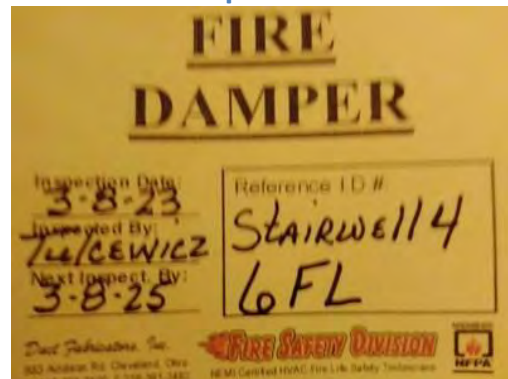

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-08

**Facility Location**

Jail 2

**Damper Location**

Floor 10

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 4-10FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

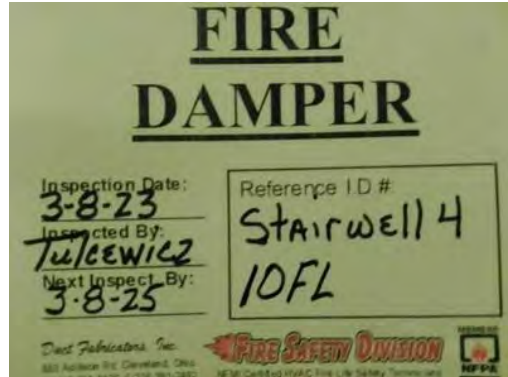

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-08

**Facility Location**

Jail 2

**Damper Location**

Floor 12

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 4-12FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

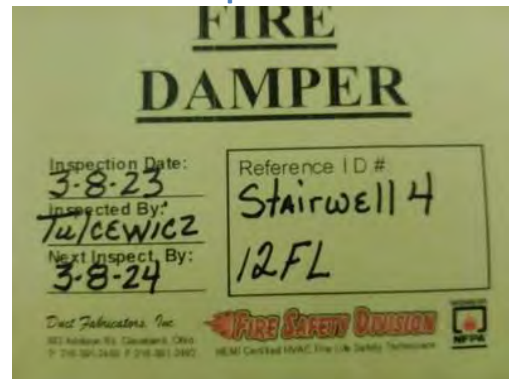



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-08

**Facility Location**

Jail 2

**Damper Location**

Floor 2

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 4-FL2

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

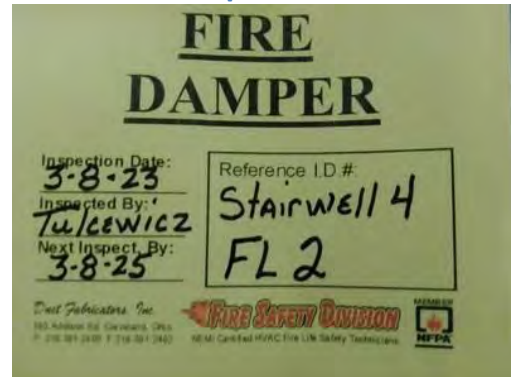

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-07

**Facility Location**

Jail 2

**Damper Location**

Basement

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 5-BL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

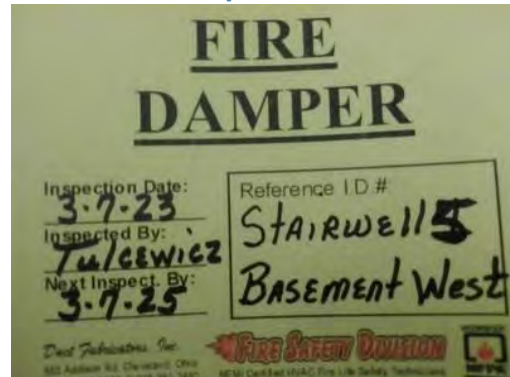

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-07

**Facility Location**

Jail 2

**Damper Location**

Floor 1

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 5-1FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-07

**Facility Location**

Jail 2

**Damper Location**

Flooe 2

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 5-2FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

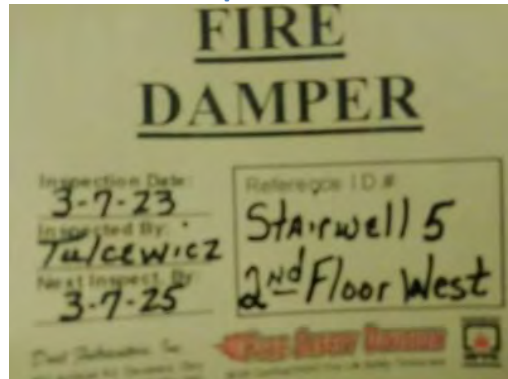

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-08

### Facility Location

Jail 2

### Damper Location

Floor 3

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

STR 4-FL3

### Damper Type

Vertical Fire Damper

### Damper Size

24"x24"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

Remove the grille

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None

### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-07

**Facility Location**

Jail 2

**Damper Location**

Floor 4

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 5- 4FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

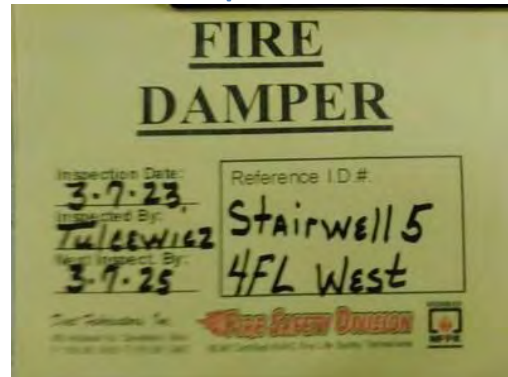

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-07

**Facility Location**

Jail 2

**Damper Location**

Floor 6

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 5- 6FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

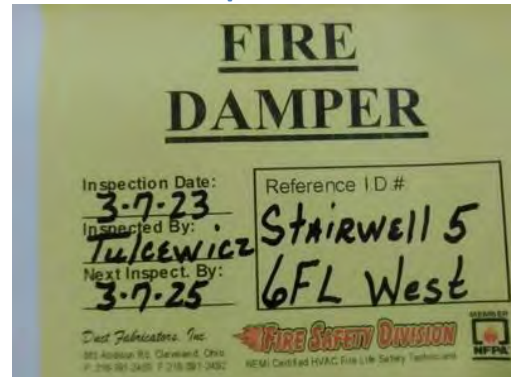

## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-07

**Facility Location**

Jail 2

**Damper Location**

Floor 3

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 5-3FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

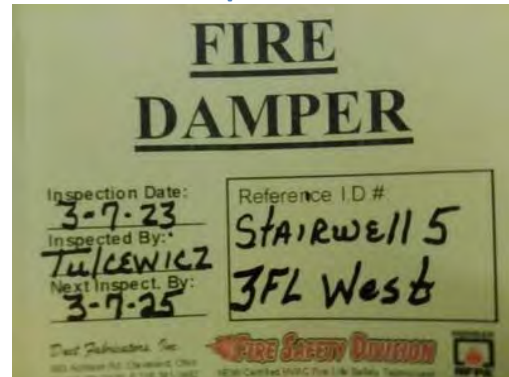



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-07

**Facility Location**

Jail 2

**Damper Location**

Floor 8

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 5-8FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None


**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

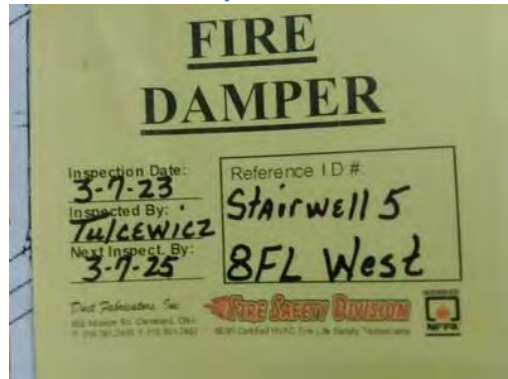

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**  
NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

### Date of Inspection

2023-03-07

### Facility Location

Jail 2

### Damper Location

Floor 10

### Inspector Name

Dan Tulcewicz

### Damper I.D. #

STR 5-10FL

### Damper Type

Vertical Fire Damper

### Damper Size

24"x24"

### Damper Manufacturer

Air Balance

### Damper Model #

Unknown

### Fusible Link Temperature

165 Degrees

### Access Door Size

Remove the grille

### Pass / Fail / Abandoned

Pass

### Comments / Corrections

None


### Exterior Picture of Damper



### Interior Picture of Damper



### Picture of Damper I.D. Label

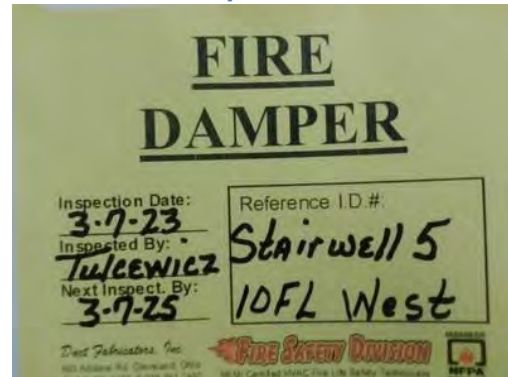

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio  
P: 216-391-2400 F: 216-391-2492

**FIRE SAFETY DIVISION**

NEMI Certified HVAC Fire Life Safety Technicians



## VISUAL CUYAHOGA COUNTY DAMPER INSPECTION REPORT

**Date of Inspection**

2023-03-07

**Facility Location**

Jail 2

**Damper Location**

Floor 12

**Inspector Name**

Dan Tulcewicz

**Damper I.D. #**

STR 5-12FL

**Damper Type**

Vertical Fire Damper

**Damper Size**

24"x24"

**Damper Manufacturer**

Air Balance

**Damper Model #**

Unknown

**Fusible Link Temperature**

165 Degrees

**Access Door Size**

Remove the grille

**Pass / Fail / Abandoned**

Pass

**Comments / Corrections**

None

**Exterior Picture of Damper**



**Interior Picture of Damper**



**Picture of Damper I.D. Label**

