

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2023-10-06

Facility Location

Jane Edna Hunter Building

Damper Location

2nd FL West Mechanical RM

Inspector Name

Larry Coreno

Damper I.D.

AHU1- Supply

Damper Type

Horizontal Fire Damper

Damper Size

64" x 36"

Damper Manufacturer

Safe Air

Damper Model

IBD2

Fusible Link Temperature

165 Degrees

Access Door Size

21" x 14"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

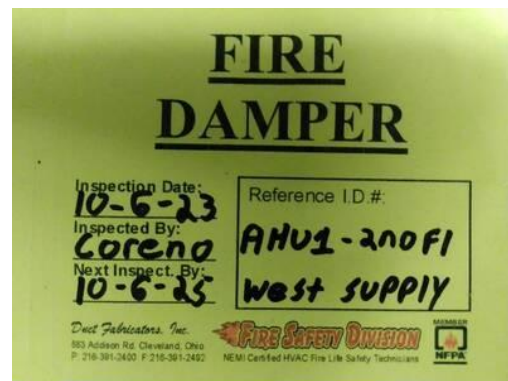

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2023-10-06

Facility Location

Jane Edna Hunter Building

Damper Location

2nd FL West Mechanical RM

Inspector Name

Larry Coreno

Damper I.D.

AHU1- Return

Damper Type

Horizontal Fire Damper

Damper Size

64" x 44"

Damper Manufacturer

Safe Air

Damper Model

IBD2

Fusible Link Temperature

165 Degrees

Access Door Size

16" x 16" & 21" x 14"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<small>883 Addison Rd. Cleveland, Ohio 44115 P: 216-391-2400 F: 216-391-2492</small>		<small>NEMI Certified HVAC Fire Life Safety Technicians</small>	<small>MEMBER NFPA</small>
<u>FIRE</u> <u>DAMPER</u>			
Inspection Date: 10-6-23	Reference I.D.#: AHU1- 2nd FL		
Inspected By: Coreno	West Return		
Next Inspect. By: 10-6-25			
<small>Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492</small>		FIRE SAFETY DIVISION	

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2023-10-06

Facility Location

Jane Edna Hunter Building

Damper Location

2nd FL East Mechanical RM

Inspector Name

Larry Coreno

Damper I.D.

AHU2- Return

Damper Type

Horizontal Fire Damper

Damper Size

64" x 44"

Damper Manufacturer

Safe Air

Damper Model

IBD2

Fusible Link Temperature

165 Degrees

Access Door Size

21" x 14" & 18" x 18"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

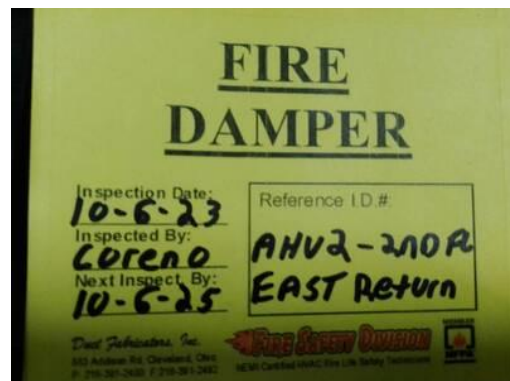

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-04-15

Facility Location

Jane Edna Hunter Building

Damper Location

2nd floor

Inspector Name

Dan Tulcewicz

Damper I.D.

AHU2 Supply

Damper Type

Horizontal Fire Damper

Damper Size

64"x36"

Damper Manufacturer

Ruskin

Damper Model

IBD60

Fusible Link Temperature

165 Degrees

Access Door Size

16"x16"

Pass / Fail / Abandoned

Pass

Comments / Corrections

2nd Floor Mech Rm


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

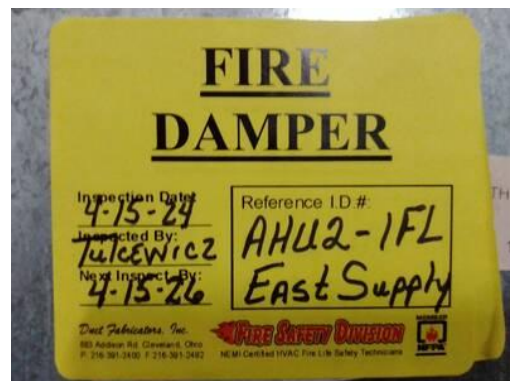

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2023-10-06

Facility Location

Jane Edna Hunter Building

Damper Location

2nd FL West Mechanical Rm

Inspector Name

Larry Coreno

Damper I.D.

AHU3- Supply

Damper Type

Vertical Fire Damper

Damper Size

72" x 30"

Damper Manufacturer

Safe Air

Damper Model

IBD2

Fusible Link Temperature

165 Degrees

Access Door Size

21" x 14"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

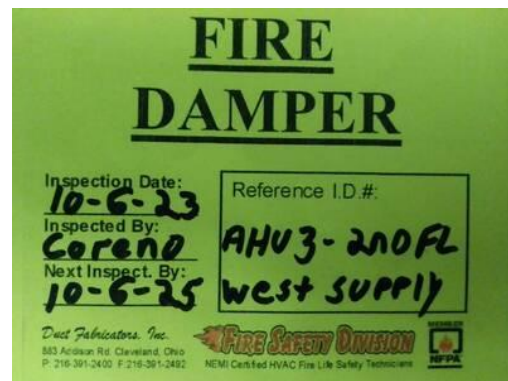

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2023-10-06

Facility Location

Jane Edna Hunter Building

Damper Location

2nd FL West Mechanical RM

Inspector Name

Larry Coreno

Damper I.D. #

AHU3- Return

Damper Type

Vertical Fire Damper

Damper Size

109" x 33"

Damper Manufacturer

Ruskin

Damper Model #

IBD2

Fusible Link Temperature

165 Degrees

Access Door Size

21" x 14"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

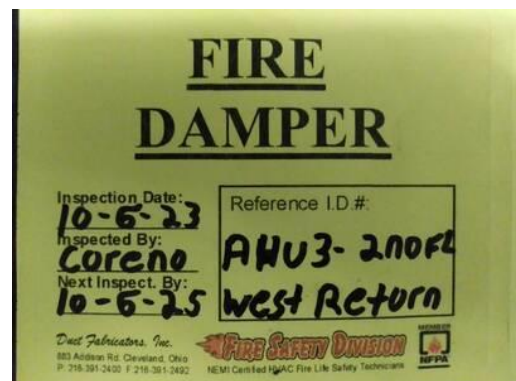

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2023-10-06

Facility Location

Jane Edna Hunter Building

Damper Location

2nd FL East Mechanical Rm

Inspector Name

Larry Coreno

Damper I.D.

AHU4- Return

Damper Type

Vertical Fire Damper

Damper Size

111" x 30"

Damper Manufacturer

Safe Air

Damper Model

IBD2

Fusible Link Temperature

165 Degrees

Access Door Size

21" x 14"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

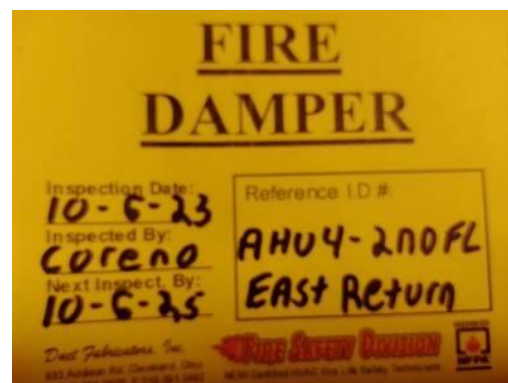

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2023-10-06

Facility Location

Jane Edna Hunter Building

Damper Location

2nd FL East Mechanical RM

Inspector Name

Larry Coreno

Damper I.D. #

AHU4- Supply

Damper Type

Vertical Fire Damper

Damper Size

72" x 30"

Damper Manufacturer

Safe Air

Damper Model #

IBD2

Fusible Link Temperature

165 Degrees

Access Door Size

21" x 14"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

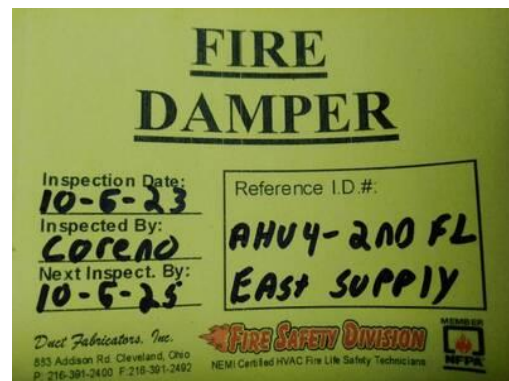

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2023-10-06

Facility Location

Jane Edna Hunter Building

Damper Location

3rd FL West Mechanical Rm

Inspector Name

Larry Coreno

Damper I.D.

AHU5- Return

Damper Type

Vertical Fire Damper

Damper Size

108" x 36"

Damper Manufacturer

Safe Air

Damper Model

IBD2

Fusible Link Temperature

165 Degrees

Access Door Size

16" x 14"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

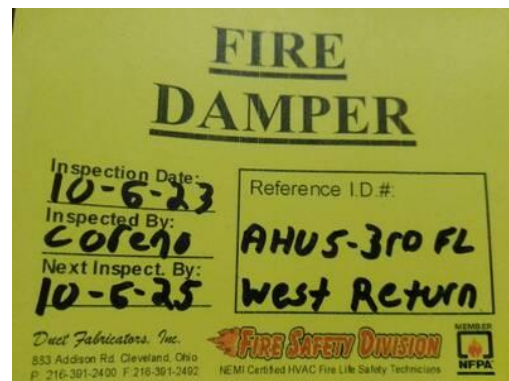

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2023-10-06

Facility Location

Jane Edna Hunter Building

Damper Location

3rd FL West Mechanical RM

Inspector Name

Larry Coreno

Damper I.D. #

AHU5- Supply

Damper Type

Vertical Fire Damper

Damper Size

90" x 36"

Damper Manufacturer

Safe Air

Damper Model #

IBD2

Fusible Link Temperature

165 Degrees

Access Door Size

21" x 14"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

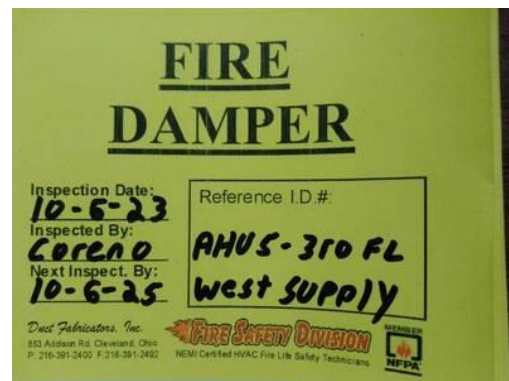

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2023-10-06

Facility Location

Jane Edna Hunter Building

Damper Location

3rd FL East Mechanical RM

Inspector Name

Larry Coreno

Damper I.D.

AHU6- Return

Damper Type

Vertical Fire Damper

Damper Size

114" x 36"

Damper Manufacturer

Safe Air

Damper Model

IBD2

Fusible Link Temperature

165 Degrees

Access Door Size

21" x 14"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

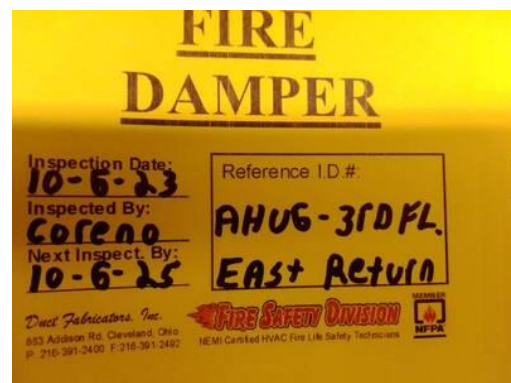

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection
2023-10-06

Facility Location
Jane Edna Hunter Building

Damper Location
3rd FL East Mechanical Rm

Inspector Name
Larry Coreno

Damper I.D. #
AHU6- Supply

Damper Type
Vertical Fire Damper

Damper Size
90" x 36"

Damper Manufacturer
Safe Air

Damper Model #
IBD2

Fusible Link Temperature
165 Degrees

Access Door Size
21" x 14"

Pass / Fail / Abandoned
Pass

Comments / Corrections
None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.
 883 Addison Rd. Cleveland, Ohio
 P: 216-391-2400 F: 216-391-2492



Fire / Smoke / Fire & Smoke Damper
Composite Inspection Report

	<u>FD/SD/FSD</u>	<u>I.D.#</u>	<u>Size</u>	<u>Manufacturer</u>	<u>Model</u>	<u>Visual</u>	<u>Functional</u>	<u>Comments</u>
1	FD	AHU1-R	64x44	Safe Air	Unknown	Pass	Pass	None
2	FD	AHU1-S	64x36	Safe Air	Unknown	Pass	Pass	None
3	FD	AHU2-R	60x44	Safe Air	Unknown	Pass	Pass	None
4	FD	AHU2-S	64x36	Ruskin	IBD20	Pass	Pass	None
5	FD	AHU3-R	109x33	Ruskin	IBD20	Pass	Pass	None
6	FD	AHU3-S	72x30	Safe Air	Unknown	Pass	Pass	None
7	FD	AHU4-R	110x30	Safe Air	Unknown	Pass	Pass	None
8	FD	AHU4-S	72x30	Safe Air	Unknown	Pass	Pass	None
9	FD	AHU5-R	108x36	Safe Air	Unknown	Pass	Pass	None
10	FD	AHU5-S	90x36	Safe Air	Unknown	Pass	Pass	None
11	FD	AHU6-R	114x36	Safe Air	Unknown	Pass	Pass	None
12	FD	AHU6-S	90x30	Safe Air	Unknown	Pass	Pass	None

Inspector: L Coreno
Inspection Dates: 6-Oct-23
Facility: Jane Edna Hunter

SA = Supply Air FD = Fire Damper
 RA = Return Air