

Report Date: September 16th, 2024

Project: Cuyahoga County
Medical Examiner's Building

Inspector(s): James Futrell, Certified Technician

Inspection and Test Date(s): August & September 2024

Duct Fabricators, Inc. "Fire Safety Division" inspected the One Hundred Four (104) fire dampers noted on the following sheets for proper installation. The dampers were then tested and photographed in the "open" and "closed" positions to confirm that they were functioning as designed.

(86) dampers passed the inspection and functional testing.
(18) dampers failed the inspection for reasons listed on the report.

NOTES: NFPA 80 and NFPA 105 require newly installed dampers to be inspected and tested one year after initial installation. Thereafter, dampers located in patient care facilities are to be inspected and tested every six years.

Additionally, the information contained herein verified whether the dampers were functional at the time of testing. This verification process does not represent any form of a guarantee that the dampers will properly perform in the future.

#	Date of Inspection	Facility Location	Damper Location	Inspector Name	Damper I D	Damper Type	Damper Size	Damper Manufacturer	Damper Model	Fusible Link Temperature	Access Door Size	Pass Fail Abandoned	Comments Corrections
1	2024-08-26	County Examiner Bldg.	Men's bathroom 6FL	James Futrell	FD-01	Vertical Fire Damper	8"/10"	Unknown	Unknown	165 Degrees	8"/6"	Fail	No Fire sleeve/No Frams
2	2024-08-26	County Examiner Bldg.	Mech Rm 606	James Futrell	FD-02	Horizontal Fire Damper	6"/10"	Unknown	unknown	165 Degrees	6"/6"	Pass	None
3	2024-08-26	County Examiner Bldg.	Mech Rm 606 6FL	James Futrell	FD-03	Horizontal Fire Damper	6"/10"	Unknown	unknown	165 Degrees	6"/6"	Pass	None
4	2024-08-26	County Examiner Bldg.	Women's Bathroom 6 FL	James Futrell	FD-04	Vertical Fire Damper	10"/8"	Unknown	Unknown	165 Degrees	8"/6"	Fail	No fire sleeve/No frams
5	2024-08-26	County Examiner Bldg.	Mech RM 605	James Futrell	FD-05	Vertical Fire Damper	12"/10"	Unknown	Unknown	165 Degrees	12"/10". Grill	Pass	None
6	2024-08-26	County Examiner Bldg.	Mech RM 5Th Floor	James Futrell	FD-06	Vertical Fire Damper	40"/9"	Unknown	Unknown	165 Degrees	6"/6"	Pass	None
7	2024-08-26	County Examiner Bldg.	Mech Rm 606	James Futrell	FD-07	Horizontal Fire Damper	36"/14"	Unknown	Unknown	165 Degrees	8"/8" -(2)	Pass	2 Dampers inside duct
8	2024-08-26	County Examiner Bldg.	Mech RM 5TH FL	James Futrell	FD-08	Vertical Fire Damper	14"/14"	Unknown	Unknown	165 Degrees	6"/6"	Pass	None
9	2024-08-26	County Examiner Bldg.	Mech RM 5TH. FL	James Futrell	FD-09	Vertical Fire Damper	36"/12"	Unknown	Unknown	165 Degrees	8"/8"	Fail	Damper is unaccessible/o pen air between Dampers 9/10
10	2024-08-26	County Examiner Bldg.	Mech RM 5TH FL	James Futrell	FD-10	Vertical Fire Damper	30"/10"	Unknown	Unknown	165 Degrees	8"/8"	Fail	Damper is unaccessible/o pen air between FD-10/9
11	2024-08-27	County Examiner Bldg.	Mech RM 5Th FL Door	James Futrell	FD-11	Vertical Fire Damper	48"/12"	Unknown	Unknown	165 Degrees	8"/8"	Pass	None
12	2024-08-27	County Examiner Bldg.	Hallway 5TH. FL	James Futrell	FD-12	Vertical Fire Damper	10"/6"	Unknown	Unknown	165 Degrees	6"/6"	Pass	None
13	2024-08-27	County Examiner Bldg.	Hallway 5TH. FL	James Futrell	FD-13	Vertical Fire Damper	10"/6"	Unknown	Unknown	165 Degrees	6"/6"	Pass	None
14	2024-08-27	County Examiner Bldg.	Hallway 5TH. FL	James Futrell	FD-14	Vertical Fire Damper	40"/7"	Unknown	Unknown	165 Degrees	6"/6"	Pass	None
15	2024-08-27	County Examiner Bldg.	Men's Restroom 5Th FL	James Futrell	FD-15	Vertical Fire Damper	10"/8"	Unknown	Unknown	165 Degrees	8"/6"	Fail	No damper sleeve/No Frams
16	2024-08-27	County Examiner Bldg.	RM 502	James Futrell	FD-16	Vertical Fire Damper	6"/6"	Unknown	Unknown	165 Degrees	5"/5"	Fail	No damper sleeve/Curtain not in wall/No Frams
17	2024-08-27	County Examiner Bldg.	RM 504 Mech RM	James Futrell	FD-17	Vertical Fire Damper	8" Round	Unknown	Unknown	165 Degrees	10"/6"	Pass	None
18	2024-08-27	County Examiner Bldg.	Door 505	James Futrell	FD-18	Vertical Fire Damper	12"/6"	Unknown	Unknown	165 Degrees	Grill	Pass	None
19	2024-08-27	County Examiner Bldg.	Rm-404. Mech Rm	James Futrell	FD-19	Vertical Fire Damper	28"/18"	Unknown	Unknown	165 Degrees	12"/12"	Pass	None
20	2024-08-27	County Examiner Bldg.	RM 405 Mech Rm	James Futrell	FD-20	Vertical Fire Damper	28"/18"	Unknown	Unknown	165 Degrees	12"/12"	Pass	None

21	2024-08-27	County Examiner Bldg.	RM-405. Mech. Rm	James Futrell	FD-21	Vertical Fire Damper	20"/10"	Unknown	Unknown	165 Degrees	10"/10"	Pass	Cut in access door
22	2024-08-27	County Examiner Bldg.	RM -405 Mech Rm	James Futrell	FD-22	Vertical Fire Damper	10"/6"	Unknown	Unknown	165 Degrees	10"/10"	Pass	Cut in access door
23	2024-08-28	County Examiner Bldg.	Men's Bathroom	James Futrell	FD-23	Vertical Fire Damper	8"/10"	Unknown	Unknown	165 Degrees	8"/6"	Fail	No damper sleeve/No Frams/Cement at wall
24	2024-08-28	County Examiner Bldg.	Mech RM-404 behind Men's bathroom	James Futrell	FD-24	Vertical Fire Damper	10"/6"	Unknown	Unknown	165 Degrees	10"/10"	Pass	Cut in access door
25	2024-09-04	County Examiner Bldg.	Mech RM 406	James Futrell	FD-25	Vertical Fire Damper	40/14	Unknown	Unknown	165 Degrees	16/16	Pass	Installed access door
26	2024-08-28	County Examiner Bldg.	Mech RM 406	James Futrell	FD-26	Vertical Fire Damper	10/8	Unknown	Unknown	165 Degrees	10/10	Pass	Install access door
27	2024-08-28	County Examiner Bldg.	Closet 402	James Futrell	FD-27	Vertical Fire Damper	28/18	Unknown	Unknown	165 Degrees	12/12	Pass	None
28	2024-08-28	County Examiner Bldg.	4th floor Women's Bathroom	James Futrell	FD-28	Vertical Fire Damper	10/8	Unknown	Unknown	165 Degrees	8/8	Pass	Install access door
29	2024-08-28	County Examiner Bldg.	4th floor Women's Bathroom	James Futrell	FD-29	Vertical Fire Damper	72/24	Unknown	Unknown	165 Degrees	18/18	Pass	None
30	2024-08-28	County Examiner Bldg.	Mech RM 404	James Futrell	FD-30	Vertical Fire Damper	6inch round	Unknown	Unknown	165 Degrees	10/6	Pass	Install access door
31	2024-08-29	County Examiner Bldg.	4th floor hallway	James Futrell	FD-31	Vertical Fire Damper	96/20	Unknown	Unknown	165 Degrees	16/16	Pass	Remove abandoned balance Dampers to can access to fire damper
32	2024-08-29	County Examiner Bldg.	3rd floor mech room	James Futrell	FD-32	Vertical Fire Damper	28/18	Unknown	Unknown	165 Degrees	12/12	Pass	None
33	2024-08-29	County Examiner Bldg.	3rd floor mech room	James Futrell	FD-33	Vertical Fire Damper	22/12	Unknown	Unknown	165 Degrees	10/10	Pass	Install access door
34	2024-08-29	County Examiner Bldg.	3rd floor mech room	James Futrell	FD-34	Vertical Fire Damper	6 inch round	Unknown	Unknown	165 Degrees	10/6	Pass	Install access door , install new heat link, damper was found in closed position
35	2024-08-29	County Examiner Bldg.	3rd floor men's bathroom	James Futrell	FD-35	Vertical Fire Damper	54/16	Unknown	Unknown	165 Degrees	12/12	Pass	None
36	2024-08-29	County Examiner Bldg.	3rd floor men's room, mech room	James Futrell	FD-36	Vertical Fire Damper	34/18	Unknown	Unknown	165 Degrees	12/12	Pass	None
37	2024-08-29	County Examiner Bldg.	3rd floor men's room, mech room	James Futrell	FD-37	Vertical Fire Damper	34/18	Unknown	Unknown	165 Degrees	14/14	Pass	Repair retaining angle frame , install access door
38	2024-08-29	County Examiner Bldg.	3rd floor hallway	James Futrell	FD-38	Vertical Fire Damper	48/16	Unknown	Unknown	165 Degrees	10/10	Pass	Install access door

39	2024-08-29	County Examiner Bldg.	3rd floor hallway	James Futrell	FD-39	Vertical Fire Damper	38/14	Unknown	Unknown	165 Degrees	12/12	Pass	Add retaining angle frame , on both sides of wall
40	2024-08-29	County Examiner Bldg.	3rd floor hallway	James Futrell	FD-40	Vertical Fire Damper	36/14	Unknown	Unknown	165 Degrees	Open	Pass	None
41	2024-08-29	County Examiner Bldg.	3rd floor hallway	James Futrell	FD-41	Vertical Fire Damper	36/14	Unknown	Unknown	165 Degrees	Open	Pass	None
42	2024-08-29	County Examiner Bldg.	3rd floor hallway	James Futrell	FD-42	Vertical Fire Damper	20/14	Unknown	Unknown	165 Degrees	16/16	Pass	None
43	2024-08-29	County Examiner Bldg.	3rd floor hallway by women bathroom	James Futrell	FD-43	Vertical Fire Damper	24/14	Unknown	Unknown	165 Degrees	12/12	Fail	No retaining angle, conduit in annular space
44	2024-09-04	County Examiner Bldg.	3rd floor hallway by women bathroom	James Futrell	FD-44	Vertical Fire / Smoke Damper	94/19	Unknown	Unknown	165 Degrees	Open	Pass	None
45	2024-08-29	County Examiner Bldg.	3rd floor by evidence	James Futrell	FD-45	Vertical Fire Damper	48/18	Unknown	Unknown	165 Degrees	Open	Pass	None
46	2024-09-04	County Examiner Bldg.	Mech Room 605	James Futrell	FD-46	Horizontal Fire Damper	66/20	Unknown	Unknown	165 Degrees	24/24	Pass	None
47	2024-09-04	County Examiner Bldg.	Mech RM 605	James Futrell	FD-47	Horizontal Fire Damper	66/24	Unknown	Unknown	165 Degrees	24/24	Pass	None
48	2024-09-04	County Examiner Bldg.	4th floor hallway	James Futrell	FD-48	Vertical Fire Damper	70/16	Unknown	Unknown	165 Degrees	18/18	Pass	None
49	2024-09-04	County Examiner Bldg.	4th floor hallway	James Futrell	FD-49	Vertical Fire Damper	60/30	Unknown	Unknown	165 Degrees	18/18	Pass	None
50	2024-09-04	County Examiner Bldg.	3rd floor suite 308	James Futrell	FD-50	Vertical Fire Damper	16/8	Unknown	Unknown	165 Degrees	Open	Pass	None
51	2024-09-04	County Examiner Bldg.	3rd floor suite 308	James Futrell	FD-51	Vertical Fire Damper	40/18	Unknown	Unknown	165 Degrees	Open	Pass	None
52	2024-09-04	County Examiner Bldg.	3rd floor suite 308	James Futrell	FD-52	Vertical Fire Damper	28/14	Unknown	Unknown	165 Degrees	16/16	Pass	Install access door
53	2024-09-04	County Examiner Bldg.	3rd floor server room	James Futrell	FD-53	Vertical Fire Damper	8inch round	Unknown	Unknown	165 Degrees	6/10	Pass	None
54	2024-09-04	County Examiner Bldg.	3rd floor Fire Arms Ref Room	James Futrell	FD-54	Vertical Fire Damper	36/16	Unknown	Unknown	165 Degrees	Open	Pass	None
55	2024-09-04	County Examiner Bldg.	3rd floor Fire Arms Ref Room	James Futrell	FD-55	Vertical Fire Damper	48/16	Unknown	Unknown	165 Degrees	16/16	Pass	None
56	2024-09-04	County Examiner Bldg.	3rd floor Fire Arms Ref Room	James Futrell	FD-56	Vertical Fire Damper	14/10	Unknown	Unknown	165 Degrees	Open	Pass	None
57	2024-09-04	County Examiner Bldg.	3rd floor Fire Arms Ref Room	James Futrell	FD-57	Vertical Fire Damper	24/20	Unknown	Unknown	165 Degrees	Open	Pass	None
58	2024-09-04	County Examiner Bldg.	3rd floor Fire Arms Ref Room	James Futrell	FD-58	Vertical Fire Damper	8 inch round	Unknown	Unknown	165 Degrees	6/10	Pass	None
59	2024-09-04	County Examiner Bldg.	3rd floor Rm325	James Futrell	FD-59	Vertical Fire Damper	24/14	Unknown	Unknown	165 Degrees	Open	Pass	None

60	2024-09-04	County Examiner Bldg.	3rd floor Finger print back hallway	James Futrell	FD-60	Vertical Fire Damper	6 inch round	Unknown	Unknown	165 Degrees	Inaccessible	Fail	Inaccessible
61	2024-09-04	County Examiner Bldg.	3rd floor by Morgue elevator	James Futrell	FD-61	Vertical Fire Damper	48/16	Unknown	Unknown	165 Degrees	16/16	Pass	None
62	2024-09-04	County Examiner Bldg.	3rd floor by Morgue elevator	James Futrell	FD-62	Vertical Fire Damper	6 inch round	Unknown	Unknown	165 Degrees	5/8	Pass	None
63	2024-09-05	County Examiner Bldg.	2nd floor mech room	James Futrell	FD-63	Vertical Fire Damper	66/20	Unknown	Unknown	165 Degrees	18/18	Pass	Install access door , damper is two separate curtains
64	2024-09-05	County Examiner Bldg.	2nd floor mech room	James Futrell	FD-64	Vertical Fire Damper	66/32	Unknown	Unknown	165 Degrees	20/20	Pass	Install access door , damper is two separate curtains
65	2024-09-05	County Examiner Bldg.	2nd floor mech room	James Futrell	FD-65	Vertical Fire Damper	20/12	Unknown	Unknown	165 Degrees	14/14	Pass	Install access door, access located on top of duct
66	2024-09-05	County Examiner Bldg.	2nd floor mech room	James Futrell	FD-66	Vertical Fire Damper	20/12	Unknown	Unknown	165 Degrees	8/8	Pass	Install access door, located on top of duct
67	2024-09-05	County Examiner Bldg.	2nd floor mech room	James Futrell	FD-67	Vertical Fire Damper	20/12	Unknown	Unknown	165 Degrees	8/8	Pass	None
68	2024-09-05	County Examiner Bldg.	2nd floor mech room	James Futrell	FD-68	Vertical Fire Damper	20/12	Unknown	Unknown	165 Degrees	8/8	Pass	None
69	2024-09-05	County Examiner Bldg.	2nd floor mech room	James Futrell	FD-69	Vertical Fire Damper	8inch round	Unknown	Unknown	165 Degrees	Remove flex	Pass	None
70	2024-09-05	County Examiner Bldg.	2nd floor hallway by electrical room B	James Futrell	FD-70	Vertical Fire / Smoke Damper	18inch round	Ruskin	FSD60	165 Degrees	12/10	Pass	None
71	2024-09-05	County Examiner Bldg.	2nd floor electric rm B	James Futrell	FD-71	Vertical Fire / Smoke Damper	10/6	Ruskin	Unknown 10/6	165 Degrees	Remove grille for access	Pass	None
72	2024-09-05	County Examiner Bldg.	2nd floor hard lid by RM 202	James Futrell	FD-72	Vertical Fire Damper	28/14	Unknown	Unknown	165 Degrees	14/14	Pass	Install access door
73	2024-09-05	County Examiner Bldg.	2nd floor men's bathroom	James Futrell	FD-73	Vertical Fire Damper	8/10	Unknown	Unknown	165 Degrees	8/6	Fail	No annular space,no retaining frame
74	2024-09-05	County Examiner Bldg.	2nd floor hallway	James Futrell	FD-74	Vertical Fire Damper	24/12	Unknown	Unknown	165 Degrees	18/12	Pass	None
75	2024-09-05	County Examiner Bldg.	2nd floor hallway	James Futrell	FD-75	Vertical Fire Damper	14/6	Unknown	Unknown	165 Degrees	8/8	Pass	Install access door
76	2024-09-06	County Examiner Bldg.	2nd floor hallway	James Futrell	FD-76	Vertical Fire Damper	14/6	Unknown	Unknown	165 Degrees	12/12	Fail	Seal tight in annular space, retaining angle missing
77	2024-09-06	County Examiner Bldg.	2nd floor women bathroom	James Futrell	FD-77	Vertical Fire Damper	10/8	Unknown	Unknown	165 Degrees	6/8	Fail	No annular space , no retaining frame
78	2024-09-06	County Examiner Bldg.	3rd floor evidence	James Futrell	FD-78	Vertical Fire Damper	40/16	Ruskin	Unknown	165 Degrees	16/16	Pass	None

79	2024-09-06	County Examiner Bldg.	3rd floor evidence	James Futrell	FSD-79	Vertical Fire / Smoke Damper	48/16	Ruskin	Unknown	165 Degrees	16/16	Fail	No retaining frame
80	2024-09-06	County Examiner Bldg.	3rd floor evidence drying room	James Futrell	FD-80	Vertical Fire Damper	48/18	Unknown	Unknown	165 Degrees	16/16	Pass	None
81	2024-09-06	County Examiner Bldg.	3rd floor evidence lobby	James Futrell	FD-82	Vertical Fire Damper	22/12	Ruskin	Unknown	165 Degrees	12/12	Pass	None
82	2024-09-06	County Examiner Bldg.	3rd floor evidence lobby	James Futrell	FSD-81	Vertical Fire / Smoke Damper	96/20	Unknown	Unknown	165 Degrees	16/16	Pass	None
83	2024-09-06	County Examiner Bldg.	3rd floor chemistry hallway	James Futrell	FD-83	Vertical Fire Damper	48/18	Ruskin	Unknown	165 Degrees	Open	Pass	None
84	2024-09-06	County Examiner Bldg.	1st floor room 123	James Futrell	FD-84	Vertical Fire Damper	12inch round	Ruskin	Unknown	212 Degrees	12/8	Pass	Install access door
86	2024-09-06	County Examiner Bldg.	1st floor women bathroom	James Futrell	FD-85	Vertical Fire Damper	36/12	Unknown	Unknown	165 Degrees	12/12	Fail	No sleeve, no retaining frame
87	2024-09-12	County Examiner Bldg.	1st floor women bathroom	James Futrell	FD-86	Vertical Fire Damper	36/12	Unknown	Unknown	165 Degrees	12/12	Fail	No annular space, no retaining frame, no sleeve
88	2024-09-12	County Examiner Bldg.	1st floor women bathroom	James Futrell	FD-87	Vertical Fire Damper	10/6	Unknown	Unknown	165 Degrees	6/6	Pass	None
89	2024-09-12	County Examiner Bldg.	1st floor conference room hallway	James Futrell	FD-88	Vertical Fire Damper	46/10	Unknown	Unknown	165 Degrees	16/16	Pass	None
90	2024-09-12	County Examiner Bldg.	1st floor men's bathroom	James Futrell	FD-89	Vertical Fire Damper	10/6	Unknown	Unknown	165 Degrees	8/8	Pass	None
91	2024-09-12	County Examiner Bldg.	2nd fl 202 info services	James Futrell	FD-90	Vertical Fire Damper	15 inch round	Unknown	Unknown	165 Degrees	10/6	Pass	None
92	2024-09-12	County Examiner Bldg.	2nd fl info services 202	James Futrell	FD-91	Vertical Fire Damper	12 inch round	Unknown	Unknown	165 Degrees	Open	Abandoned	Found closed left as is, marked as abandoned
93	2024-09-12	County Examiner Bldg.	2nd fl data center build room	James Futrell	FD-92	Vertical Fire Damper	70/16	Unknown	Unknown	165 Degrees	12/12	Pass	Duct has two curtains in it
94	2024-09-12	County Examiner Bldg.	2nd fl data center build room	James Futrell	FD-93	Vertical Fire Damper	96/18	Unknown	Unknown	165 Degrees	40/18	Pass	Remove abandoned volume damper, install access door , damper is two separate curtains
95	2024-09-12	County Examiner Bldg.	2nd fl 201M	James Futrell	FD-94	Vertical Fire Damper	20/10	Unknown	Unknown	165 Degrees	12/12	Pass	None
96	2024-09-13	County Examiner Bldg.	Ground floor women bathroom	James Futrell	FD-95	Vertical Fire Damper	12/10	Unknown	Unknown	165 Degrees	8/8	Fail	No annular space, no retaining frame, no sleeve

97	2024-09-13	County Examiner Bldg.	Ground floor women bathroom	James Futrell	FD-96	Vertical Fire Damper	10/8	Unknown	Unknown	165 Degrees	8/8	Fail	No annular space, no retaining frame, no sleeve
98	2024-09-13	County Examiner Bldg.	Ground floor women bathroom	James Futrell	FD-97	Vertical Fire Damper	12/10	Unknown	Unknown	165 Degrees	8/8	Fail	No annular space, no retaining frame, no sleeve
99	2024-09-13	County Examiner Bldg.	Ground floor room 022	James Futrell	FD-98	Vertical Fire Damper	24/5	Unknown	Unknown	165 Degrees	10/10	Pass	None
100	2024-09-13	County Examiner Bldg.	Ground floor mech room 025	James Futrell	FD-99	Vertical Fire Damper	76/42	Unknown	Unknown	165 Degrees	16/16	Pass	Damper is two separate curtains
101	2024-09-13	County Examiner Bldg.	Vehicle bay	James Futrell	FD-100	Vertical Fire Damper	48/24	Unknown	Unknown	165 Degrees	Open	Pass	None
102	2024-09-13	County Examiner Bldg.	Vehicle bay	James Futrell	FD-101	Vertical Fire Damper	30/20	Unknown	Unknown	165 Degrees	14/14	Pass	None
103	2024-09-13	County Examiner Bldg.	Vehicle bay	James Futrell	FD-102	Vertical Fire Damper	32/20	Unknown	Unknown	165 Degrees	12/12	Pass	None
104	2024-09-13	County Examiner Bldg.	Vehicle bay	James Futrell	FD-103	Vertical Fire Damper	14/12	Unknown	Unknown	165 Degrees	12/12	Pass	None

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-26

Facility Location

County Examiner Bldg.

Damper Location

Men's bathroom 6FL

Inspector Name

James Futrell

Damper I.D. #

FD-1

Damper Type

Vertical Fire Damper

Damper Size

8"/10"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8"/6"

Pass / Fail / Abandoned

Fail

Comments / Corrections

No sleeve/No retaining angle

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-26

Facility Location

County Examiner Bldg.

Damper Location

Mech Rm 606

Inspector Name

James Futrell

Damper I.D. #

FD-2

Damper Type

Horizontal Fire Damper

Damper Size

6"/10"

Damper Manufacturer

Unknown

Damper Model #

unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6"/6"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

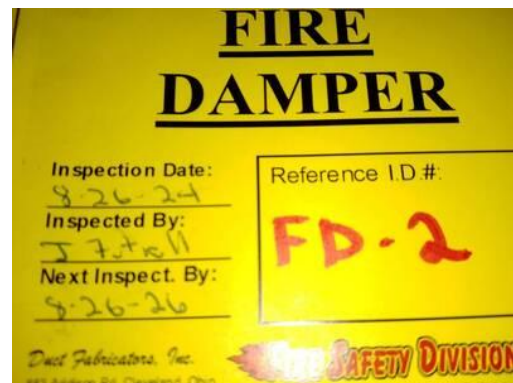

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-26

Facility Location

County Examiner Bldg.

Damper Location

Mech Rm 606 6FL

Inspector Name

James Futrell

Damper I.D. #

FD-3

Damper Type

Horizontal Fire Damper

Damper Size

6"/10"

Damper Manufacturer

Unknown

Damper Model #

unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6"/6"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

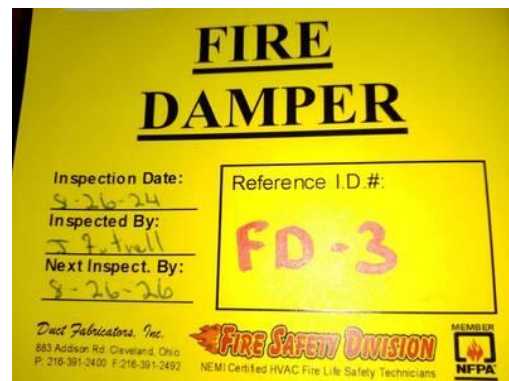

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-26

Facility Location

County Examiner Bldg.

Damper Location

Women's Bathroom 6 FL

Inspector Name

James Futrell

Damper I.D. #

FD-4

Damper Type

Vertical Fire Damper

Damper Size

10"/8"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8"/6"

Pass / Fail / Abandoned

Fail

Comments / Corrections

No sleeve/No retaining angle

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-26

Facility Location

County Examiner Bldg.

Damper Location

Mech RM 605

Inspector Name

James Futrell

Damper I.D. #

FD-5

Damper Type

Vertical Fire Damper

Damper Size

12"/10"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"/10" Grille

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

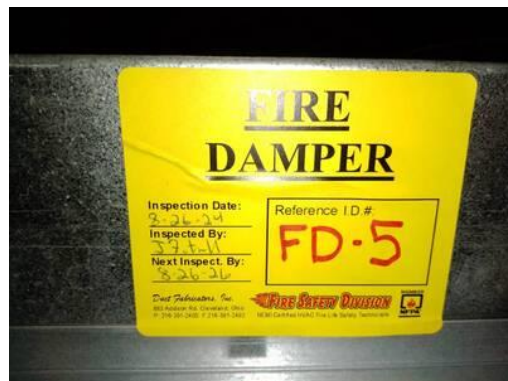

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-26

Facility Location

County Examiner Bldg.

Damper Location

Mech RM 5Th Floor

Inspector Name

James Futrell

Damper I.D. #

FD-6

Damper Type

Vertical Fire Damper

Damper Size

40"/9"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6"/6"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-26

Facility Location

County Examiner Bldg.

Damper Location

Mech Rm 606

Inspector Name

James Futrell

Damper I.D. #

FD-7

Damper Type

Horizontal Fire Damper

Damper Size

36"/14"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8"/8" (2)

Pass / Fail / Abandoned

Pass

Comments / Corrections

2 Dampers inside duct

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-26

Facility Location

County Examiner Bldg.

Damper Location

Mech RM 5TH FL

Inspector Name

James Futrell

Damper I.D. #

FD-8

Damper Type

Vertical Fire Damper

Damper Size

14"/14"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6"/6"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

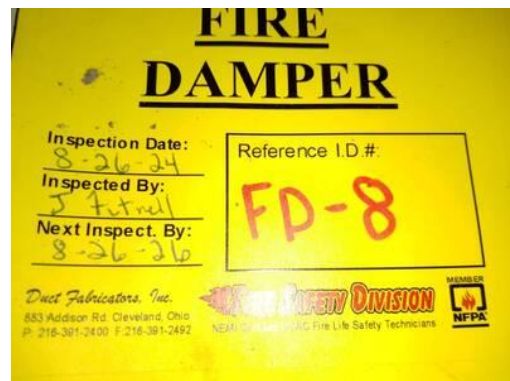

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-26

Facility Location

County Examiner Bldg.

Damper Location

Mech RM 5TH. FL

Inspector Name

James Futrell

Damper I.D. #

FD-9

Damper Type

Vertical Fire Damper

Damper Size

36"/12"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8"/8"

Pass / Fail / Abandoned

Fail

Comments / Corrections

Damper is inaccessible/open air between
Dampers 9/10

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-26

Facility Location

County Examiner Bldg.

Damper Location

Mech RM 5TH FL

Inspector Name

James Futrell

Damper I.D. #

FD-10

Damper Type

Vertical Fire Damper

Damper Size

30"/10"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8"/8"

Pass / Fail / Abandoned

Fail

Comments / Corrections

Damper is inaccessible/open air between
FD-10/9

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-27

Facility Location

County Examiner Bldg.

Damper Location

Mech RM 5Th FL Door

Inspector Name

James Futrell

Damper I.D. #

FD-11

Damper Type

Vertical Fire Damper

Damper Size

48"/12"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8"/8"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-27

Facility Location

County Examiner Bldg.

Damper Location

Hallway 5TH. FL

Inspector Name

James Futrell

Damper I.D. #

FD-12

Damper Type

Vertical Fire Damper

Damper Size

10"/6"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6"/6"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

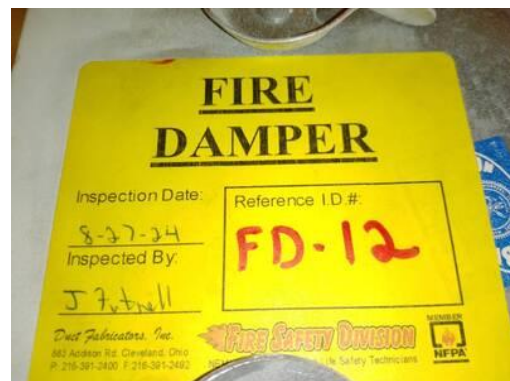

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-27

Facility Location

County Examiner Bldg.

Damper Location

Hallway 5TH. FL

Inspector Name

James Futrell

Damper I.D. #

FD-13

Damper Type

Vertical Fire Damper

Damper Size

10"/6"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6"/6"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

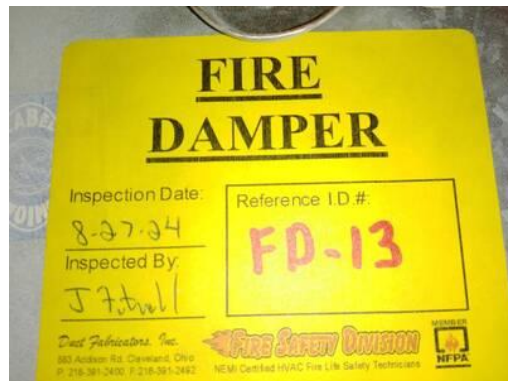

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-27

Facility Location

County Examiner Bldg.

Damper Location

Hallway 5TH. FL

Inspector Name

James Futrell

Damper I.D. #

FD-14

Damper Type

Vertical Fire Damper

Damper Size

40"/7"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6"/6"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-27

Facility Location

County Examiner Bldg.

Damper Location

Men's Restroom 5Th FL

Inspector Name

James Futrell

Damper I.D. #

FD-15

Damper Type

Vertical Fire Damper

Damper Size

10"/8"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8"/6"

Pass / Fail / Abandoned

Fail

Comments / Corrections

No sleeve or retaining angles

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-27

Facility Location

County Examiner Bldg.

Damper Location

RM 502

Inspector Name

James Futrell

Damper I.D. #

FD-16

Damper Type

Vertical Fire Damper

Damper Size

6"/6"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

5"/5"

Pass / Fail / Abandoned

Fail

Comments / Corrections

No sleeve/Curtain not in wall/No retaining angles


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

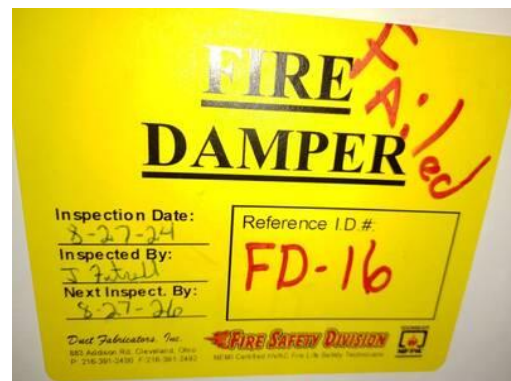

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-27

Facility Location

County Examiner Bldg.

Damper Location

RM 504 Mech RM

Inspector Name

James Futrell

Damper I.D. #

FD-17

Damper Type

Vertical Fire Damper

Damper Size

8" Round

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10"/6"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

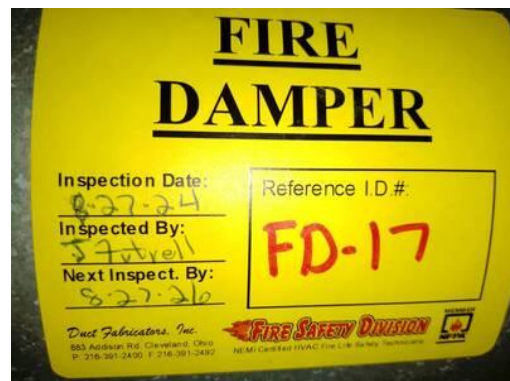

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection
2024-08-27

Facility Location
County Examiner Bldg.

Damper Location
Door 505

Inspector Name
James Futrell

Damper I.D. #
FD-18

Damper Type
Vertical Fire Damper

Damper Size
12"/6"

Damper Manufacturer
Unknown

Damper Model #
Unknown

Fusible Link Temperature
165 Degrees

Access Door Size
Grill

Pass / Fail / Abandoned
Pass

Comments / Corrections
None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

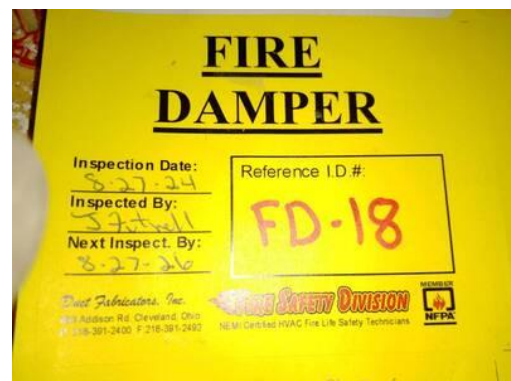

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-27

Facility Location

County Examiner Bldg.

Damper Location

Rm-404. Mech Rm

Inspector Name

James Futrell

Damper I.D. #

FD-19

Damper Type

Vertical Fire Damper

Damper Size

28"/18"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"/12"


Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position

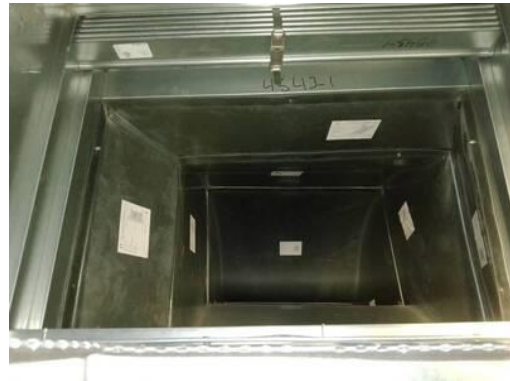

Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-27

Facility Location

County Examiner Bldg.

Damper Location

RM 405 Mech Rm

Inspector Name

James Futrell

Damper I.D. #

FD-20

Damper Type

Vertical Fire Damper

Damper Size

28"/18"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"/12"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

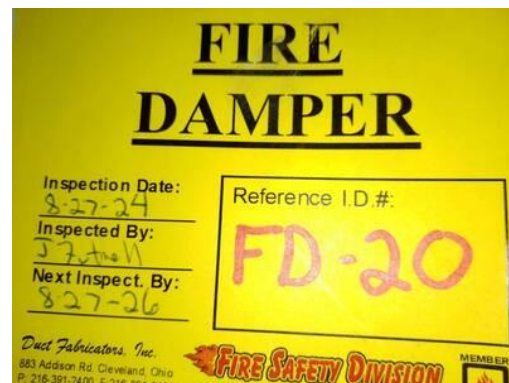

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-27

Facility Location

County Examiner Bldg.

Damper Location

RM-405 Mech. Rm

Inspector Name

James Futrell

Damper I.D. #

FD-21

Damper Type

Vertical Fire Damper

Damper Size

20"/10"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10"/10"

Pass / Fail / Abandoned

Pass

Comments / Corrections

Cut in access door

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-27

Facility Location

County Examiner Bldg.

Damper Location

RM -405 Mech Rm

Inspector Name

James Futrell

Damper I.D. #

FD-22

Damper Type

Vertical Fire Damper

Damper Size

10"/6"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10"/10"

Pass / Fail / Abandoned

Pass

Comments / Corrections

Cut in access door

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-28

Facility Location

County Examiner Bldg.

Damper Location

Men's Bathroom

Inspector Name

James Futrell

Damper I.D.

FD-23

Damper Type

Vertical Fire Damper

Damper Size

8"/10"

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8"/6"

Pass / Fail / Abandoned

Fail

Comments / Corrections

No damper sleeve/No retaining angle/
Cement filled annular space

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-28

Facility Location

County Examiner Bldg.

Damper Location

Mech RM-404 behind Men's bathroom

Inspector Name

James Futrell

Damper I.D. #

FD-24

Damper Type

Vertical Fire Damper

Damper Size

10"/6"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10"/10"

Pass / Fail / Abandoned

Pass

Comments / Corrections

Installed access door


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

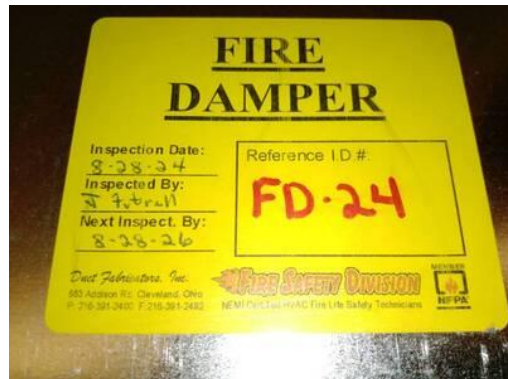

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

Mech RM 406

Inspector Name

James Futrell

Damper I.D.

FD-25

Damper Type

Vertical Fire Damper

Damper Size

40/14

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

Installed access door


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

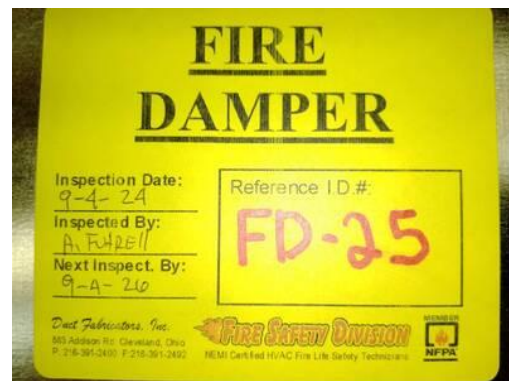

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-28

Facility Location

County Examiner Bldg.

Damper Location

Mech RM 406

Inspector Name

James Futrell

Damper I.D. #

FD-26

Damper Type

Vertical Fire Damper

Damper Size

10/8

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/10

Pass / Fail / Abandoned

Pass

Comments / Corrections

Install access door

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-28

Facility Location

County Examiner Bldg.

Damper Location

Closet 402

Inspector Name

James Futrell

Damper I.D. #

FD-27

Damper Type

Vertical Fire Damper

Damper Size

28/18

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-28

Facility Location

County Examiner Bldg.

Damper Location

4th floor Women's Bathroom

Inspector Name

James Futrell

Damper I.D. #

FD-28

Damper Type

Vertical Fire Damper

Damper Size

10/8

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/8

Pass / Fail / Abandoned

Pass

Comments / Corrections

Installed access door


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

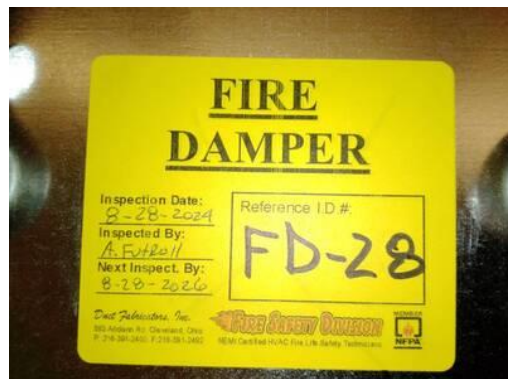

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-28

Facility Location

County Examiner Bldg.

Damper Location

4th floor Women's Bathroom

Inspector Name

James Futrell

Damper I.D. #

FD-29

Damper Type

Vertical Fire Damper

Damper Size

72/24

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

18/18

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

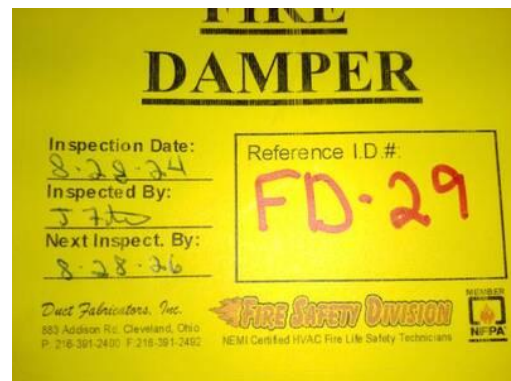

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-28

Facility Location

County Examiner Bldg.

Damper Location

Mech RM 404

Inspector Name

James Futrell

Damper I.D. #

FD-30

Damper Type

Vertical Fire Damper

Damper Size

6-inch round

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/6


Pass / Fail / Abandoned

Pass

Comments / Corrections

Installed access door


Picture of Damper in Open Position

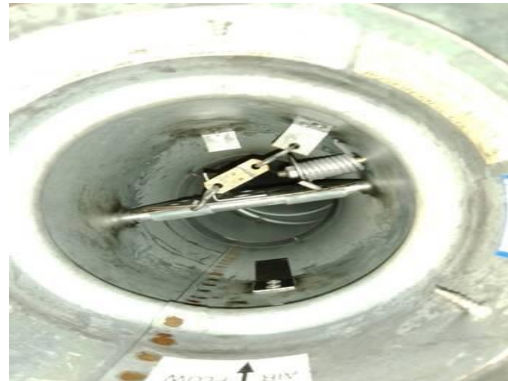

Picture of Damper in Closed Position



Picture of Damper I.D. Label

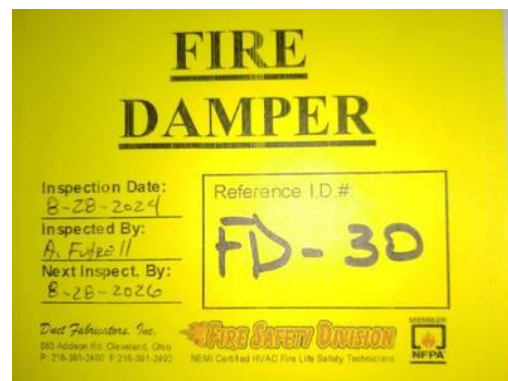

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

4th floor hallway

Inspector Name

James Futrell

Damper I.D.

FD-31

Damper Type

Vertical Fire Damper

Damper Size

96/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

Remove abandoned balancing damper to access to fire damper


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

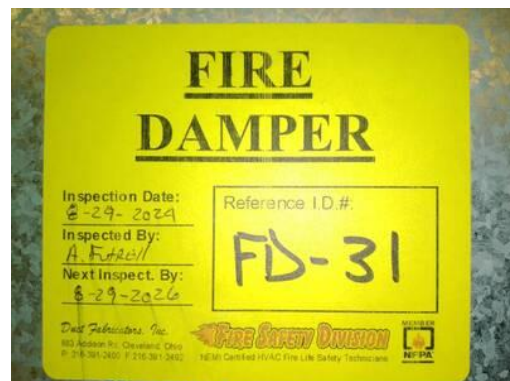

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor mech room

Inspector Name

James Futrell

Damper I.D. #

FD-32

Damper Type

Vertical Fire Damper

Damper Size

28/18

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Pass


Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position

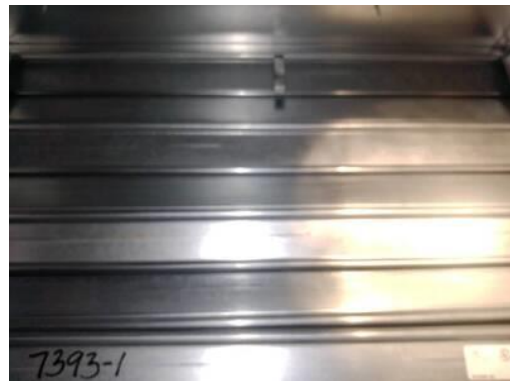

Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor mech room

Inspector Name

James Futrell

Damper I.D. #

FD-33

Damper Type

Vertical Fire Damper

Damper Size

22/12

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/10

Pass / Fail / Abandoned

Pass

Comments / Corrections

Installed access door


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

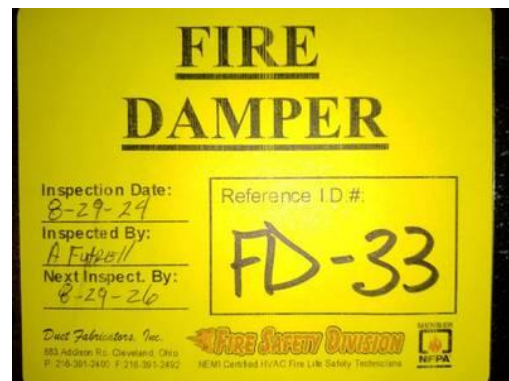

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection
2024-08-29

Facility Location
County Examiner Bldg.

Damper Location
3rd floor mech room

Inspector Name
James Futrell

Damper I.D. #
FD-34

Damper Type
Vertical Fire Damper

Damper Size
6-inch round

Damper Manufacturer
Unknown

Damper Model #
Unknown

Fusible Link Temperature
165 Degrees

Access Door Size
10/6

Pass / Fail / Abandoned
Pass

Comments / Corrections
Installed access door & link. Damper was found in closed position

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

FIRE DAMPER	
Inspection Date: 8-29-2024	Reference I.D. #: FD-34
Inspected By: A. Futrell	
Next Inspect. By: 8-29-2026	
Duct Fabricators, Inc. FIRE SAFETY DIVISION MEMBER NFPA 883 Addison Rd. Cleveland, Ohio NEMI Certified HVAC Fire Life Safety Technicians	

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor men's bathroom

Inspector Name

James Futrell

Damper I.D. #

FD-35

Damper Type

Vertical Fire Damper

Damper Size

54/16

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

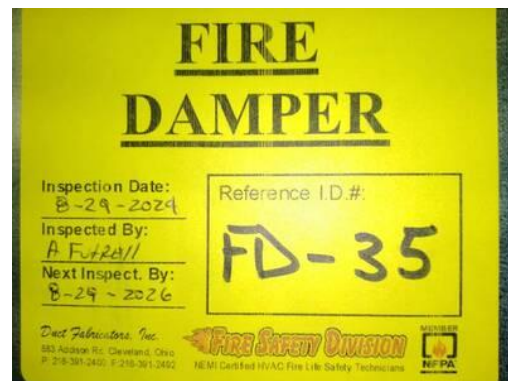

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor men's room, mech room

Inspector Name

James Futrell

Damper I.D. #

FD-36

Damper Type

Vertical Fire Damper

Damper Size

34/18

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

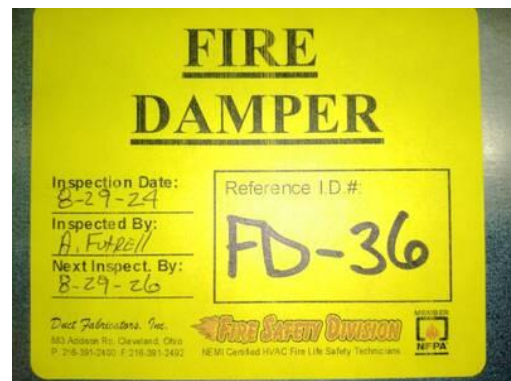

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor men's room, mech room

Inspector Name

James Futrell

Damper I.D. #

FD-37

Damper Type

Vertical Fire Damper

Damper Size

34/18

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

14/14

Pass / Fail / Abandoned

Pass

Comments / Corrections

Repaired retaining angle, installed access door

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor hallway

Inspector Name

James Futrell

Damper I.D. #

FD-38

Damper Type

Vertical Fire Damper

Damper Size

48/16

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/10

Pass / Fail / Abandoned

Pass

Comments / Corrections

Installed access door


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

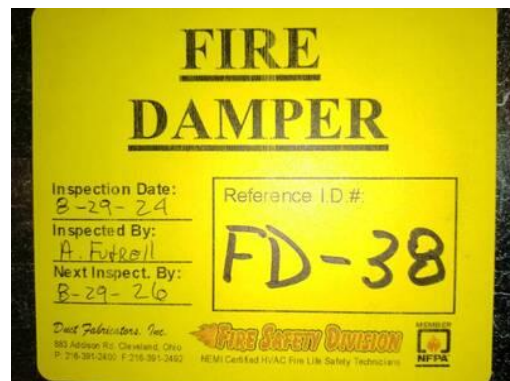

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor hallway

Inspector Name

James Futrell

Damper I.D. #

FD-39

Damper Type

Vertical Fire Damper

Damper Size

38/14

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle on both sides of wall

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor hallway

Inspector Name

James Futrell

Damper I.D. #

FD-40

Damper Type

Vertical Fire Damper

Damper Size

36/14

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

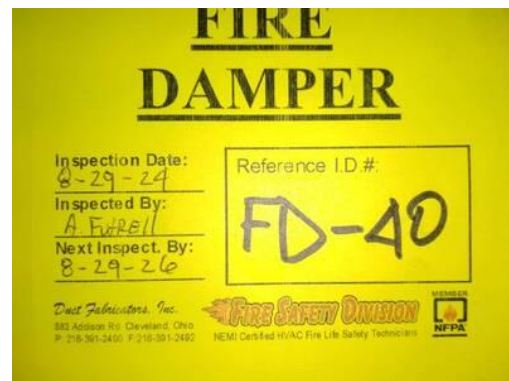

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor hallway

Inspector Name

James Futrell

Damper I.D. #

FD-41

Damper Type

Vertical Fire Damper

Damper Size

36/14

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor hallway

Inspector Name

James Futrell

Damper I.D. #

FD-42

Damper Type

Vertical Fire Damper

Damper Size

20/14

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

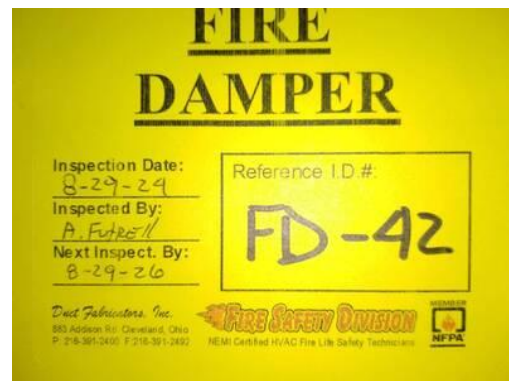

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor hallway by women bathroom

Inspector Name

James Futrell

Damper I.D.

FD-43

Damper Type

Vertical Fire Damper

Damper Size

24/14

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Fail


Comments / Corrections

No retaining angle, conduit in annular space

Picture of Damper in Open Position



Picture of Damper in Closed Position

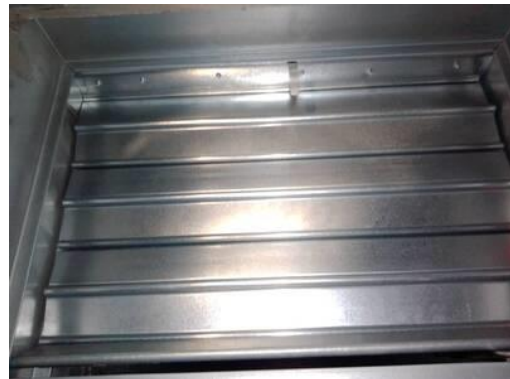

Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor hallway by women bathroom

Inspector Name

James Futrell

Damper I.D.

FD-44

Damper Type

Vertical Fire / Smoke Damper

Damper Size

94/19

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-29

Facility Location

County Examiner Bldg.

Damper Location

3rd floor by evidence

Inspector Name

James Futrell

Damper I.D. #

FD-45

Damper Type

Vertical Fire Damper

Damper Size

48/18

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

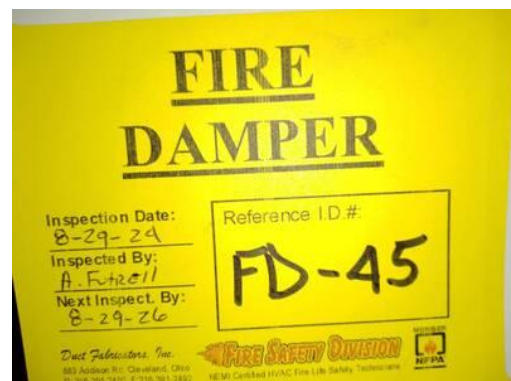

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

Mech Room 605

Inspector Name

James Futrell

Damper I.D.

FD-46

Damper Type

Horizontal Fire Damper

Damper Size

66/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

24/24

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

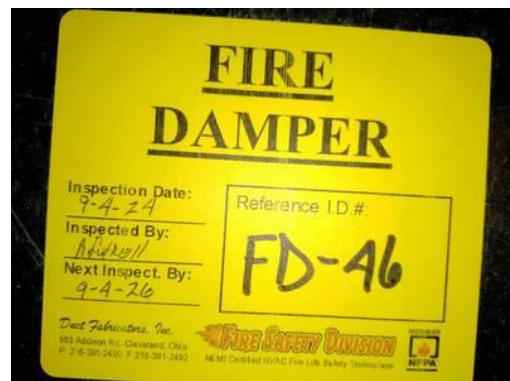

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

Mech RM 605

Inspector Name

James Futrell

Damper I.D.

FD-47

Damper Type

Horizontal Fire Damper

Damper Size

66/24

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

24/24

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

4th floor hallway

Inspector Name

James Futrell

Damper I.D.

FD-48

Damper Type

Vertical Fire Damper

Damper Size

70/16

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

18/18

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

4th floor hallway

Inspector Name

James Futrell

Damper I.D.

FD-49

Damper Type

Vertical Fire Damper

Damper Size

60/30

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

18/18

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

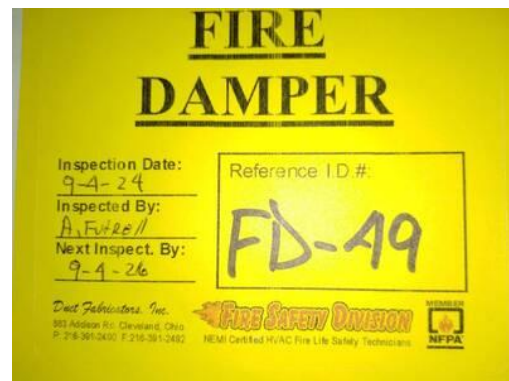

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor suite 308

Inspector Name

James Futrell

Damper I.D. #

FD-50

Damper Type

Vertical Fire Damper

Damper Size

16/8

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

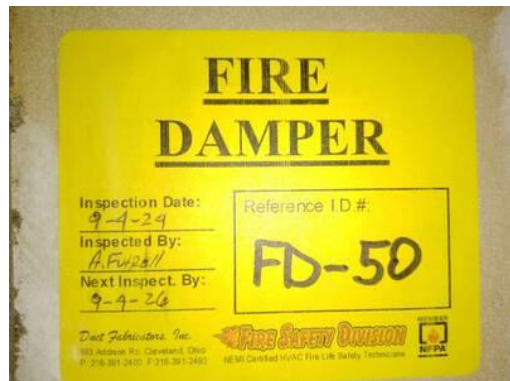

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor suite 308

Inspector Name

James Futrell

Damper I.D.

FD-51

Damper Type

Vertical Fire Damper

Damper Size

40/18

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

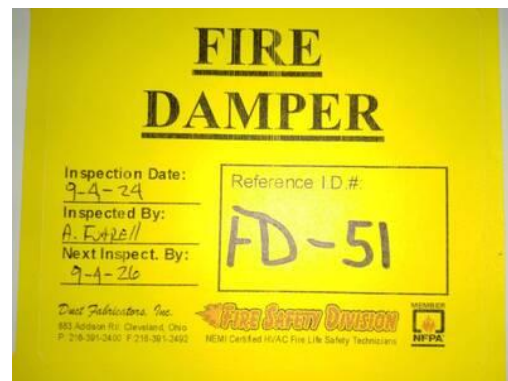

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor suite 308

Inspector Name

James Futrell

Damper I.D.

FD-52

Damper Type

Vertical Fire Damper

Damper Size

28/14

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

Install access door


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

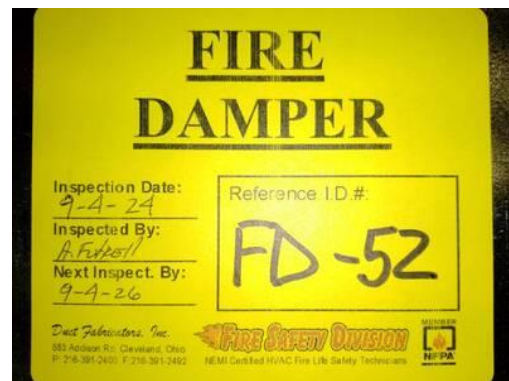

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor server room

Inspector Name

James Futrell

Damper I.D.

FD-53

Damper Type

Vertical Fire Damper

Damper Size

8-inch round

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6/10

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor Fire Arms Ref Room

Inspector Name

James Futrell

Damper I.D.

FD-54

Damper Type

Vertical Fire Damper

Damper Size

36/16

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor Fire Arms Ref Room

Inspector Name

James Futrell

Damper I.D.

FD-55

Damper Type

Vertical Fire Damper

Damper Size

48/16

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor Fire Arms Ref Room

Inspector Name

James Futrell

Damper I.D.

FD-56

Damper Type

Vertical Fire Damper

Damper Size

14/10

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u>	
<u>DAMPER</u>	
Inspection Date: 9-4-24	Reference I.D.#:
Inspected By: J. Futrell	FD-56
Next Inspect. By: 9-4-26	

Duct Fabricators, Inc.
883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER
NFPA

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor Fire Arms Ref Room

Inspector Name

James Futrell

Damper I.D.

FD-57

Damper Type

Vertical Fire Damper

Damper Size

24/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass


Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position

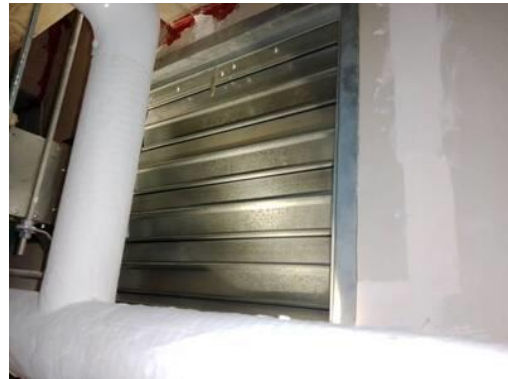

Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F:216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor Fire Arms Ref Room

Inspector Name

James Futrell

Damper I.D.

FD-58

Damper Type

Vertical Fire Damper

Damper Size

8 inch round

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6/10


Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position

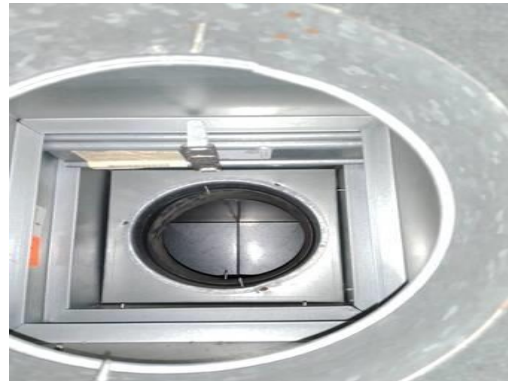

Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor Rm325

Inspector Name

James Futrell

Damper I.D.

FD-59

Damper Type

Vertical Fire Damper

Damper Size

24/14

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor Finger print back hallway

Inspector Name

James Futrell

Damper I.D.

FD-60

Damper Type

Vertical Fire Damper

Damper Size

6 inch round

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Inaccessible

Pass / Fail / Abandoned

Fail

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

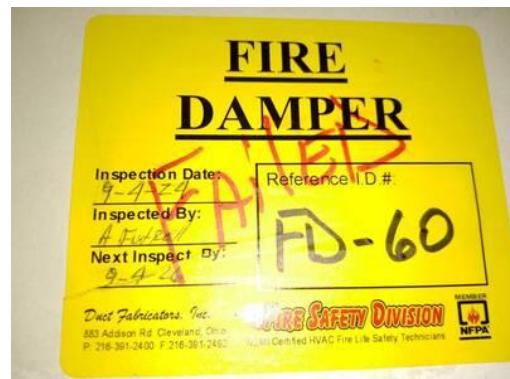

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor by Morgue elevator

Inspector Name

James Futrell

Damper I.D.

FD-61

Damper Type

Vertical Fire Damper

Damper Size

48/16

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-04

Facility Location

County Examiner Bldg.

Damper Location

3rd floor by Morgue elevator

Inspector Name

James Futrell

Damper I.D. #

FD-62

Damper Type

Vertical Fire Damper

Damper Size

6 inch round

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

5/8

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor mech room

Inspector Name

James Futrell

Damper I.D.

FD-63

Damper Type

Vertical Fire Damper

Damper Size

66/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

18/18

Pass / Fail / Abandoned

Pass

Comments / Corrections

Install access door, damper is two separate curtains


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

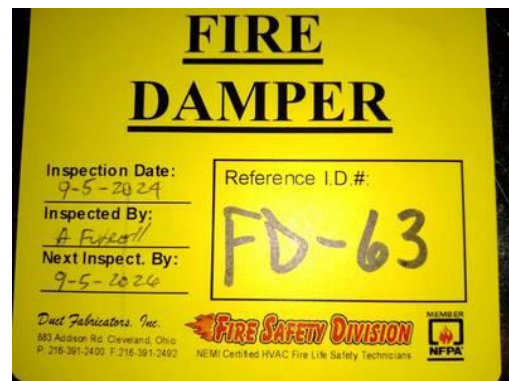

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor mech room

Inspector Name

James Futrell

Damper I.D.

FD-64

Damper Type

Vertical Fire Damper

Damper Size

66/32

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

20/20

Pass / Fail / Abandoned

Pass

Comments / Corrections

Install access door, damper is two separate curtains

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u> <u>DAMPER</u>	
Inspection Date: 9-5-24	Reference I.D. #: FD-64
Inspected By: A. FUTRELL	
Next Inspect. By: 9-5-26	
<small>Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492</small>	
<u>FIRE SAFETY DIVISION</u> <small>MEMBER NFPA</small>	
<small>NEMI Certified HVAC Fire Life Safety Technicians</small>	

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor mech room

Inspector Name

James Futrell

Damper I.D.

FD-65

Damper Type

Vertical Fire Damper

Damper Size

20/12

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

14/14

Pass / Fail / Abandoned

Pass

Comments / Corrections

Install access door, access located on top of duct

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u> <u>DAMPER</u>	
Inspection Date: 9-5-2024	Reference I.D. #: FD-65
Inspected By: A Futrell	
Next Inspect. By: 9-5-2026	
Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492	
<u>FIRE SAFETY DIVISION</u> NEMI Certified HVAC Fire Life Safety Technicians	
MEMBER NFPA	

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor mech room

Inspector Name

James Futrell

Damper I.D.

FD-66

Damper Type

Vertical Fire Damper

Damper Size

20/12

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/8

Pass / Fail / Abandoned

Pass

Comments / Corrections

Install access door, located on top of duct


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

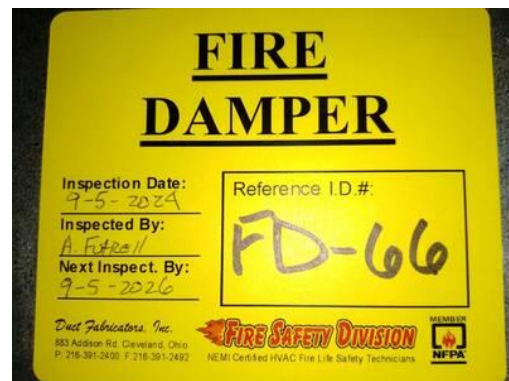

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor mech room

Inspector Name

James Futrell

Damper I.D.

FD-67

Damper Type

Vertical Fire Damper

Damper Size

20/12

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/8

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor mech room

Inspector Name

James Futrell

Damper I.D.

FD-68

Damper Type

Vertical Fire Damper

Damper Size

20/12

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/8

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor mech room

Inspector Name

James Futrell

Damper I.D.

FD-69

Damper Type

Vertical Fire Damper

Damper Size

8inch round

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Remove flex

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor hallway by electrical room B

Inspector Name

James Futrell

Damper I.D.

FD-70

Damper Type

Vertical Fire / Smoke Damper

Damper Size

18inch round

Damper Manufacturer

Ruskin

Damper Model

FSD60

Fusible Link Temperature

165 Degrees

Access Door Size

12/10

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor electric rm B

Inspector Name

James Futrell

Damper I.D.

FD-71

Damper Type

Vertical Fire / Smoke Damper

Damper Size

10/6

Damper Manufacturer

Ruskin

Damper Model

Unknown 10/6

Fusible Link Temperature

165 Degrees

Access Door Size

Remove grille for access

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

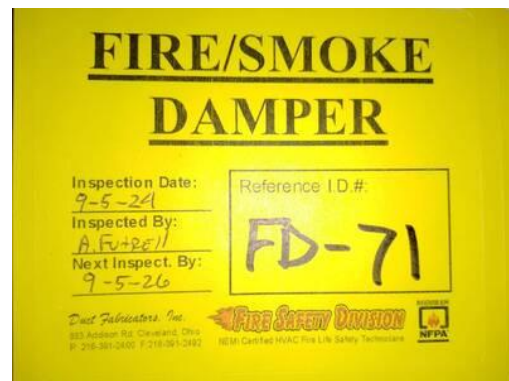

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor hard lid by RM 202

Inspector Name

James Futrell

Damper I.D.

FD-72

Damper Type

Vertical Fire Damper

Damper Size

28/14

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

14/14

Pass / Fail / Abandoned

Pass

Comments / Corrections

Install access door


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

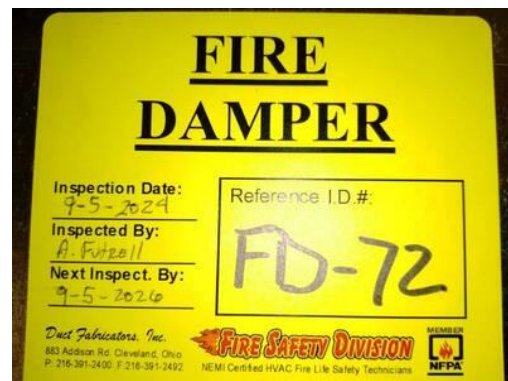

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor men's bathroom

Inspector Name

James Futrell

Damper I.D.

FD-73

Damper Type

Vertical Fire Damper

Damper Size

8/10

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/6

Pass / Fail / Abandoned

Fail

Comments / Corrections

No annular space, no retaining frame


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

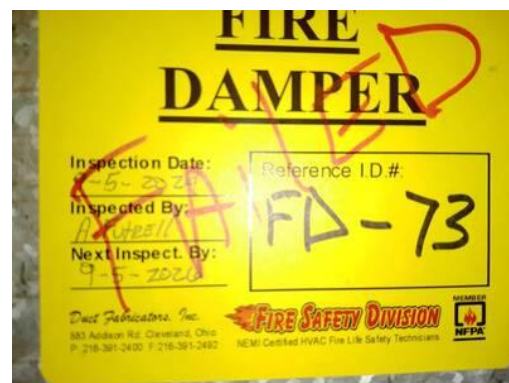

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor hallway

Inspector Name

James Futrell

Damper I.D.

FD-74

Damper Type

Vertical Fire Damper

Damper Size

24/12

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

18/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

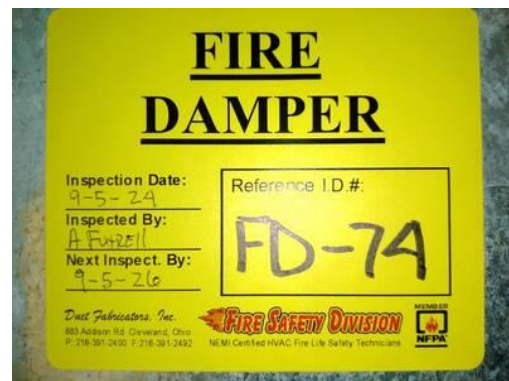

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-05

Facility Location

County Examiner Bldg.

Damper Location

2nd floor hallway

Inspector Name

James Futrell

Damper I.D.

FD-75

Damper Type

Vertical Fire Damper

Damper Size

14/6

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/8

Pass / Fail / Abandoned

Pass

Comments / Corrections

Install access door

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u>	
<u>DAMPER</u>	
Inspection Date: 9-5-24	Reference I.D.#:
Inspected By: A. Futrell	FD-75
Next Inspect. By: 9-5-26	

Duct Fabricators, Inc.
883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER
NFPA

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-06

Facility Location

County Examiner Bldg.

Damper Location

2nd floor hallway

Inspector Name

James Futrell

Damper I.D.

FD-76

Damper Type

Vertical Fire Damper

Damper Size

14/6

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Fail

Comments / Corrections

Seal tight in annular space, retaining angle missing


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

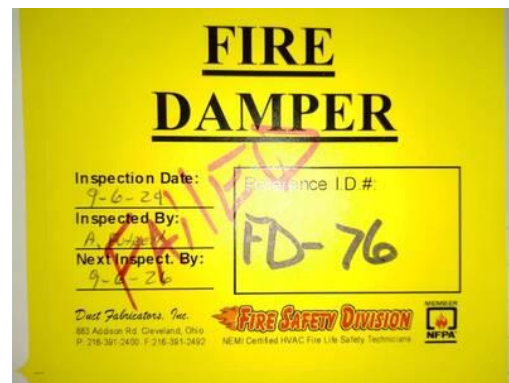

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-06

Facility Location

County Examiner Bldg.

Damper Location

2nd floor women bathroom

Inspector Name

James Futrell

Damper I.D.

FD-77

Damper Type

Vertical Fire Damper

Damper Size

10/8

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6/8

Pass / Fail / Abandoned

Fail

Comments / Corrections

No annular space, no retaining frame

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-06

Facility Location

County Examiner Bldg.

Damper Location

3rd floor evidence

Inspector Name

James Futrell

Damper I.D.

FD-78

Damper Type

Vertical Fire Damper

Damper Size

40/16

Damper Manufacturer

Ruskin

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

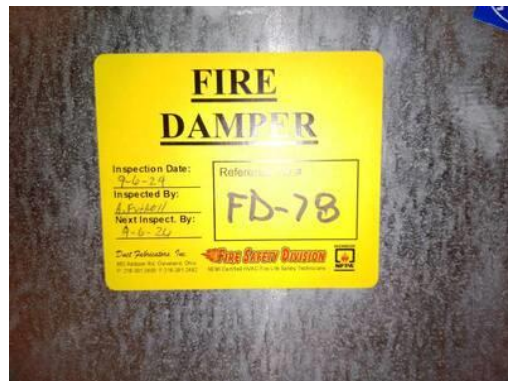

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-06

Facility Location

County Examiner Bldg.

Damper Location

3rd floor evidence

Inspector Name

James Futrell

Damper I.D.

FSD-79

Damper Type

Vertical Fire / Smoke Damper

Damper Size

48/16

Damper Manufacturer

Ruskin

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Fail

Comments / Corrections

No retaining frame


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

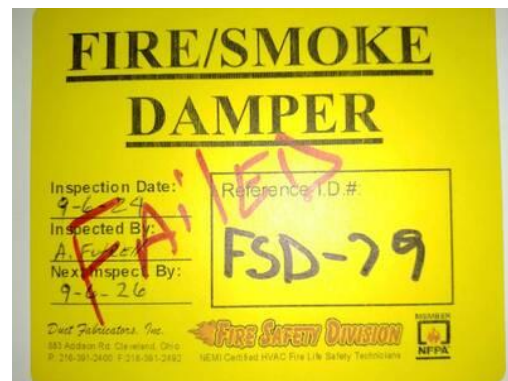

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-06

Facility Location

County Examiner Bldg.

Damper Location

3rd floor evidence drying room

Inspector Name

James Futrell

Damper I.D.

FD-80

Damper Type

Vertical Fire Damper

Damper Size

48/18

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

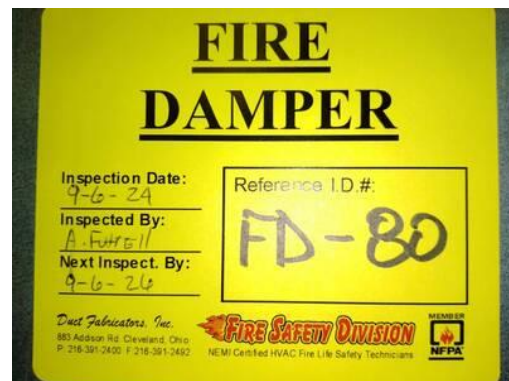

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-06

Facility Location

County Examiner Bldg.

Damper Location

3rd floor evidence lobby

Inspector Name

James Futrell

Damper I.D.

FSD-81

Damper Type

Vertical Fire / Smoke Damper

Damper Size

96/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-06

Facility Location

County Examiner Bldg.

Damper Location

3rd floor evidence lobby

Inspector Name

James Futrell

Damper I.D.

FD-82

Damper Type

Vertical Fire Damper

Damper Size

22/12

Damper Manufacturer

Ruskin

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

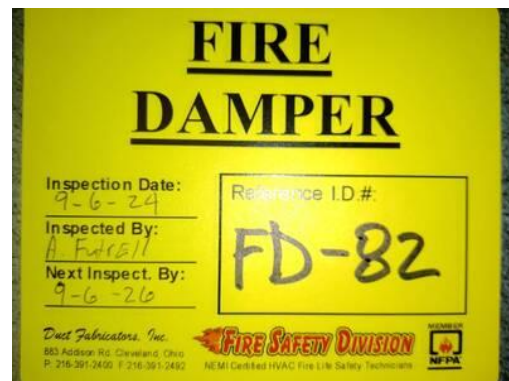

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-06

Facility Location

County Examiner Bldg.

Damper Location

3rd floor chemistry hallway

Inspector Name

James Futrell

Damper I.D. #

FD-83

Damper Type

Vertical Fire Damper

Damper Size

48/18

Damper Manufacturer

Ruskin

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass


Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position

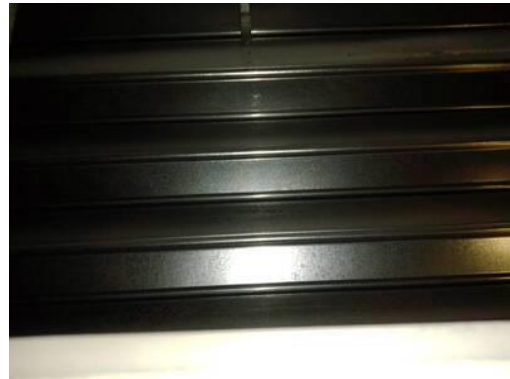

Picture of Damper I.D. Label

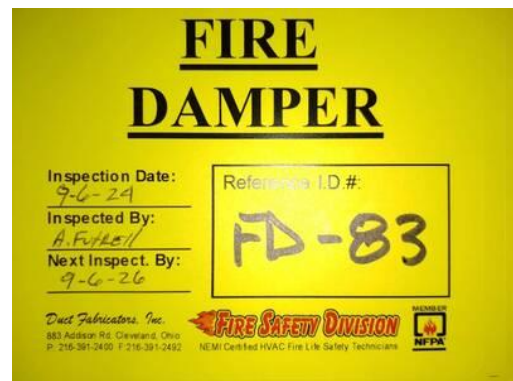

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-06

Facility Location

County Examiner Bldg.

Damper Location

1st floor room 123

Inspector Name

James Futrell

Damper I.D.

FD-84

Damper Type

Vertical Fire Damper

Damper Size

12-inch round

Damper Manufacturer

Ruskin

Damper Model

Unknown

Fusible Link Temperature

212 Degrees

Access Door Size

12/8


Pass / Fail / Abandoned

Pass

Comments / Corrections

Install access door


Picture of Damper in Open Position

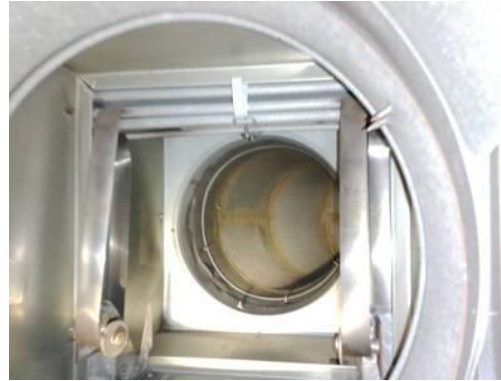

Picture of Damper in Closed Position



Picture of Damper I.D. Label

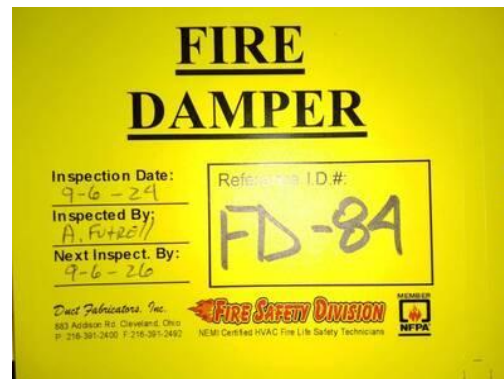

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-06

Facility Location

County Examiner Bldg.

Damper Location

1st floor women bathroom

Inspector Name

James Futrell

Damper I.D.

FD-85

Damper Type

Vertical Fire Damper

Damper Size

36/12

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Fail

Comments / Corrections

No sleeve, no retaining frame

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-12

Facility Location

County Examiner Bldg.

Damper Location

1st floor women bathroom

Inspector Name

James Futrell

Damper I.D.

FD-86

Damper Type

Vertical Fire Damper

Damper Size

36/12

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Fail

Comments / Corrections

No annular space, no retaining frame, no sleeve

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-12

Facility Location

County Examiner Bldg.

Damper Location

1st floor women bathroom

Inspector Name

James Futrell

Damper I.D.

FD-87

Damper Type

Vertical Fire Damper

Damper Size

10/6

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6/6

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-12

Facility Location

County Examiner Bldg.

Damper Location

1st floor conference room hallway

Inspector Name

James Futrell

Damper I.D.

FD-88

Damper Type

Vertical Fire Damper

Damper Size

46/10

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-12

Facility Location

County Examiner Bldg.

Damper Location

1st floor men's bathroom

Inspector Name

James Futrell

Damper I.D.

FD-89

Damper Type

Vertical Fire Damper

Damper Size

10/6

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/8

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

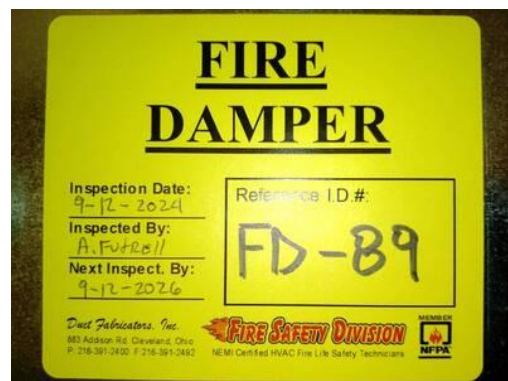

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F:216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-12

Facility Location

County Examiner Bldg.

Damper Location

2nd fl 202 info services

Inspector Name

James Futrell

Damper I.D.

FD-90

Damper Type

Vertical Fire Damper

Damper Size

15 inch round

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/6

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u>	
<u>DAMPER</u>	
Inspection Date: 9-12-2024	Reference I.D.#: FD-90
Inspected By: A Futrell	
Next Inspect. By: 9-12-2026	

Duct Fabricators, Inc.
883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER
NFPA

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-12

Facility Location

County Examiner Bldg.

Damper Location

2nd fl info services 202

Inspector Name

James Futrell

Damper I.D.

FD-91

Damper Type

Vertical Fire Damper

Damper Size

12 inch round

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Abandoned

Comments / Corrections

Found closed left as is, marked as abandoned

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-12

Facility Location

County Examiner Bldg.

Damper Location

2nd fl data center build room

Inspector Name

James Futrell

Damper I.D.

FD-92

Damper Type

Vertical Fire Damper

Damper Size

70/16

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

Duct has two curtains in it

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-12

Facility Location

County Examiner Bldg.

Damper Location

2nd fl data center build room

Inspector Name

James Futrell

Damper I.D.

FD-93

Damper Type

Vertical Fire Damper

Damper Size

96/18

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

40/18

Pass / Fail / Abandoned

Pass

Comments / Corrections

Remove abandoned volume damper,
install access door.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u> <u>DAMPER</u>	
Inspection Date: 9-12-2024	Reference I.D.#:
Inspected By: A. Futrell	FD-93
Next Inspect. By: 9-12-2026	

Duct Fabricators, Inc.
883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER
NFPA

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-12

Facility Location

County Examiner Bldg.

Damper Location

2nd fl 201M

Inspector Name

James Futrell

Damper I.D. #

FD-94

Damper Type

Vertical Fire Damper

Damper Size

20/10

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

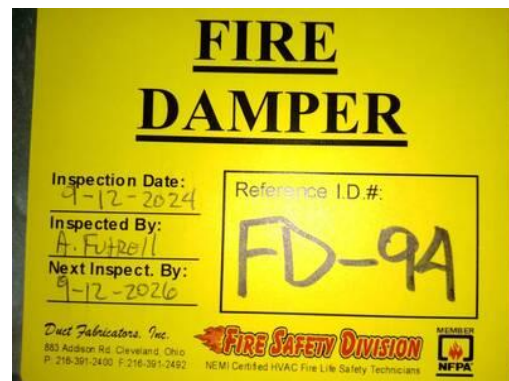

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-13

Facility Location

County Examiner Bldg.

Damper Location

Ground floor women bathroom

Inspector Name

James Futrell

Damper I.D.

FD-95

Damper Type

Vertical Fire Damper

Damper Size

12/10

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/8

Pass / Fail / Abandoned

Fail

Comments / Corrections

No annular space, no retaining frame, no sleeve


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

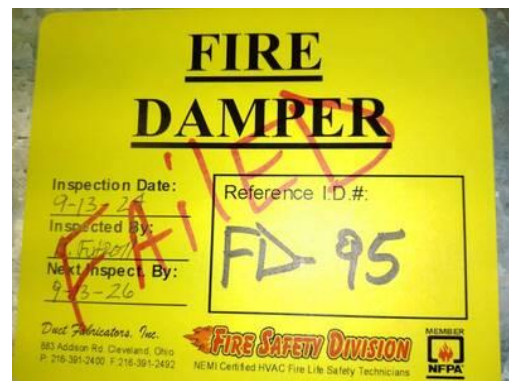

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-13

Facility Location

County Examiner Bldg.

Damper Location

Ground floor women bathroom

Inspector Name

James Futrell

Damper I.D.

FD-96

Damper Type

Vertical Fire Damper

Damper Size

10/8

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/8

Pass / Fail / Abandoned

Fail

Comments / Corrections

No annular space, no retaining frame, no sleeve

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-13

Facility Location

County Examiner Bldg.

Damper Location

Ground floor women bathroom

Inspector Name

James Futrell

Damper I.D.

FD-97

Damper Type

Vertical Fire Damper

Damper Size

12/10

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/8

Pass / Fail / Abandoned

Fail

Comments / Corrections

No annular space, no retaining frame, no sleeve

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-13

Facility Location

County Examiner Bldg.

Damper Location

Ground floor room 022

Inspector Name

James Futrell

Damper I.D.

FD-98

Damper Type

Vertical Fire Damper

Damper Size

24/5

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/10

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

**FIRE
DAMPER**

Inspection Date: 9-13-24
Inspected By: J. Futrell
Next Inspect. By: 9-13-26

Reference I.D.#: FD-98

Duct Fabricators, Inc.
883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER
NFPA

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-13

Facility Location

County Examiner Bldg.

Damper Location

Ground floor mech room 025

Inspector Name

James Futrell

Damper I.D.

FD-99

Damper Type

Vertical Fire Damper

Damper Size

76/42

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

Damper is two separate curtains


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

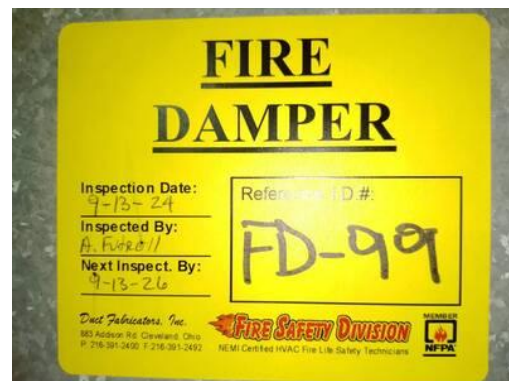

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-13

Facility Location

County Examiner Bldg.

Damper Location

Vehicle bay

Inspector Name

James Futrell

Damper I.D. #

FD-100

Damper Type

Vertical Fire Damper

Damper Size

48/24

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

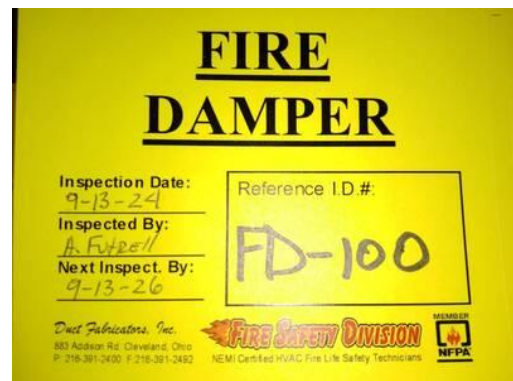

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-13

Facility Location

County Examiner Bldg.

Damper Location

Vehicle bay

Inspector Name

James Futrell

Damper I.D.

FD-101

Damper Type

Vertical Fire Damper

Damper Size

30/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

14/14

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

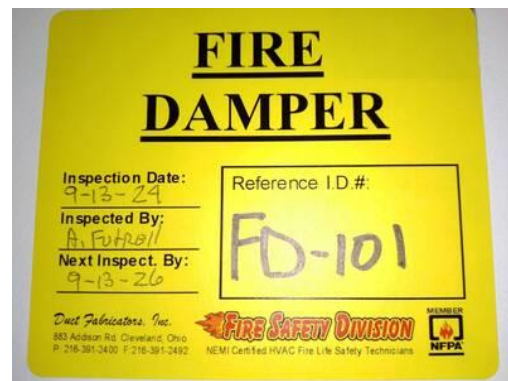

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-13

Facility Location

County Examiner Bldg.

Damper Location

Vehicle bay

Inspector Name

James Futrell

Damper I.D.

FD-102

Damper Type

Vertical Fire Damper

Damper Size

32/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-09-13

Facility Location

County Examiner Bldg.

Damper Location

Vehicle bay

Inspector Name

James Futrell

Damper I.D.

FD-103

Damper Type

Vertical Fire Damper

Damper Size

14/12

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

