

Cuyahoga County
William Patrick Day
2421 Community College Ave, Cleveland, OH 44115

Fire/Smoke Damper Inspection Report

AUGUST 2024 Physical Inspections

Duct Fabricators, Inc.
FIRE SAFETY DIVISION



Report Date: September 2024

Project: Cuyahoga County
William Patrick Day

Inspector(s):

- Dan Tulcewicz, Certified Technician
- Tristan May, Certified Technician
- James Futrell, Certified Technician

Inspection and Test Date(s):

- August 2024

Duct Fabricators, Inc. "Fire Safety Division" inspected the Eighty-Two (82) fire dampers noted on the following sheets for proper installation. The dampers were then tested and photographed in the "open" and "closed" positions to confirm that they were functioning as designed.

(48) dampers passed the inspection and functional testing.
(34) dampers failed the inspection due to reasons indicated in the report.

NOTES: NFPA 80 and NFPA 105 require newly installed dampers to be inspected and tested one year after initial installation. Thereafter, dampers located in patient care facilities are to be inspected and tested every six years.

Additionally, the information contained herein verified whether the dampers were functional at the time of testing. This verification process does not represent any form of a guarantee that the dampers will properly perform in the future.

Date of Inspection	Facility Location	Damper Location	Inspector Name	Damper ID	Damper Type	Damper Size	Damper Manufacturer	Damper Model	Fusible Link Temperature	Access Door Size	Pass Fail Abandoned	Comments Corrections
2024-08-01	William Patrick Day	E188	Dan Tulcewicz	FD-01	Vertical Fire Damper	18"x8"	Unknown	Unknown	165 Degrees	10"x12"	Pass	Added retaining angle.
2024-08-01	William Patrick Day	E189	Dan Tulcewicz	FD-02	Vertical Fire Damper	18"x8"	Unknown	Unknown	165 Degrees	12"x10"	Pass	Added retaining angle.
2024-08-08	William Patrick Day	E190	Dan Tulcewicz	FD-03	Vertical Fire Damper	18"x8"	Unknown	Unknown	165 Degrees	12"x10"	Pass	Added retaining angle.
2024-08-08	William Patrick Day	E193	Dan Tulcewicz	FD-04	Vertical Fire Damper	18"x8"	Unknown	Unknown	165 Degrees	12"x10"	Pass	Added retaining angle to the wall.
2024-08-08	William Patrick Day	E195	Dan Tulcewicz	FD-05	Vertical Fire Damper	16"x8"	Unknown	Unknown	165 Degrees	12"x10"	Pass	Added retaining angle to the wall.
2024-08-12	William Patrick Day	E135A Corridor	Dan Tulcewicz	FD-06	Vertical Fire Damper	12"x8"	Unknown	Unknown	165 Degrees	12"x10"	Pass	None
2024-08-12	William Patrick Day	E135A Corridor	Dan Tulcewicz	FD-07	Vertical Fire Damper	48"x16"	Unknown	Unknown	165 Degrees	Open	Pass	Install retaining angle to the wall.
2024-08-12	William Patrick Day	E135A Corridor	Dan Tulcewicz	FD-08	Vertical Fire Damper	48"x16"	Unknown	Unknown	165 Degrees	Open	Pass	Install retaining angle to the wall.
2024-08-13	William Patrick Day	Room 229	Dan Tulcewicz	FD-09	Horizontal Fire Damper	12/12	Unknown	Unknown	165 Degrees	NA	Pass	Added angle frame
2024-08-13	William Patrick Day	Room 229	Dan Tulcewicz	FD-10	Horizontal Fire Damper	10/6	Unknown	Unknown	165 Degrees	6/8	Pass	Add angle retaining frame and screws to sleeve
2024-08-13	William Patrick Day	E192	Dan Tulcewicz	FD-11	Horizontal Fire Damper	16/8	Unknown	Unknown	165 Degrees	12/10	Pass	Add frame to sleeve
2024-08-13	William Patrick Day	E194	Dan Tulcewicz	FD-12	Horizontal Fire Damper	16/8	Unknown	Unknown	165 Degrees	12/8	Pass	Add angle to sleeve.
2024-08-12	William Patrick Day	Conference room A #208	Dan Tulcewicz	FD-12a	Vertical Fire Damper	12"x8"	Unknown	Unknown	165 Degrees	12"x10"	Pass	Installed retaining angles
2024-08-13	William Patrick Day	E191	Dan Tulcewicz	FD-13	Horizontal Fire Damper	16/8	Unknown	Unknown	165 Degrees	12/10	Pass	Added angle frame
2024-08-13	William Patrick Day	Hallway E176 corridor	James Futrell	FD-14	Horizontal Fire Damper	80/32	Unknown	Unknown	165 Degrees	NA	Pass	Added angle frame
2024-08-12	William Patrick Day	E135A Corridor.	Dan Tulcewicz	FD-15	Vertical Fire Damper	12"x6"	Unknown	Unknown	165 Degrees	12"x10"	Pass	Install retaining angle to the wall on both sides.
2024-08-13	William Patrick Day	Corridor E176	James Futrell	FD-16	Horizontal Fire Damper	80x32	Unknown	Unknown	165 Degrees	Open	Pass	Added angle frame
2024-08-13	William Patrick Day	E 176 corridor	James Futrell	FD-17	Horizontal Fire Damper	12/6	Unknown	Unknown	165 Degrees	7/6	Pass	Added angle frame
2024-08-13	William Patrick Day	E-176 Corridor	James Futrell	FD-18	Horizontal Fire Damper	12/6	Unknown	Unknown	165 Degrees	8/6	Pass	Added angle frame
2024-08-14	William Patrick Day	E135A Corridor	Tristan May	FD-19	Vertical Fire Damper	48x16"	Unknown	Unknown	165 Degrees	Open	Pass	Added angle
2024-08-14	William Patrick Day	E135A Corridor	Tristan May	FD-20	Vertical Fire Damper	48*16	Unknown	Unknown	165 Degrees	Open	Fail	Added angle. Wires ran through damper. Fire proofing spray stuck to curtain also preventing damper operation
2024-08-14	William Patrick Day	E135 Corridor	Tristan May	FD-21	Vertical Fire Damper	6x16"	Unknown	Unknown	165 Degrees	10x12"	Pass	Added angle frame
2024-08-14	William Patrick Day	134A Corridor	Tristan May	FD-23	Vertical Fire Damper	48x16"	Unknown	U300G	165 Degrees	Open	Pass	Added angle frame
2024-08-14	William Patrick Day	E135 Corridor	Tristan May	FD-24	Vertical Fire Damper	48x16"	Unknown	U350G	165 Degrees	Open	Pass	Added angle frame

Date of Inspection	Facility Location	Damper Location	Inspector Name	Damper ID	Damper Type	Damper Size	Damper Manufacturer	Damper Model	Fusible Link Temperature	Access Door Size	Pass Fail Abandoned	Comments Corrections
2024-08-14	William Patrick Day	E135 Corridor	Tristan May	FD-25	Vertical Fire Damper	48x16"	Unknown	U250G	165 Degrees	Open	Fail	Added angle. Wire through damper
2024-08-14	William Patrick Day	E135 Corridor	Tristan May	FD-26	Vertical Fire Damper	48x16"	Unknown	U250G	165 Degrees	Open	Pass	Added angle both sides of wall
2024-08-14	William Patrick Day	E-172	James Futrell	FD-27	Vertical Fire Damper	24/10	Unknown	Unknown	165 Degrees	10/12	Pass	Added angle frame
2024-08-14	William Patrick Day	Rm-E 172 C	James Futrell	FD-28	Vertical Fire Damper	60/24	Unknown	Unknown	165 Degrees	Open	Fail	Communication cables going through damper, an added angle frame to sleeve.
2024-08-14	William Patrick Day	E176 office1	James Futrell	FD-29	Vertical Fire Damper	70/21	Unknown	Unknown	165 Degrees	Open	Pass	Added angle frame
2024-08-14	William Patrick Day	E176 office1	James Futrell	FD-30	Vertical Fire Damper	10/20	Unknown	Unknown	165 Degrees	10/12	Pass	Add retaining angle
2024-08-14	William Patrick Day	Room 232	James Futrell	FD-31	Vertical Fire Damper	42/16	Unknown	Unknown	165 Degrees	Open	Fail	Failed due to screw in curtain track, cables going through top and bottom of opening in wall, improper installation of fusible link, an damper is installed out of level.
2024-08-14	William Patrick Day	Room 232	James Futrell	FD-32	Vertical Fire Damper	50/21	Unknown	Unknown	165 Degrees	Open	Pass	Add retaining angle
2024-08-14	William Patrick Day	E123 Vestibule	Tristan May	FD-33	Vertical Fire Damper	6x20	Unknown	Unknown	165 Degrees	6x8"	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123 Vestibule	Tristan May	FD-34	Vertical Fire Damper	7x20	Unknown	Unknown	165 Degrees	6x8	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123 Vestibule	Tristan May	FD-35	Vertical Fire Damper	6x20"	Unknown	Unknown	165 Degrees	6x8"	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123 Vestibule	Tristan May	FD-37	Vertical Fire Damper	11x20	Unknown	Unknown	165 Degrees	10x12	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123 Vestibule	Tristan May	FD-38	Vertical Fire Damper	6*20	Unknown	Unknown	165 Degrees	8*6	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123 Vestibule	Tristan May	FD-39	Vertical Fire Damper	6*20	Unknown	Unknown	165 Degrees	6*8	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123 Vestibule	Tristan May	FD-40	Vertical Fire Damper	13*20	Unknown	Unknown	165 Degrees	12*10*	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123	Tristan May	FD-41	Vertical Fire Damper	6*20	Unknown	Unknown	165 Degrees	Patch	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123 Vestibule	Tristan May	FD-42	Vertical Fire Damper	7*20	Unknown	Unknown	165 Degrees	Patch	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123	Tristan May	FD-43	Vertical Fire Damper	6*20	Unknown	Unknown	165 Degrees	Patch	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123	Tristan May	FD-44	Vertical Fire Damper	6*20	Unknown	Unknown	165 Degrees	Patch	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123 Vestibule	Tristan May	FD-45	Vertical Fire Damper	11*20	Unknown	Unknown	165 Degrees	Patch	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123 Vestibule	Tristan May	FD-46	Vertical Fire Damper	6*20	Unknown	Unknown	165 Degrees	Patch	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-14	William Patrick Day	E123 Vestibule	Tristan May	FD-47	Vertical Fire Damper	6*20	Unknown	Unknown	165 Degrees	Patch	Fail	Wire through annular space, sleeve not through wall, breakaway connection in wall.
2024-08-15	William Patrick Day	Room 232	James Futrell	FD-48	Vertical Fire Damper	11/20	Unknown	Unknown	165 Degrees	10/12	Pass	Add retaining angle

Date of Inspection	Facility Location	Damper Location	Inspector Name	Damper ID	Damper Type	Damper Size	Damper Manufacturer	Damper Model	Fusible Link Temperature	Access Door Size	Pass Fail Abandoned	Comments Corrections
2024-08-15	William Patrick Day	Room 232	James Futrell	FD-49	Vertical Fire Damper	11/20	Unknown	Unknown	165 Degrees	10/12	Pass	Add retaining angle
2024-08-15	William Patrick Day	Room 232	James Futrell	FD-50	Vertical Fire Damper	9/20	Unknown	Unknown	165 Degrees	6/8	Pass	Add retaining angle
2024-08-15	William Patrick Day	Kitchen E128	Tristan May	FD-51	Vertical Fire Damper	48*16	Unknown	Unknown	165 Degrees	Grill	Pass	None
2024-08-15	William Patrick Day	E128 Kitchen	Tristan May	FD-52	Vertical Fire Damper	48*16	Unknown	Unknown	165 Degrees	Grill	Pass	None
2024-08-15	William Patrick Day	E147	James Futrell	FD-53	Vertical Fire Damper	8/4	Unknown	Unknown	165 Degrees	8/6	Fail	Pneumatic lines an conduit in sleeve
2024-08-15	William Patrick Day	Room G1	James Futrell	FD-54	Vertical Fire Damper	48/15	Unknown	Unknown	165 Degrees	16/16	Pass	None
2024-08-15	William Patrick Day	Room G1	James Futrell	FD-55	Vertical Fire Damper	36/16	Unknown	Unknown	165 Degrees	16/16	Pass	None
2024-08-15	William Patrick Day	Room G2	James Futrell	FD-56	Vertical Fire Damper	30/24	Unknown	Unknown	165 Degrees	12/10	Pass	Add retaining angle
2024-08-15	William Patrick Day	E138 mechanical	Tristan May	FD-57	Vertical Fire Damper	60*24	Unknown	U200G	165 Degrees	Open	Pass	Add angle
2024-08-15	William Patrick Day	E138 Mechanical	Tristan May	FD-58	Vertical Fire Damper	42*12	Unknown	Unknown	165 Degrees	Open	Pass	Add angle
2024-08-20	William Patrick Day	Mechanical room E138	Tristan May	FD-59	Vertical Fire Damper	60*24	Unknown	Unknown	165 Degrees	Grill	Pass	None
2024-08-20	William Patrick Day	E138 mechanical room.	Tristan May	FD-60	Vertical Fire Damper	24"x10"	Unknown	Unknown	165 Degrees	Open duct	Pass	None
2024-08-15	William Patrick Day	Room G2	James Futrell	FD-61	Vertical Fire Damper	16/8	Unknown	Unknown	165 Degrees	8/8	Fail	Multiple infractions, one being unable to properly retain
2024-08-20	William Patrick Day	Room G-2	James Futrell	FD-62	Horizontal Fire Damper	14/12	Unknown	Unknown	165 Degrees	6/10	Pass	None
2024-08-19	William Patrick Day	E160	Tristan May	FD-63	Vertical Fire Damper	16*8	Unknown	Unknown	165 Degrees	12*10	Fail	Sleeve not long enough.
2024-08-19	William Patrick Day	E198	Tristan May	FD-64	Vertical Fire Damper	16*8	Unknown	Unknown	165 Degrees	10x12	Fail	Copper line through annular space, sleeve to short.
2024-08-19	William Patrick Day	E157	Tristan May	FD-65	Vertical Fire Damper	18"x8"	Unknown	Unknown	165 Degrees	12*10	Fail	Sleeve not long enough
2024-08-19	William Patrick Day	E159	Tristan May	FD-66	Vertical Fire Damper	18"x8"	Unknown	Unknown	165 Degrees	12"x10"	Fail	Sleeve not long enough
2024-08-19	William Patrick Day	E161	Tristan May	FD-67	Vertical Fire Damper	8*18	Unknown	Unknown	165 Degrees	10*12	Fail	Sleeve not long enough
2024-08-19	William Patrick Day	E163	Tristan May	FD-68	Vertical Fire Damper	18"x8"	Unknown	Unknown	165 Degrees	12"x10"	Fail	Sleeve not long enough.
2024-08-19	William Patrick Day	E165	Tristan May	FD-69	Vertical Fire Damper	12*18	Unknown	Unknown	165 Degrees	10*12	Fail	Sleeve not long enough
2024-08-20	William Patrick Day	E176 Hallway	James Futrell	FD-70	Vertical Fire Damper	11/20	Unknown	Unknown	165 Degrees	10/12	Fail	Door too far from curtain, breakaway joint in wall no retaining frame
2024-08-20	William Patrick Day	E176 Hallway	James Futrell	FD-71	Vertical Fire Damper	11/20	Unknown	Unknown	165 Degrees	10/20	Fail	Door too far away from curtain, breakaway joint in wall and no retaining frame
2024-08-20	William Patrick Day	E176 Hallway	James Futrell	FD-72	Vertical Fire Damper	9/20	Unknown	Unknown	165 Degrees	6/8	Fail	Door too far away from curtain, breakaway joint in wall and no retaining frame

Date of Inspection	Facility Location	Damper Location	Inspector Name	Damper ID	Damper Type	Damper Size	Damper Manufacturer	Damper Model	Fusible Link Temperature	Access Door Size	Pass Fail Abandoned	Comments Corrections
2024-08-20	William Patrick Day	E176 Hallway	James Futrell	FD-73	Vertical Fire Damper	9/20	Unknown	Unknown	165 Degrees	6/8	Fail	Door too far away from curtain, breakaway joint in wall and no retaining frame
2024-08-20	William Patrick Day	E176 Hallway	James Futrell	FD-74	Vertical Fire Damper	11/20	Unknown	Unknown	165 Degrees	10/20	Fail	Door too far away from curtain, break away joint in wall and no retaining frame
2024-08-20	William Patrick Day	E176 Hallway	James Futrell	FD-75	Vertical Fire Damper	11/20	Unknown	Unknown	165 Degrees	10/12	Fail	Door too far away from curtain breakaway joint in wall and no retaining frame
2024-08-20	William Patrick Day	E176 Hallway	James Futrell	FD-76	Vertical Fire Damper	6/20	Unknown	Unknown	165 Degrees	10/12	Fail	Door too far away from curtain breakaway joint in wall and no retaining frame
2024-08-20	William Patrick Day	Room 192A	James Futrell	FD-77	Vertical Fire Damper	10/4	Unknown	Unknown	165 Degrees	8/6	Pass	Add retaining angle
2024-08-20	William Patrick Day	E176 KS Office	James Futrell	FD-78	Vertical Fire Damper	20/8	Unknown	Unknown	165 Degrees	10/12	Pass	Add retaining angle frame
2024-08-20	William Patrick Day	E194A	James Futrell	FD-79	Vertical Fire Damper	10/4	Unknown	Unknown	165 Degrees	10/12	Pass	Add retaining angle
2024-08-21	William Patrick Day	E182	James Futrell	FD-80	Vertical Fire Damper	8*6	Unknown	Unknown	165 Degrees	8*6	Pass	Add angle to wall
2024-08-21	William Patrick Day	E182	Tristan May	FD-81	Vertical Fire Damper	12*12	Unknown	Unknown	165 Degrees	Open	Pass	None
2024-08-21	William Patrick Day	E170	James Futrell	FD-82	Vertical Fire Damper	10*20	Unknown	Unknown	165 Degrees	Patch	Pass	Add angle
2024-08-21	William Patrick Day	E170	James Futrell	FD-83	Vertical Fire Damper	32*16	Unknown	Unknown	165 Degrees	Open	Pass	None

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-01

Facility Location

William Patrick Day

Damper Location

E188

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-1

Damper Type

Vertical Fire Damper

Damper Size

18"x8"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10"x12"

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-01

Facility Location

William Patrick Day

Damper Location

E189

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-2

Damper Type

Vertical Fire Damper

Damper Size

18"x8"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"x10"

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

FIRE
DAMPER

Inspection Date: 8-1-24	Reference I.D. #: FD-2
Inspected By: TULCEWICZ	
Next Inspect. By: 8-1-26	

Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F:216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER
NFPA

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-08

Facility Location

William Patrick Day

Damper Location

E190

Inspector Name

Dan Tulcewicz

Damper I.D.

FD-3

Damper Type

Vertical Fire Damper

Damper Size

18"x8"

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"x10"

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u> <u>DAMPER</u>	
Inspection Date: <u>8-8-24</u>	Reference I.D.#: <u>FD-3</u>
Inspected By: <u>Tulcewicz</u>	
Next Inspect. By: <u>8-8-26</u>	

Duct Fabricators, Inc.
883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER
NFPA

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-08

Facility Location

William Patrick Day

Damper Location

E193

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-4

Damper Type

Vertical Fire Damper

Damper Size

18"x8"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"x10"

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u> <u>DAMPER</u>	
Inspection Date: 8-8-24	Reference I.D. #: FD-4
Inspected By: TULCEWICZ	
Next Inspect. By: 8-8-26	
Duct Fabricators, Inc. FIRE SAFETY DIVISION MEMBER 883 Addison Rd. Cleveland, Ohio NEMI Certified HVAC Fire Life Safety Technicians NFPA	

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-08

Facility Location

William Patrick Day

Damper Location

E195

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-5

Damper Type

Vertical Fire Damper

Damper Size

16"x8"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"x10"

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

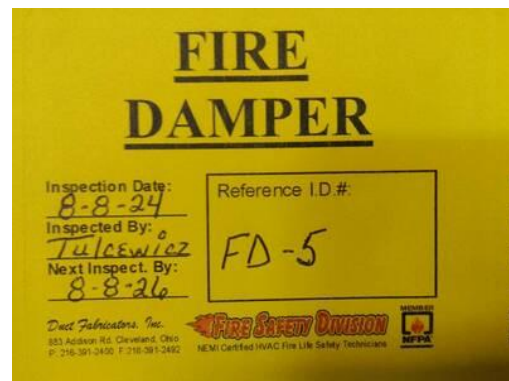

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-12

Facility Location

William Patrick Day

Damper Location

E135A Corridor

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-6

Damper Type

Vertical Fire Damper

Damper Size

12"x8"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"x10"

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

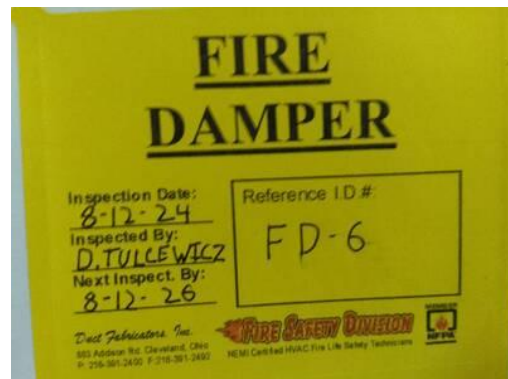

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-12

Facility Location

William Patrick Day

Damper Location

E135A Corridor

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-7

Damper Type

Vertical Fire Damper

Damper Size

48"x16"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

Installed retaining angle.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

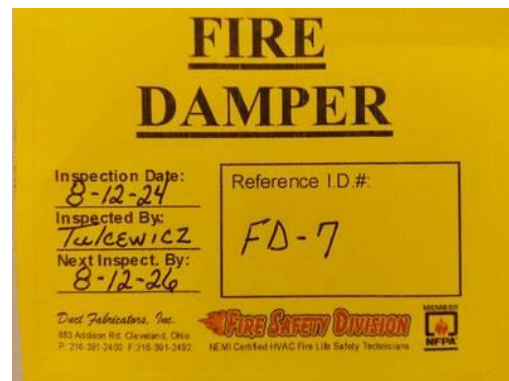

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-12

Facility Location

William Patrick Day

Damper Location

E135A Corridor

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-8

Damper Type

Vertical Fire Damper

Damper Size

48"x16"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass


Comments / Corrections

Installed retaining angle.

Picture of Damper in Open Position



Picture of Damper in Closed Position

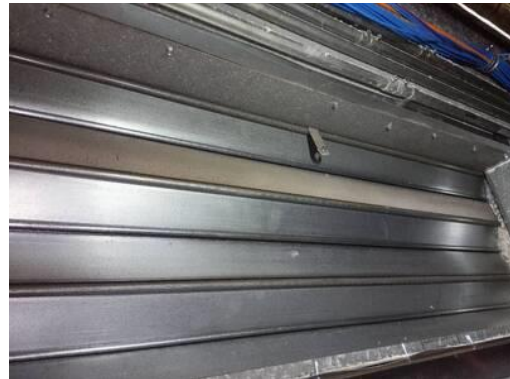

Picture of Damper I.D. Label

<u>FIRE</u> <u>DAMPER</u>	
Inspection Date: 8-12-24	Reference I.D.#:
Inspected By: Tulcewicz	FD-8
Next Inspect. By: 8-12-26	
<small>Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492</small>	
<small>FIRE SAFETY DIVISION NEMI Certified HVAC Fire Life Safety Technicians</small>	
<small>MEMBER NFPA</small>	

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-13

Facility Location

William Patrick Day

Damper Location

Room 229

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-9

Damper Type

Horizontal Fire Damper

Damper Size

12/12

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

NA

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

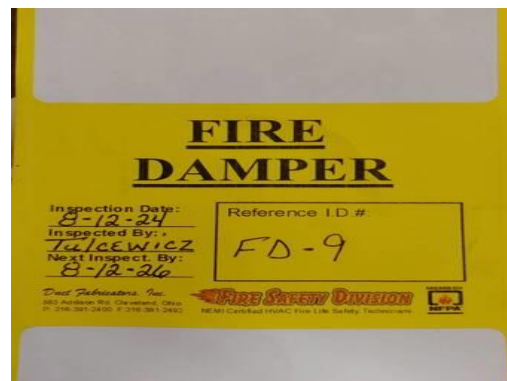

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-13

Facility Location

William Patrick Day

Damper Location

Room 229

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-10

Damper Type

Horizontal Fire Damper

Damper Size

10/6

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6/8

Pass / Fail / Abandoned

Pass

Comments / Corrections

Add angle retaining frame

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-13

Facility Location

William Patrick Day

Damper Location

E192

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-11

Damper Type

Horizontal Fire Damper

Damper Size

16/8

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/10

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angles.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-13

Facility Location

William Patrick Day

Damper Location

E194

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-12

Damper Type

Horizontal Fire Damper

Damper Size

16/8

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/8

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angles.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-12

Facility Location

William Patrick Day

Damper Location

Conference room A #208

Inspector Name

Dan Tulcewicz

Damper I.D. #

FD-12a

Damper Type

Vertical Fire Damper

Damper Size

12"x8"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"x10"

Pass / Fail / Abandoned

Pass

Comments / Corrections

Installed retaining angle.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

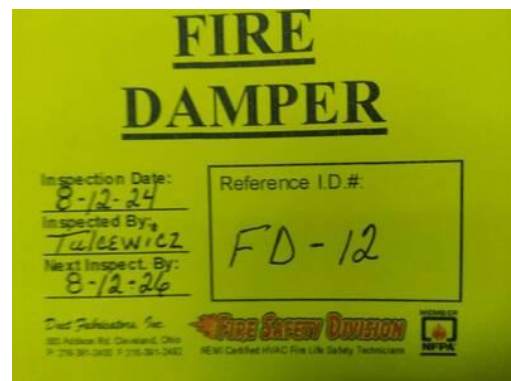

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-13

Facility Location

William Patrick Day

Damper Location

E191

Inspector Name

Dan Tulcewicz

Damper I.D.

FD-13

Damper Type

Horizontal Fire Damper

Damper Size

16/8

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/10

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angles.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-13

Facility Location

William Patrick Day

Damper Location

Hallway E176 corridor

Inspector Name

James Futrell

Damper I.D. #

FD-14

Damper Type

Horizontal Fire Damper

Damper Size

80/32

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

NA

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angles.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-12

Facility Location

William Patrick Day

Damper Location

E135A Corridor.

Inspector Name

Dan Tulcewicz

Damper I.D.

FD-15

Damper Type

Vertical Fire Damper

Damper Size

12"x6"

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"x10"

Pass / Fail / Abandoned

Pass

Comments / Corrections

Installed retaining angle.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u> <u>DAMPER</u>	
Inspection Date: <i>8-12-24</i>	Reference I.D.#:
Inspected By: <i>Tulcewicz</i>	<i>FD-15</i>
Next Inspect. By: <i>8-12-26</i>	
<small>Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492</small>	
<u>FIRE SAFETY DIVISION</u>	
<small>NEMI Certified HVAC Fire Life Safety Technicians</small>	

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-13

Facility Location

William Patrick Day

Damper Location

Corridor E176

Inspector Name

James Futrell

Damper I.D. #

FD-16

Damper Type

Horizontal Fire Damper

Damper Size

80x32

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angles.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

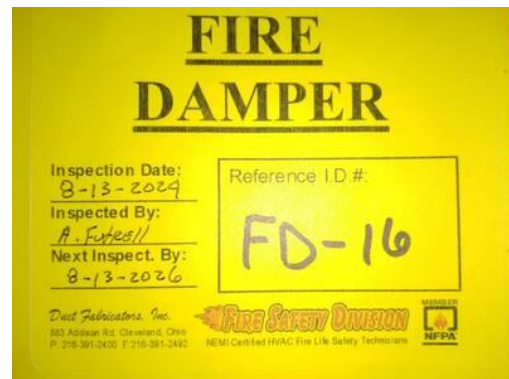

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F:216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-13

Facility Location

William Patrick Day

Damper Location

E 176 corridor

Inspector Name

James Futrell

Damper I.D.

FD-17

Damper Type

Horizontal Fire Damper

Damper Size

12/6

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

7/6

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angles.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-13

Facility Location

William Patrick Day

Damper Location

E-176 Corridor

Inspector Name

James Futrell

Damper I.D. #

FD-18

Damper Type

Horizontal Fire Damper

Damper Size

12/6

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/6

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angles.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E135A Corridor

Inspector Name

Tristan May

Damper I.D. #

FD-19

Damper Type

Vertical Fire Damper

Damper Size

48x16"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

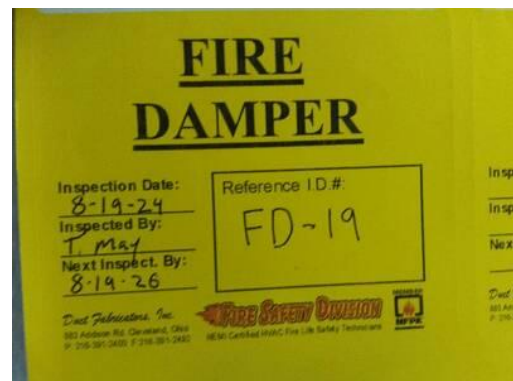

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E135A Corridor

Inspector Name

Tristan May

Damper I.D.

FD-20

Damper Type

Vertical Fire Damper

Damper Size

48*16

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Fail

Comments / Corrections

Added angle. Wires through damper. Fire proofing stuck to curtain.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

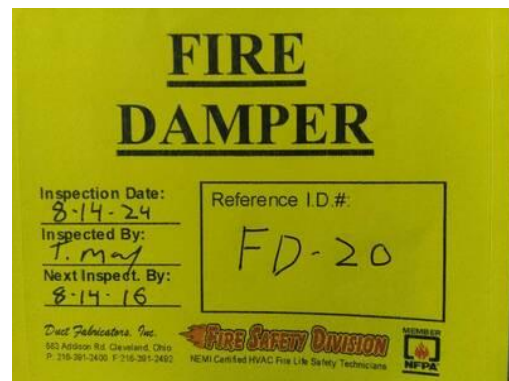

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E135 Corridor

Inspector Name

Tristan May

Damper I.D. #

FD-21

Damper Type

Vertical Fire Damper

Damper Size

6x16"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10x12"

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining anlg.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

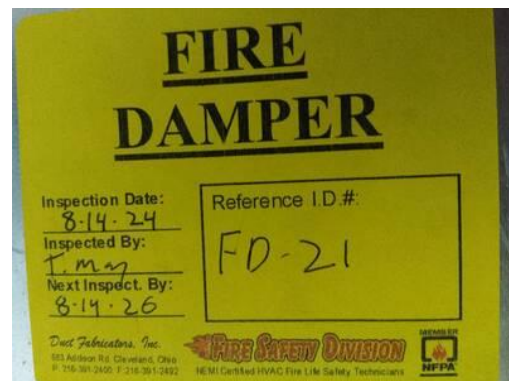

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

134A Corridor

Inspector Name

Tristan May

Damper I.D. #

FD-23

Damper Type

Vertical Fire Damper

Damper Size

48x16"

Damper Manufacturer

Unknown

Damper Model #

U300G

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

FIRE DAMPER	
Inspection Date: 8-14-24	Reference I.D.#: FD-23
Inspected By: T. May	
Next Inspect. By: 8-14-26	
<small>Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492</small>	
FIRE SAFETY DIVISION <small>NEMI Certified HVAC Fire Life Safety Technicians</small>	
<small>MEMBER</small> NFPA	

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E135 Corridor

Inspector Name

Tristan May

Damper I.D.

FD-24

Damper Type

Vertical Fire Damper

Damper Size

48x16"

Damper Manufacturer

Unknown

Damper Model

U350G

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E135 Corridor

Inspector Name

Tristan May

Damper I.D.

FD-25

Damper Type

Vertical Fire Damper

Damper Size

48x16"

Damper Manufacturer

Unknown

Damper Model

U250G

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Fail

Comments / Corrections

Added retaining angle. Wire through damper


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

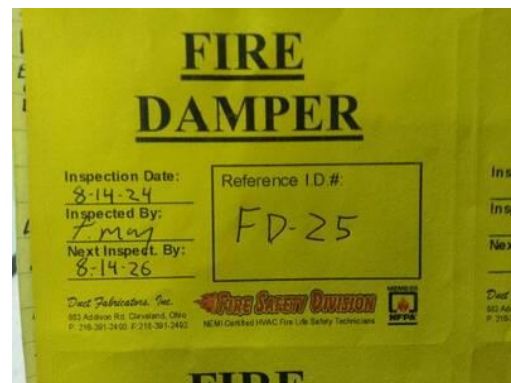

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E135 Corridor

Inspector Name

Tristan May

Damper I.D.

FD-26

Damper Type

Vertical Fire Damper

Damper Size

48x16"

Damper Manufacturer

Unknown

Damper Model

U250G

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

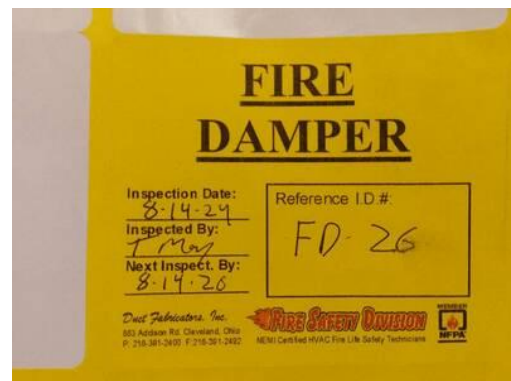

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E-172

Inspector Name

James Futrell

Damper I.D. #

FD-27

Damper Type

Vertical Fire Damper

Damper Size

24/10

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/12

Pass / Fail / Abandoned

Pass


Comments / Corrections

Added retaining angles.


Picture of Damper in Open Position



Picture of Damper in Closed Position

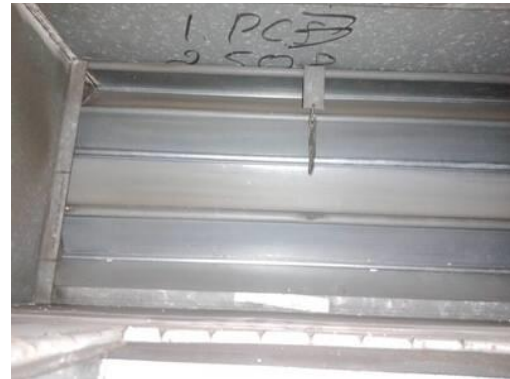

Picture of Damper I.D. Label

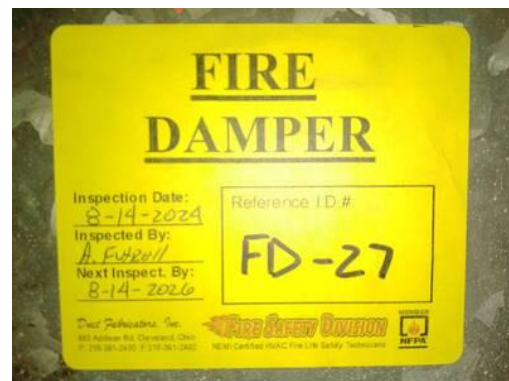

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection
2024-08-14

Facility Location
William Patrick Day

Damper Location
Rm-E 172 C

Inspector Name
James Futrell

Damper I.D. #
FD-28

Damper Type
Vertical Fire Damper

Damper Size
60/24

Damper Manufacturer
Unknown

Damper Model #
Unknown

Fusible Link Temperature
165 Degrees

Access Door Size
Open

Pass / Fail / Abandoned
Fail

Comments / Corrections
Communication cables going through damper, an added retaining angle.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E176 office1

Inspector Name

James Futrell

Damper I.D. #

FD-29

Damper Type

Vertical Fire Damper

Damper Size

70/21

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E176 office1

Inspector Name

James Futrell

Damper I.D. #

FD-30

Damper Type

Vertical Fire Damper

Damper Size

10/20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

Room 232

Inspector Name

James Futrell

Damper I.D.

FD-31

Damper Type

Vertical Fire Damper

Damper Size

42/16

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Fail

Comments / Corrections

Screw in curtain track, cables in annular space, improper installation of fusible link

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

Room 232

Inspector Name

James Futrell

Damper I.D.

FD-32

Damper Type

Vertical Fire Damper

Damper Size

50/21

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

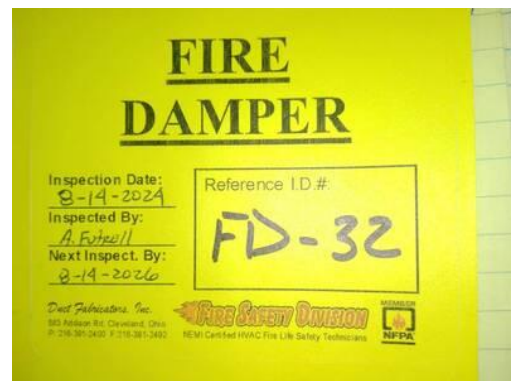

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123 Vestibule

Inspector Name

Tristan May

Damper I.D. #

FD-33

Damper Type

Vertical Fire Damper

Damper Size

6x20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6x8"

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire through annular space, sleeve not through wall.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123 Vestibule

Inspector Name

Tristan May

Damper I.D.

FD-34

Damper Type

Vertical Fire Damper

Damper Size

7x20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6x8

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire through annular space, sleeve not through wall.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123 Vestibule

Inspector Name

Tristan May

Damper I.D. #

FD-35

Damper Type

Vertical Fire Damper

Damper Size

6x20"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6x8"

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire through annular space, sleeve not through wall.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123 Vestibule

Inspector Name

Tristan May

Damper I.D.

FD-37

Damper Type

Vertical Fire Damper

Damper Size

11x20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10x12

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire through annular space, sleeve not through wall.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

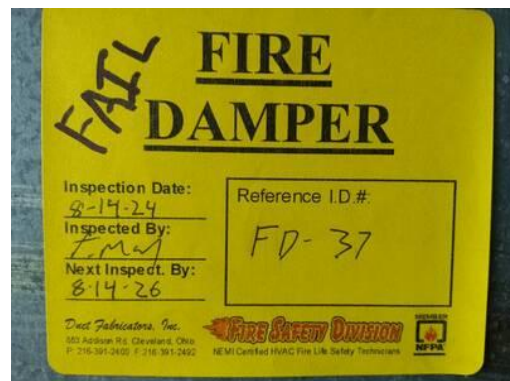

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123 Vestibule

Inspector Name

Tristan May

Damper I.D.

FD-38

Damper Type

Vertical Fire Damper

Damper Size

6*20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8*6

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire through annular space, sleeve not through wall.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

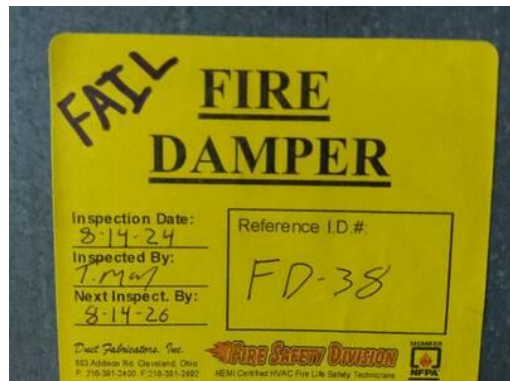

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123 Vestibule

Inspector Name

Tristan May

Damper I.D.

FD-39

Damper Type

Vertical Fire Damper

Damper Size

6*20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6*8

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire through annular space, sleeve not through wall.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123 Vestibule

Inspector Name

Tristan May

Damper I.D. #

FD-40

Damper Type

Vertical Fire Damper

Damper Size

13*20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12*10*

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire through annular space, sleeve not through wall.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123

Inspector Name

Tristan May

Damper I.D. #

FD-41

Damper Type

Vertical Fire Damper

Damper Size

6*20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Patch

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire through annular space, sleeve not through wall.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

FIRE DAMPER	
Inspection Date: 8-14-24	Reference I.D.#: FD-41
Inspected By: TMay	
Next Inspect. By: 8.14.26	
Duct Fabricators, Inc. FIRE SAFETY DIVISION MEMBER 883 Addison Rd. Cleveland, Ohio NEMI Certified HVAC Fire Life Safety Technicians NFPA P: 216-391-2400 F: 216-391-2492	

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123 Vestibule

Inspector Name

Tristan May

Damper I.D. #

FD-42

Damper Type

Vertical Fire Damper

Damper Size

7*20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Patch

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire through annular space, sleeve not through wall.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u> <u>DAMPER</u>	
Inspection Date: 8-14-24	Reference I.D. #: FD-42
Inspected By: T May	
Next Inspect. By: 8-14-26	
<small>Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492</small>	
FIRE SAFETY DIVISION <small>NEMI Certified HVAC Fire Life Safety Technicians</small>	
<small>MEMBER NFPA</small>	

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123

Inspector Name

Tristan May

Damper I.D. #

FD-43

Damper Type

Vertical Fire Damper

Damper Size

6*20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Patch

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire in annular space, sleeve not through wall.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

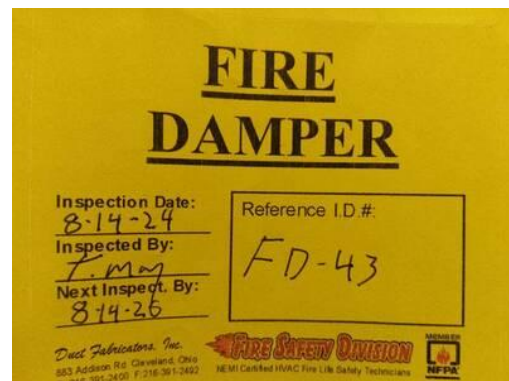

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123

Inspector Name

Tristan May

Damper I.D.

FD-44

Damper Type

Vertical Fire Damper

Damper Size

6*20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Patch

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire in annular space, sleeve not through wall.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

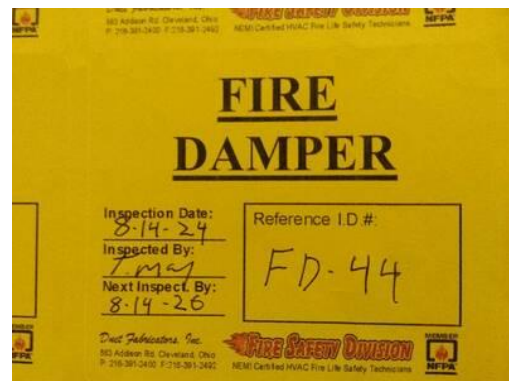

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123 Vestibule

Inspector Name

Tristan May

Damper I.D.

FD-45

Damper Type

Vertical Fire Damper

Damper Size

11*20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Patch

Pass / Fail / Abandoned

Fail

Comments / Corrections

Wire in annular space, sleeve not through wall.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

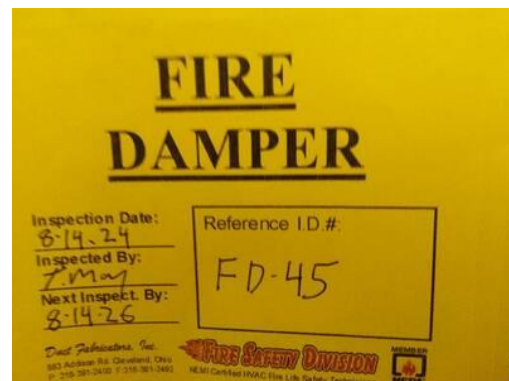

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123 Vestibule

Inspector Name

Tristan May

Damper I.D. #

FD-46

Damper Type

Vertical Fire Damper

Damper Size

6*20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Patch

Pass / Fail / Abandoned

Fail


Comments / Corrections

Wire in annular space, sleeve not through wall.


Picture of Damper in Open Position



Picture of Damper in Closed Position

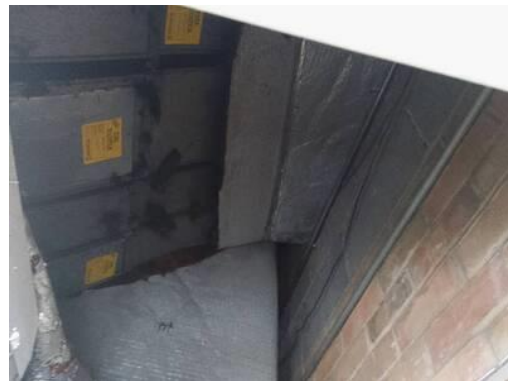

Picture of Damper I.D. Label

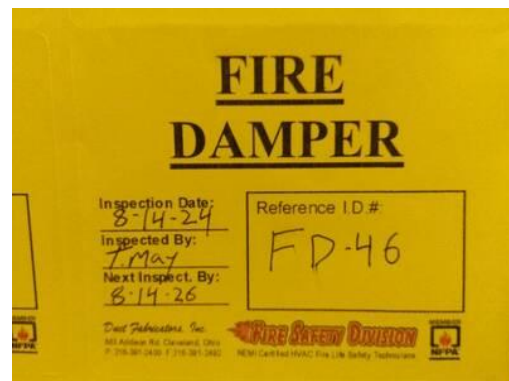

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-14

Facility Location

William Patrick Day

Damper Location

E123 Vestibule

Inspector Name

Tristan May

Damper I.D. #

FD-47

Damper Type

Vertical Fire Damper

Damper Size

6*20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Patch

Pass / Fail / Abandoned

Fail


Comments / Corrections

Wire in annular space, sleeve not through wall.


Picture of Damper in Open Position



Picture of Damper in Closed Position

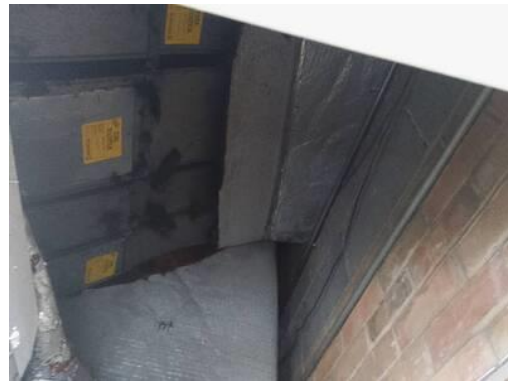

Picture of Damper I.D. Label

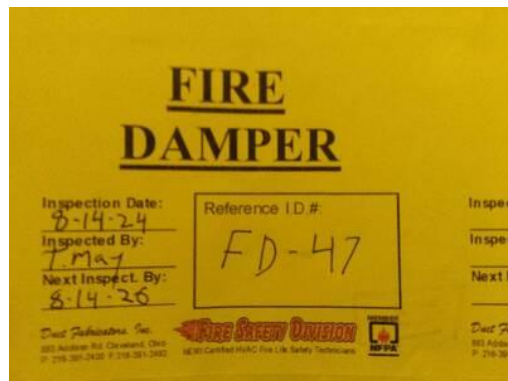

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-15

Facility Location

William Patrick Day

Damper Location

Room 232

Inspector Name

James Futrell

Damper I.D. #

FD-48

Damper Type

Vertical Fire Damper

Damper Size

11/20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-15

Facility Location

William Patrick Day

Damper Location

Room 232

Inspector Name

James Futrell

Damper I.D.

FD-49

Damper Type

Vertical Fire Damper

Damper Size

11/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-15

Facility Location

William Patrick Day

Damper Location

Room 232

Inspector Name

James Futrell

Damper I.D.

FD-50

Damper Type

Vertical Fire Damper

Damper Size

9/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6/8

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-15

Facility Location

William Patrick Day

Damper Location

Kitchen E128

Inspector Name

Tristan May

Damper I.D. #

FD-51

Damper Type

Vertical Fire Damper

Damper Size

48*16

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Grill

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

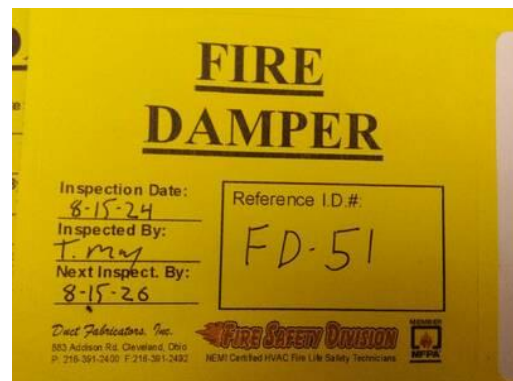

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-15

Facility Location

William Patrick Day

Damper Location

E128 Kitchen

Inspector Name

Tristan May

Damper I.D. #

FD-52

Damper Type

Vertical Fire Damper

Damper Size

48*16

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Grill

Pass / Fail / Abandoned

Pass

Comments / Corrections

None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

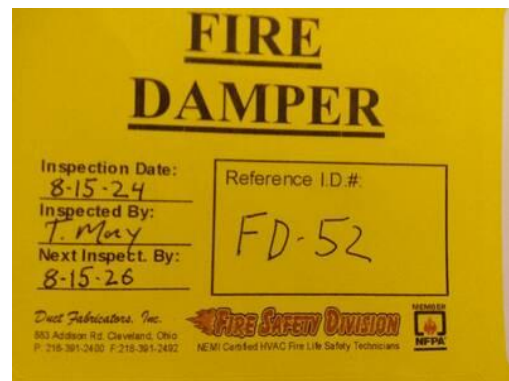

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-15

Facility Location

William Patrick Day

Damper Location

E147

Inspector Name

James Futrell

Damper I.D. #

FD-53

Damper Type

Vertical Fire Damper

Damper Size

8/4

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/6

Pass / Fail / Abandoned

Fail

Comments / Corrections

Pneumatic lines and conduit in annular space.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-15

Facility Location

William Patrick Day

Damper Location

Room G1

Inspector Name

James Futrell

Damper I.D. #

FD-54

Damper Type

Vertical Fire Damper

Damper Size

48/15

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

16/16

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.
883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection
2024-08-15

Facility Location
William Patrick Day

Damper Location
Room G1

Inspector Name
James Futrell

Damper I.D. #
FD-55

Damper Type
Vertical Fire Damper

Damper Size
36/16

Damper Manufacturer
Unknown

Damper Model #
Unknown

Fusible Link Temperature
165 Degrees

Access Door Size
16/16

Pass / Fail / Abandoned
Pass

Comments / Corrections
None


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

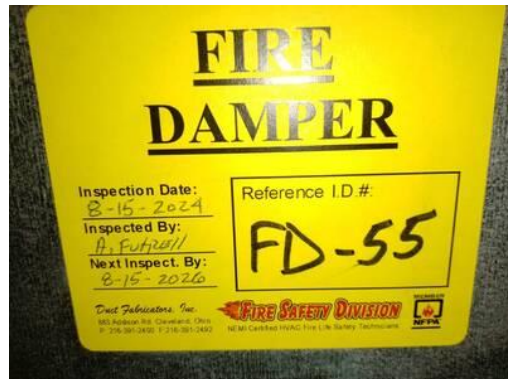

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-15

Facility Location

William Patrick Day

Damper Location

Room G2

Inspector Name

James Futrell

Damper I.D. #

FD-56

Damper Type

Vertical Fire Damper

Damper Size

30/24

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12/10

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

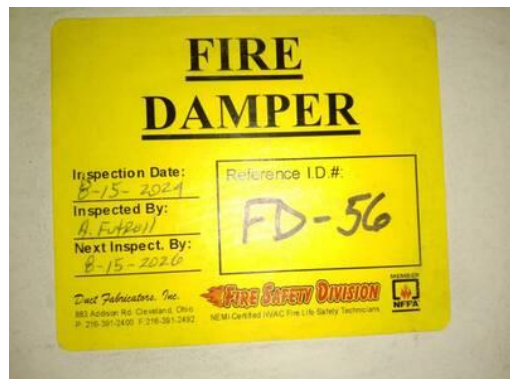

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-15

Facility Location

William Patrick Day

Damper Location

E138 mechanical

Inspector Name

Tristan May

Damper I.D. #

FD-57

Damper Type

Vertical Fire Damper

Damper Size

60*24

Damper Manufacturer

Unknown

Damper Model #

U200G

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

Add angle


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

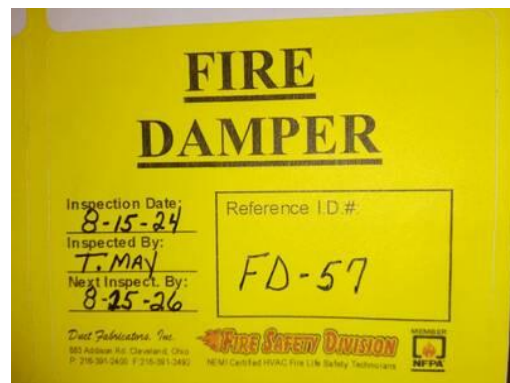

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-15

Facility Location

William Patrick Day

Damper Location

E138 Mechanical

Inspector Name

Tristan May

Damper I.D. #

FD-58

Damper Type

Vertical Fire Damper

Damper Size

42*12

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added angle

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

Mechanical room E138

Inspector Name

Tristan May

Damper I.D. #

FD-59

Damper Type

Vertical Fire Damper

Damper Size

60*24

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Grill

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

E138 mechanical room.

Inspector Name

Tristan May

Damper I.D. #

FD-60

Damper Type

Vertical Fire Damper

Damper Size

24"x10"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open duct

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

FIRE DAMPER

Inspection Date: 8-20-24	Reference I.D.#:
Inspected By: T. MAY	FD-60
Next Inspect. By: 8-20-26	

Duct Fabricators, Inc.
883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER
NFPA

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-15

Facility Location

William Patrick Day

Damper Location

Room G2

Inspector Name

James Futrell

Damper I.D. #

FD-61

Damper Type

Vertical Fire Damper

Damper Size

16/8

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/8

Pass / Fail / Abandoned

Fail

Comments / Corrections

Multiple infractions. This requires reworking the duct/wall opening.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection
2024-08-20

Facility Location
William Patrick Day

Damper Location
Room G-2

Inspector Name
James Futrell

Damper I.D. #
FD-62

Damper Type
Horizontal Fire Damper

Damper Size
14/12

Damper Manufacturer
Unknown

Damper Model #
Unknown

Fusible Link Temperature
165 Degrees

Access Door Size
6/10

Pass / Fail / Abandoned
Pass

Comments / Corrections
None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-19

Facility Location

William Patrick Day

Damper Location

E160

Inspector Name

Tristan May

Damper I.D. #

FD-63

Damper Type

Vertical Fire Damper

Damper Size

16*8

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12*10

Pass / Fail / Abandoned

Fail

Comments / Corrections

Sleeve not long enough.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

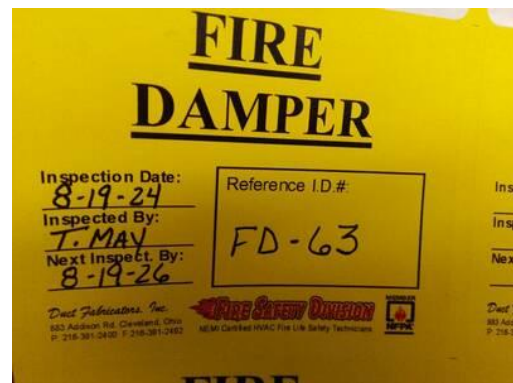

Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-19

Facility Location

William Patrick Day

Damper Location

E198

Inspector Name

Tristan May

Damper I.D. #

FD-64

Damper Type

Vertical Fire Damper

Damper Size

16*8

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10x12

Pass / Fail / Abandoned

Fail

Comments / Corrections

Copper line through annular space, sleeve to short.


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

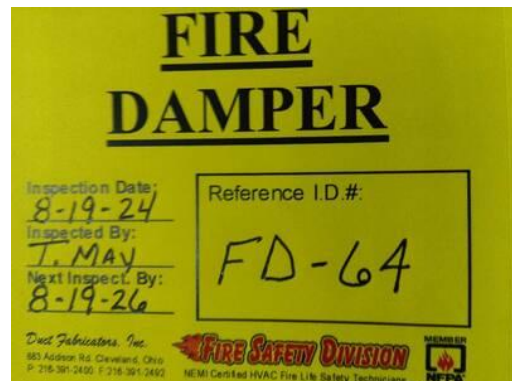

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-19

Facility Location

William Patrick Day

Damper Location

E157

Inspector Name

Tristan May

Damper I.D. #

FD-65

Damper Type

Vertical Fire Damper

Damper Size

18"x8"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12*10

Pass / Fail / Abandoned

Fail

Comments / Corrections

Sleeve not long enough

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

FIRE
DAMPER

Inspection Date: 8-19-24	Reference I.D. #:
Inspected By: Tulcewicz	FD-65
Next Inspect. By: 8-19-26	

Duct Fabricators, Inc.
883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER
NFPA

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-19

Facility Location

William Patrick Day

Damper Location

E159

Inspector Name

Tristan May

Damper I.D. #

FD-66

Damper Type

Vertical Fire Damper

Damper Size

18"x8"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"x10"

Pass / Fail / Abandoned

Fail

Comments / Corrections

Sleeve not long enough

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

FIRE
DAMPER

Inspection Date: <u>8-19-24</u>	Reference I.D.#: <u>FD-66</u>
Inspected By: <u>T. MAY</u>	
Next Inspect. By: <u>8-19-26</u>	

Duct Fabricators, Inc.
883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians

MEMBER
NFPA

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-19

Facility Location

William Patrick Day

Damper Location

E161

Inspector Name

Tristan May

Damper I.D. #

FD-67

Damper Type

Vertical Fire Damper

Damper Size

8*18

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10*12

Pass / Fail / Abandoned

Fail

Comments / Corrections

Sleeve not long enough


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

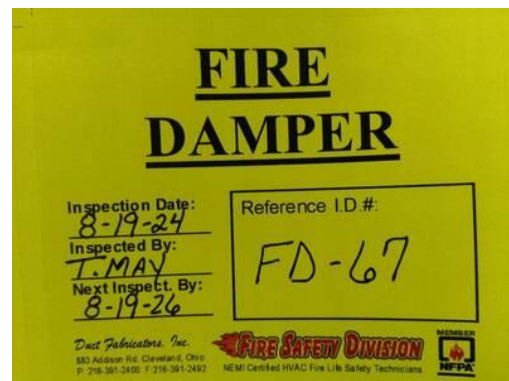

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-19

Facility Location

William Patrick Day

Damper Location

E163

Inspector Name

Tristan May

Damper I.D. #

FD-68

Damper Type

Vertical Fire Damper

Damper Size

18"x8"

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

12"x10"

Pass / Fail / Abandoned

Fail

Comments / Corrections

Sleeve not long enough.

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u> <u>DAMPER</u>	
Inspection Date: 8-19-24	Reference I.D. #: FD-68
Inspected By: T. MAY	
Next Inspect. By: 8-19-26	
<small>Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492</small>	
FIRE SAFETY DIVISION	
<small>MEMBER NFPA</small>	

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-19

Facility Location

William Patrick Day

Damper Location

E165

Inspector Name

Tristan May

Damper I.D. #

FD-69

Damper Type

Vertical Fire Damper

Damper Size

12*18

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10*12

Pass / Fail / Abandoned

Fail

Comments / Corrections

Sleeve not long enough

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u>	
<u>DAMPER</u>	
Inspection Date: 8-19-24	Reference I.D. #: FD-69
Inspected By: T. MAY	
Next Inspect. By: 8-19-26	
<small>Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492</small>	
FIRE SAFETY DIVISION <small>NEMI Certified HVAC Fire Life Safety Technicians</small>	
<small>MEMBER</small> NFPA	

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

E176 Hallway

Inspector Name

James Futrell

Damper I.D. #

FD-70

Damper Type

Vertical Fire Damper

Damper Size

11/20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/12

Pass / Fail / Abandoned

Fail

Comments / Corrections

Door too far from curtain, breakaway joint in wall no retaining frame

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

E176 Hallway

Inspector Name

James Futrell

Damper I.D. #

FD-71

Damper Type

Vertical Fire Damper

Damper Size

11/20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/20

Pass / Fail / Abandoned

Fail

Comments / Corrections

Door too far away, breakaway joint in wall and no retaining frame


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

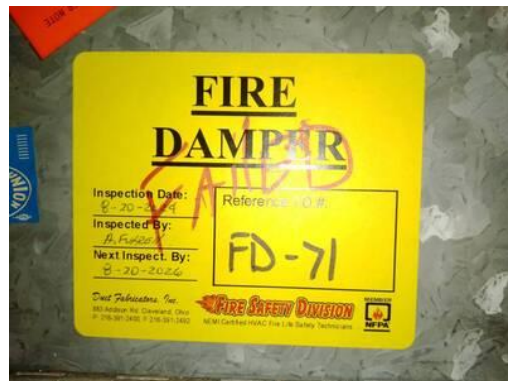

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

E176 Hallway

Inspector Name

James Futrell

Damper I.D. #

FD-72

Damper Type

Vertical Fire Damper

Damper Size

9/20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6/8

Pass / Fail / Abandoned

Fail

Comments / Corrections

Door too far away, breakaway joint in wall and no retaining frame

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION
NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

E176 Hallway

Inspector Name

James Futrell

Damper I.D.

FD-73

Damper Type

Vertical Fire Damper

Damper Size

9/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

6/8

Pass / Fail / Abandoned

Fail

Comments / Corrections

Door too far away, breakaway joint in wall and no retaining frame

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

E176 Hallway

Inspector Name

James Futrell

Damper I.D.

FD-74

Damper Type

Vertical Fire Damper

Damper Size

11/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/20

Pass / Fail / Abandoned

Fail

Comments / Corrections

Door too far away from curtain, break away joint in wall and no retaining frame

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



Duct Fabricators, Inc.

883 Addison Rd. Cleveland, Ohio
P: 216-391-2400 F: 216-391-2492

FIRE SAFETY DIVISION

NEMI Certified HVAC Fire Life Safety Technicians



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

E176 Hallway

Inspector Name

James Futrell

Damper I.D.

FD-75

Damper Type

Vertical Fire Damper

Damper Size

11/20

Damper Manufacturer

Unknown

Damper Model

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/12

Pass / Fail / Abandoned

Fail

Comments / Corrections

Door too far away, breakaway joint in wall and no retaining frame

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

E176 Hallway

Inspector Name

James Futrell

Damper I.D. #

FD-76

Damper Type

Vertical Fire Damper

Damper Size

6/20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/12

Pass / Fail / Abandoned

Fail

Comments / Corrections

Door too far away, breakaway joint in wall and no retaining frame

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

Room 192A

Inspector Name

James Futrell

Damper I.D. #

FD-77

Damper Type

Vertical Fire Damper

Damper Size

10/4

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8/6

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle


Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

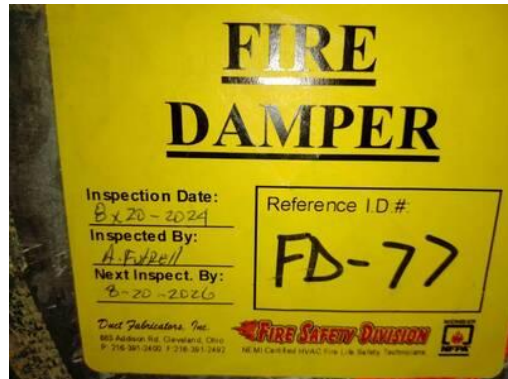

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

E176 KS Office

Inspector Name

James Futrell

Damper I.D. #

FD-78

Damper Type

Vertical Fire Damper

Damper Size

20/8

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angles

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-20

Facility Location

William Patrick Day

Damper Location

E194A

Inspector Name

James Futrell

Damper I.D. #

FD-79

Damper Type

Vertical Fire Damper

Damper Size

10/4

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

10/12

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added retaining angle

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-21

Facility Location

Justice Center Court Towers

Damper Location

E182

Inspector Name

James Futrell

Damper I.D. #

FD-80

Damper Type

Vertical Fire Damper

Damper Size

8*6

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

8*6

Pass / Fail / Abandoned

Pass

Comments / Corrections

Add angle to wall

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

<u>FIRE</u>	
<u>DAMPER</u>	
Inspection Date: 8-21-24	Reference I.D.#: FD-80
Inspected By: J May	
Next Inspect. By: 8-21-26	
<small>Duct Fabricators, Inc. 883 Addison Rd. Cleveland, Ohio P: 216-391-2400 F: 216-391-2492</small>	
FIRE SAFETY DIVISION <small>NEMI Certified HVAC Fire Life Safety Technicians</small>	
<small>MEMBER</small> NFPA	

CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-21

Facility Location

William Patrick Day

Damper Location

E182

Inspector Name

Tristan May

Damper I.D. #

FD-81

Damper Type

Vertical Fire Damper

Damper Size

12*12

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-21

Facility Location

William Patrick Day

Damper Location

E170

Inspector Name

James Futrell

Damper I.D. #

FD-82

Damper Type

Vertical Fire Damper

Damper Size

10*20

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Patch

Pass / Fail / Abandoned

Pass

Comments / Corrections

Added angle

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label



CUYAHOGA COUNTY DAMPER INSPECTION REPORT

Date of Inspection

2024-08-21

Facility Location

William Patrick Day

Damper Location

E170

Inspector Name

James Futrell

Damper I.D. #

FD-83

Damper Type

Vertical Fire Damper

Damper Size

32*16

Damper Manufacturer

Unknown

Damper Model #

Unknown

Fusible Link Temperature

165 Degrees

Access Door Size

Open

Pass / Fail / Abandoned

Pass

Comments / Corrections

None

Picture of Damper in Open Position



Picture of Damper in Closed Position



Picture of Damper I.D. Label

